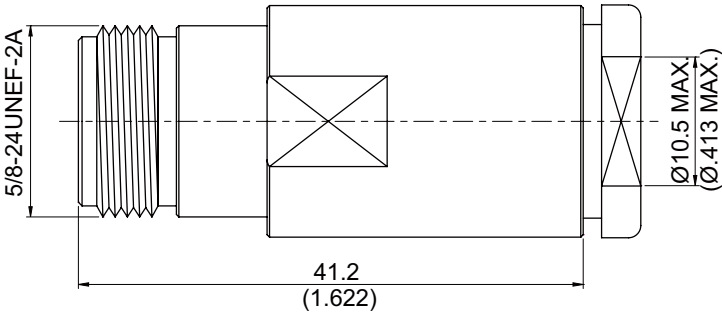


N8200BL-L400	N Jack Clamp	50Ω																								
																										
<table border="1"> <thead> <tr> <th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr> </thead> <tbody> <tr> <td>Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Gasket</td><td>Silicon</td><td></td></tr> <tr> <td>Braid Clamp</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Contact Pin</td><td>Phosphor Bronze</td><td>Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20</td></tr> <tr> <td>Insulator</td><td>Teflon</td><td></td></tr> <tr> <td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> </tbody> </table>	Parts	Material	Plating (Micro-inch)	Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Contact Pin	Phosphor Bronze	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50		
Parts	Material	Plating (Micro-inch)																								
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																								
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																								
Gasket	Silicon																									
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																								
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20																								
Insulator	Teflon																									
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																								
Weight: Suitable Cables: JBY400																										

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N8200BL-L400

JYE BAO CO., LTD.

N8200BL-L400

DATE

2014/04/29

REV

—

A

B

 
C

D

E

F

G



BODY

CONTACT
PIN

WASHER

BRAID
CLAMP


GASKET

WASHER


NUT

DIAGRAM


ASSEMBLY INSTRUCTION

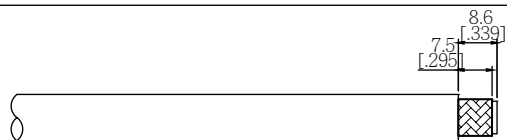


Step 1: STRIP AS SHOWN.

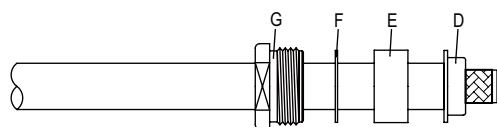


Step 2: SLIDE NUT " G ", WASHER " F ", GASKET " E " AND BRAID CLAMP " D " OVER CABLE.

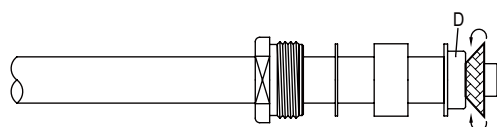


Step 3: WRAP THE BRAIDING OVER " D ".

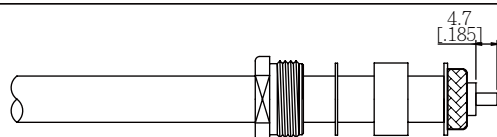

Step 4: STRIP AS SHOWN.

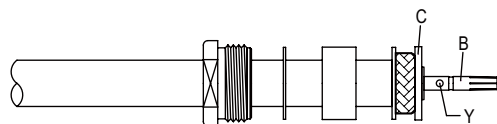

Step 5: SLIDE PREPARED CABLE INTO WASHER " C ".
Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".

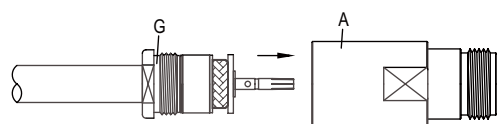

Step 7: FINALLY SCREW " G " ON THE CONNECTOR BODY " A ".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.