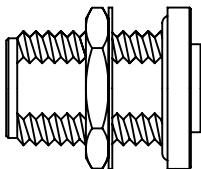
 
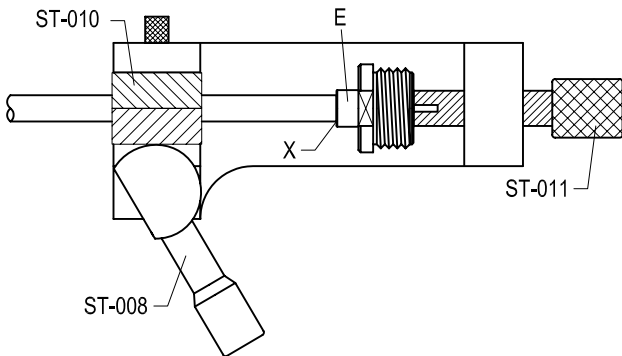
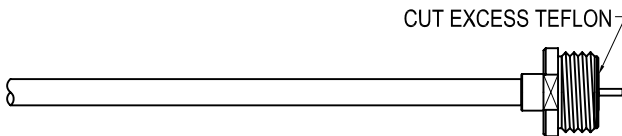
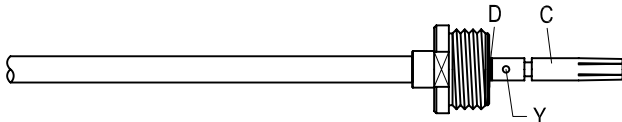
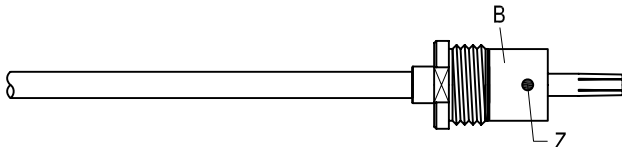
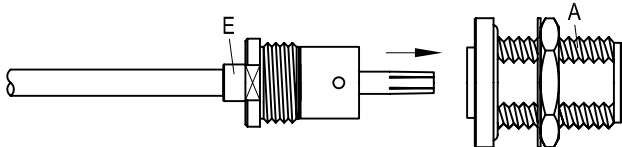


JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N8305-0141/EP		DATE	2015/07/31	REV	—
A		B	C	D	E
					
BODY + GASKET + WASHER + HEX NUT		INSULATOR	CONTACT PIN	INSULATOR	SOLDER NUT
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: USE SOLDERING FIXTURE " ST-008 ", INSERT TOOL " ST-010 " AND LOCATOR TOOL " ST-011 " TO FIX THE SOLDER NUT " E ". SOLDER IN " X ".		
			Step 3: CUT AWAY ANY EXCESS TEFLON STICKING OUT OF THE SOLDER NUT.		
			Step 4: PUT INSULATOR " D " AND CONTACT PIN " C " ON CENTER CONDUCTOR AND SOLDER IN " Y ".		
			Step 5: PUT INSULATOR " B " ON CONTACT PIN AND ADD EPOXY IN " Z ".		
			Step 6: SCREW SOLDER NUT " E " ON THE CONNECTOR BODY " A ".		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	