

TNC Isolated Jack Crimp For Bulkhead 50Ω

CABLE ASSEMBLY INSTRUCTION

TNC8105T-0058

JYE BAO CO., LTD.

TNC8105T-0058

DATE

2014/04/29


REV

—

A

B

C

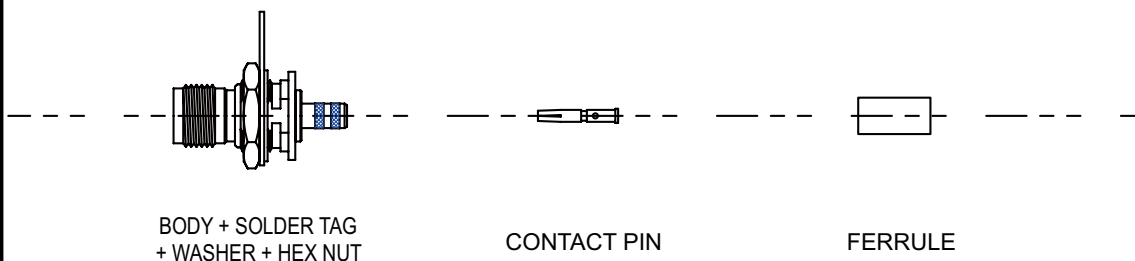


BODY + SOLDER TAG
+ WASHER + HEX NUT

CONTACT PIN


FERRULE

DIAGRAM


ASSEMBLY INSTRUCTION

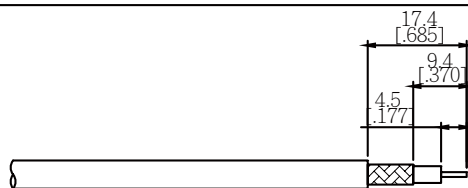

 
Step 1: STRIP AS SHOWN.



Step 2: SLIDE FERRULE "C" OVER CABLE.
Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN "Y".
(USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-B IF CRIMPED)

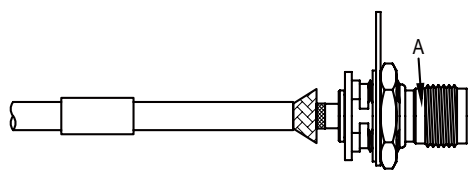

Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "A" IN PLACE.

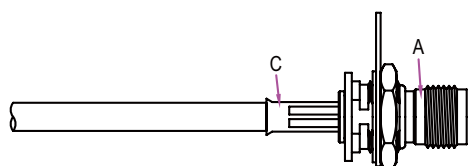

Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP.
(USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.