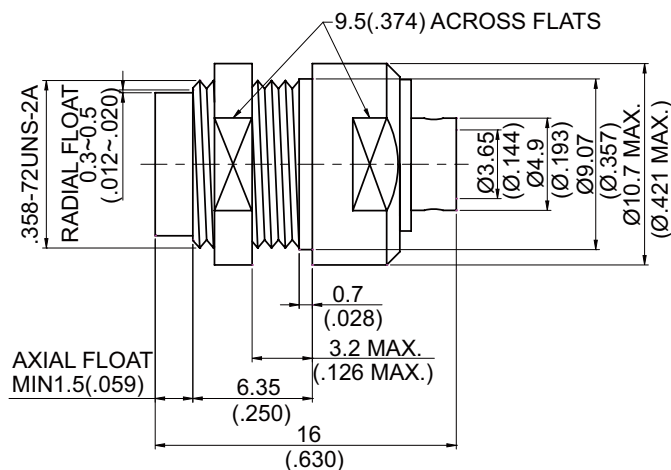


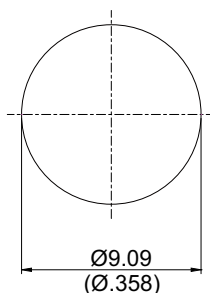
BMA8305-0141/W

BMA jack solder bulkhead for RG402

50Ω



MOUNTING HOLES



NOTE: Spring finger desing allows for ease

Parts	Material	Plating (Micro-inch)
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Spring Washer	Beryllium Copper	Gold 4 Over Nickel-Phosphorus 80 Over Copper 20
Spring Ring	Beryllium Copper	Gold 4 Over Nickel-Phosphorus 80 Over Copper 20
Ferrule	Brass	Gold 4 Over Nickel-Phosphorus 80 Over Copper 20
Spring	Stainless Steel	Passivated
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
E-Ring	Stainless Steel	Passivated
Contact Pin	Beryllium Copper	Gold 4 Over Nickel-Phosphorus 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

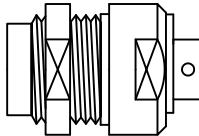
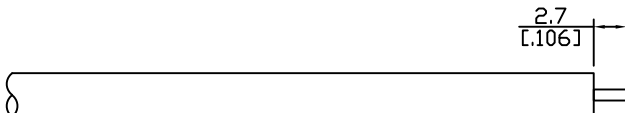
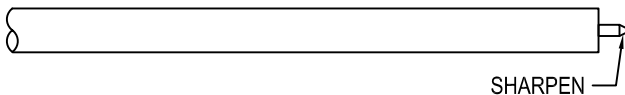
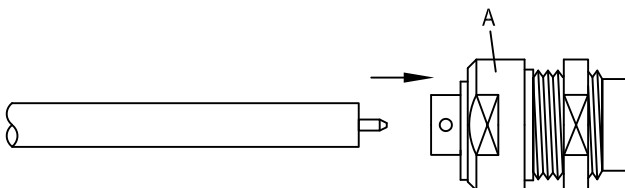
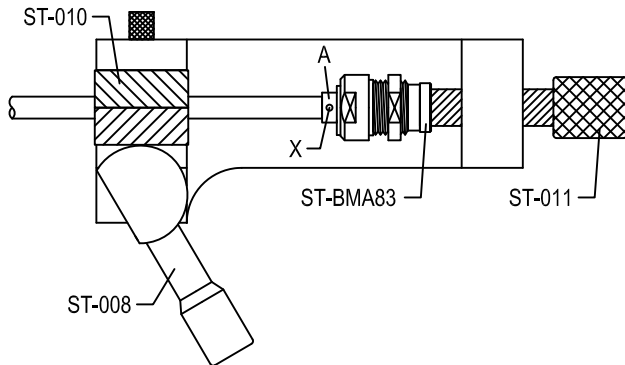
Suitable Cables:Semi-rigid.141

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

BMA8305-0141/W		DATE	2020/11/06	REV	—
A  BODY					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SHARPEN CENTER CONDUCTOR TIP.		
			Step 3: SLIDE CABLE INTO CONNECTOR BODY "A".		
			Step 4: USE SOLDERING FIXTURE " ST-008 ", INSERT TOOL " ST-010 " AND LOCATOR TOOL " ST-011 " AND " ST-BMA83 " TO FIX THE CONNECTOR. SOLDER IN " X ".		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	