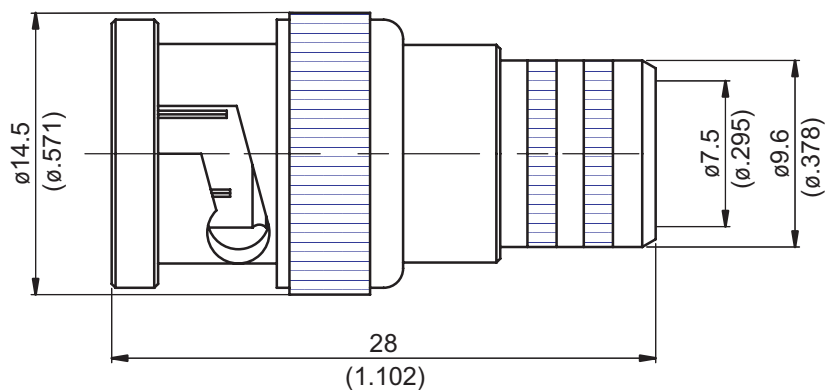


BNC6100-L400

BNC Reverse Polarity Plug Crimp 50Ω



NOTE: REVERSE POLARITY PLUG

Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Phosphor Bronze	Gold 3 Over Nickel 50 Over Copper 50
Gasket	Silicon	
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Spring	SK5	
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:







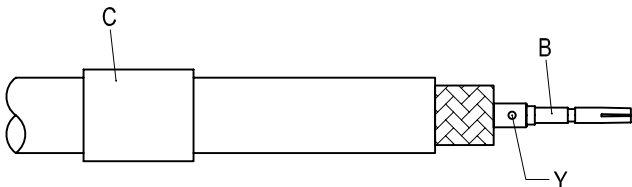
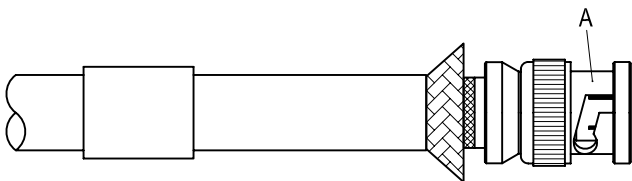
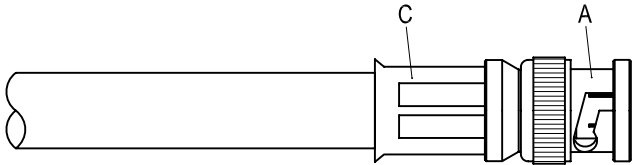
Suitable Cables: JBY400

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

BNC6100-L400		DATE	2016/04/18	REV	—									
<table><tr><td>A</td><td>B</td><td>C</td></tr><tr><td></td><td></td><td></td></tr><tr><td>BODY</td><td>CONTACT PIN</td><td>FERRULE</td></tr></table>						A	B	C				BODY	CONTACT PIN	FERRULE
A	B	C												
														
BODY	CONTACT PIN	FERRULE												
DIAGRAM			ASSEMBLY INSTRUCTION											
			Step 1: STRIP AS SHOWN.											
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".											
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.											
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 10.7mm/0.421inch HEX SECTION OF INSERT-C)											
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.														
APPROVED		CHECKED		DRAWING										
				Albert										