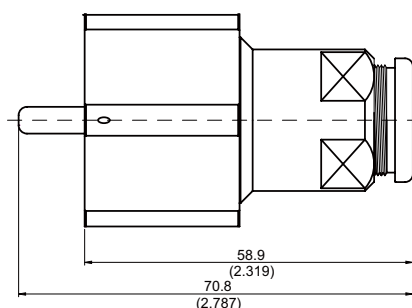
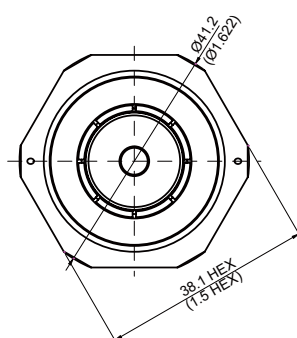


LC3200-0217

LC Plug Clamp

50Ω



Parts	Material	Plating (Micro-inch)
Gasket	Silicon	
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Silver 150 Over Copper 50
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Bush	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

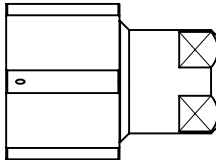

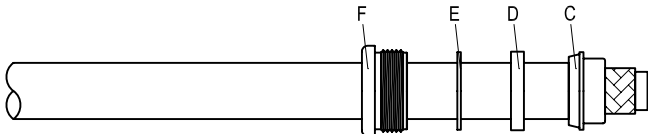
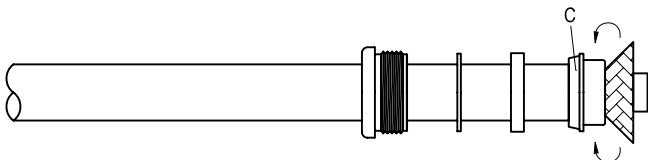
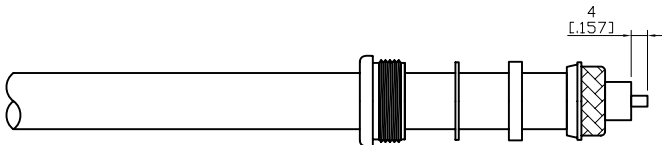
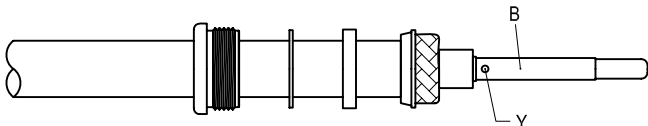
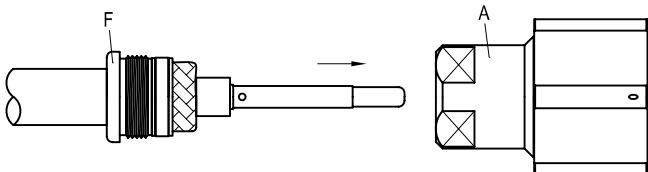
Suitable Cables: RG217

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

LC3200-0217		DATE	2015/09/02	REV	—
A	B	C	D	E	F
					
BODY	CONTACT PIN	TOP HAT	GASKET	WASHER	NUT
DIAGRAM		ASSEMBLY INSTRUCTION			
		Step 1: STRIP AS SHOWN.			
		Step 2: SLIDE NUT " F " 、 WASHER " E " 、 GASKET " D " AND TOP HAT " C " OVER CABLE.			
		Step 3: WRAP THE BRAIDING OVER " C " .			
		Step 4: STRIP AS SHOWN.			
		Step 5: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y " .			
		Step 6: FINALLY SCREW NUT " F " ON THE CONNECTOR BODY " A " .			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	