


N3100BA-0011

N Plug Crimp

75Ω

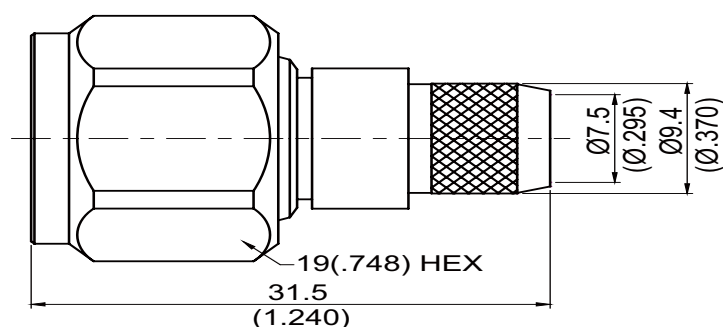

Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:
Suitable Cables:RG11

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N3100BA-0011

JYE BAO CO., LTD.

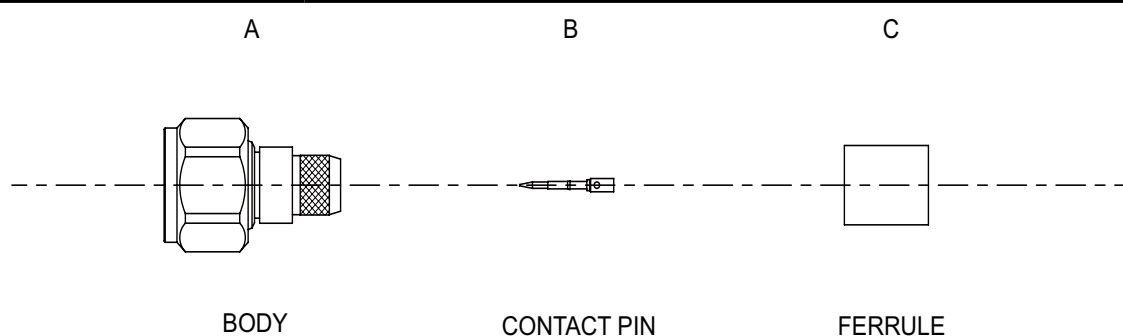


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE FERRULE "C" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN "Y". (USE 1.6mm/0.063inch SQUARE SECTION OF INSERT-C IF CRIMPED)
	Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "A" IN PLACE.
	Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP. (USE 10.7mm/0.421inch HEX SECTION OF

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.