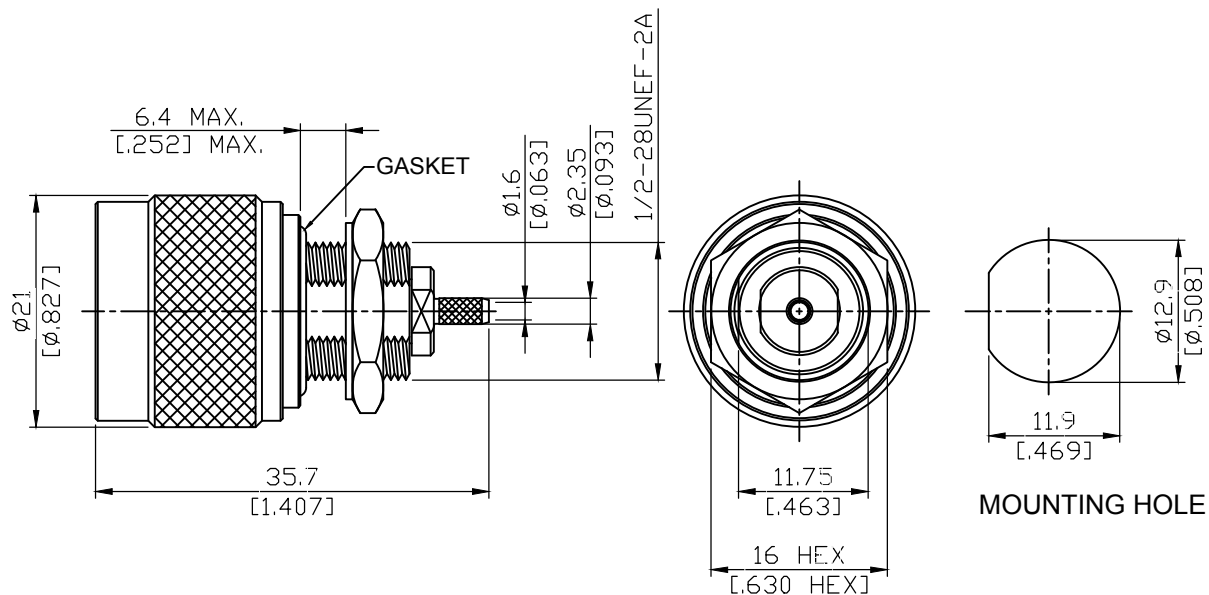


N3105DS-0316

N Plug Crimp Bulkhead For
RD316,RD316-FEP

50Ω



Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Hex Nut	Stainless Steel	Passivated
Washer	Stainless Steel	Passivated
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicone	
Contact Body	Stainless Steel	Passivated
Barrel	Stainless Steel	Passivated
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Stainless Steel	Passivated
Coupling Nut	Stainless Steel	Passivated

Suitable Cables: RD316, RD316-FEP, RD316-LSFH

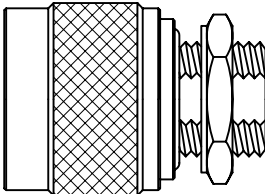


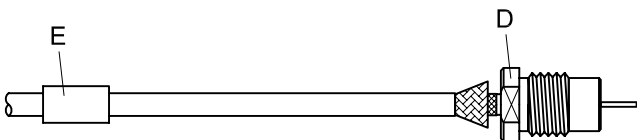
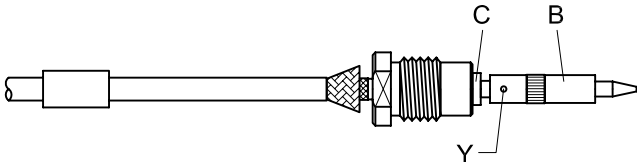
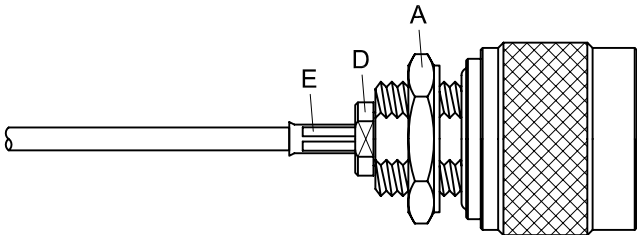
IP67 (Mated)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications demand appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3105DS-0316		DATE		REV	—
A	B	C	D	E	
					
BODY + GASKET + WASHER + HEX NUT	CONTACT PIN	INSULATOR	BARREL	FERRULE	
DIAGRAM		ASSEMBLY INSTRUCTION			
		Step 1: STRIP AS SHOWN.			
		Step 2: SLIDE FERRULE " E " OVER CABLE. Step 3: LOOSEN BRAIDING AND SLIDE BARREL " D " IN PLACE.			
		Step 4: PUT INSULATOR " C " AND PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".			
		Step 5: SCREW BARREL " D " ON THE CONNECTOR BODY " A ". Step 6: SLIDE FERRULE " E " TOWARDS THE BARREL " D " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	