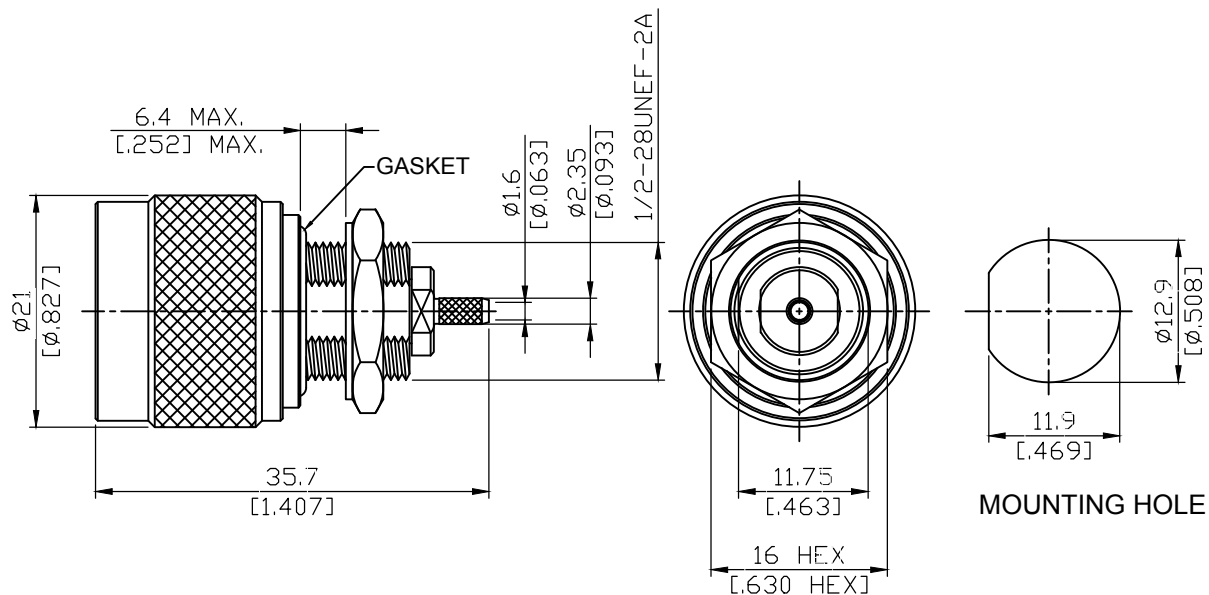


N3105S-0316

N Plug Crimp Bulkhead For
RG174, RG188, RG316

50Ω



IP68 (Mated)

Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Hex Nut	Stainless Steel	Passivated
Washer	Stainless Steel	Passivated
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicone	
Contact Body	Stainless Steel	Passivated
Barrel	Stainless Steel	Passivated
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Stainless Steel	Passivated
Coupling Nut	Stainless Steel	Passivated

Suitable Cables: RG174, RG188, RG316, RG316-FEP, RG316-LSFH

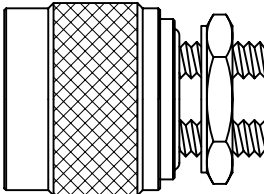


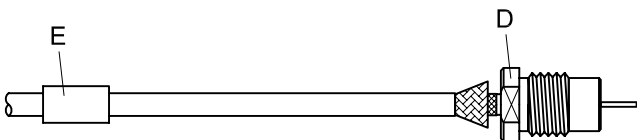
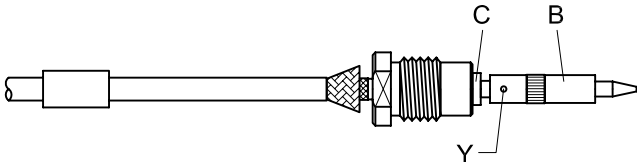
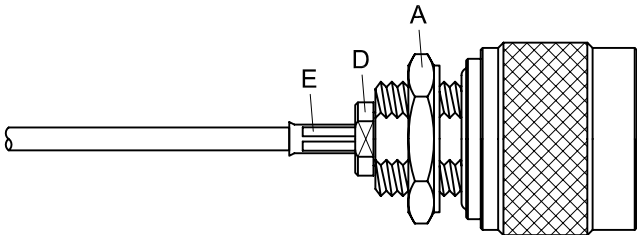
IP67 (Mated)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications demand appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3105S-0316		DATE	2015/09/24	REV	—
A		B	C	D	E
					
BODY + GASKET + WASHER + HEX NUT		CONTACT PIN	INSULATOR	BARREL	FERRULE
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " E " OVER CABLE. Step 3: LOOSEN BRAIDING AND SLIDE BARREL " D " IN PLACE.		
			Step 4: PUT INSULATOR " C " AND PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".		
			Step 5: SCREW BARREL " D " ON THE CONNECTOR BODY " A ". Step 6: SLIDE FERRULE " E " TOWARDS THE BARREL " D " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	