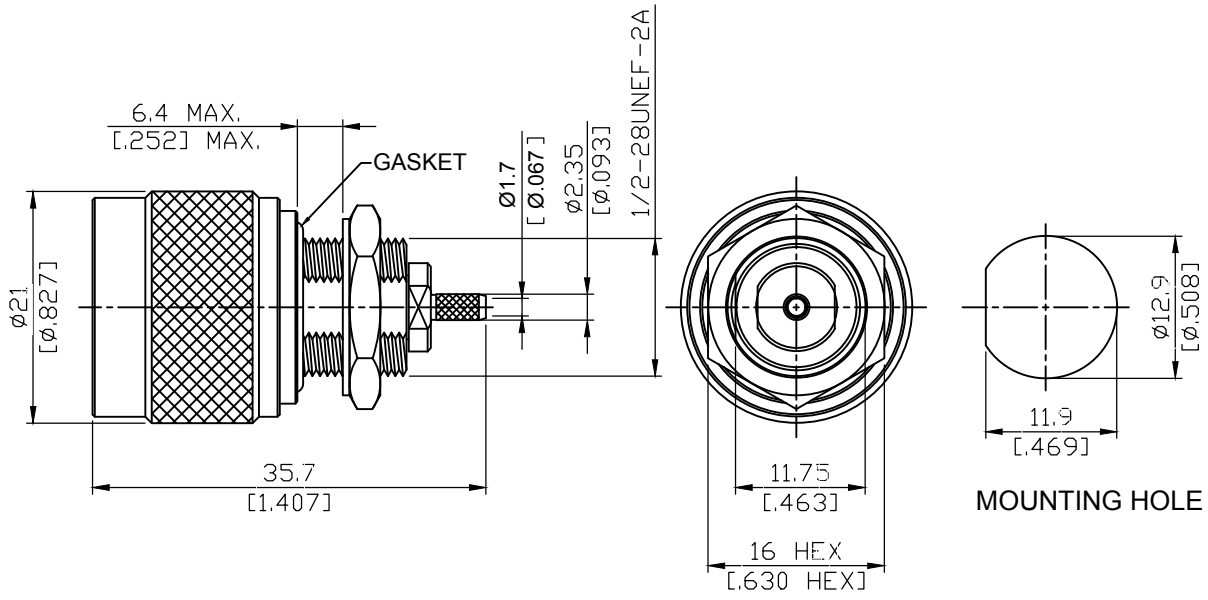


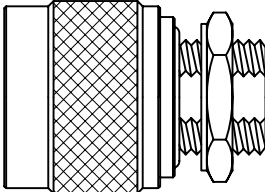

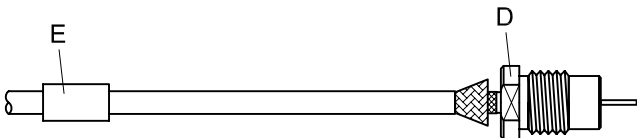
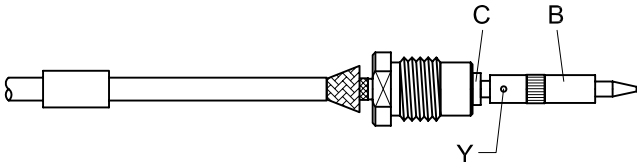
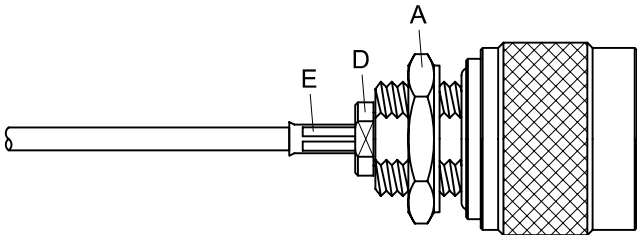
N3105S-L100		N Plug Crimp Bulkhead For JBY100,LMR100	50Ω
			
Parts	Material	Plating (Micro-inch)	
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	
Hex Nut	Stainless Steel	Passivated	
Washer	Stainless Steel	Passivated	
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	
Gasket	Silicone		
Contact Body	Stainless Steel	Passivated	
Barrel	Stainless Steel	Passivated	
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	
Insulator	Teflon		
Body	Stainless Steel	Passivated	
Coupling Nut	Stainless Steel	Passivated	
Suitable Cables: JBY100, LMR100			IP67 (Mated)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications demand appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3105S-L100		DATE		REV	—
A	B	C	D	E	
					
BODY + GASKET + WASHER + HEX NUT	CONTACT PIN	INSULATOR	BARREL	FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " E " OVER CABLE. Step 3: LOOSEN BRAIDING AND SLIDE BARREL " D " IN PLACE.		
			Step 4: PUT INSULATOR " C " AND PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".		
			Step 5: SCREW BARREL " D " ON THE CONNECTOR BODY " A ". Step 6: SLIDE FERRULE " E " TOWARDS THE BARREL " D " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	