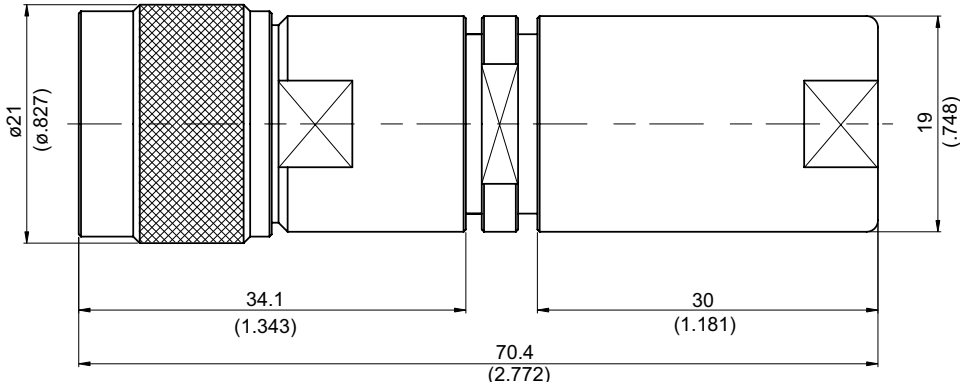


N3200B-0215	N Plug Clamp	50Ω																																	
																																			
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Braid Clamp</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Center Pin</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr><tr><td>Retainer Ring</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Contact Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>			Parts	Material	Plating (Micro-inch)	Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Insulator	Teflon		Center Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50	Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																																	
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Insulator	Teflon																																		
Center Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50																																	
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Gasket	Silicon																																		
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Weight: 90.54 g																																			
Suitable Cables: RG215																																			

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N3200B-0215

JYE BAO CO., LTD.


N3200B-0215

DATE

2014/04/29

REV


—



BODY



INSULATOR



CONTACT PIN



INSULATOR



WASHER




BRAID CLAMP




GASKET



WASHER




NUT




NUT

DIAGRAM


ASSEMBLY INSTRUCTION




Step 1: STRIP AS SHOWN.




Step 2: SLIDE NUT "J" · NUT "I" · WASHER "H" · GASKET "G" AND BRAID CLAMP "F" OVER CABLE.




Step 3: WRAP THE BRAIDING OVER "F".



Step 4: STRIP AS SHOWN.



Step 5: SLIDE PREPARED CABLE INTO WASHER "E" AND TEFLON "D".
Step 6: PUT CONTACT PIN "C" ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN "Y".
(USE 2.55mm/0.100inch HEX SECTION OF INSERT-C IF CRIMPED)



Step 7: SLIDE TEFLON "B" INTO CONNECTOR BODY "A".
Step 8: SCREW "I" ON THE CONNECTOR BODY "A".
Step 9: SCREW "J" ON THE NUT "I".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.