


N3200BA-9011

N Plug Clamp Right Angle

50Ω

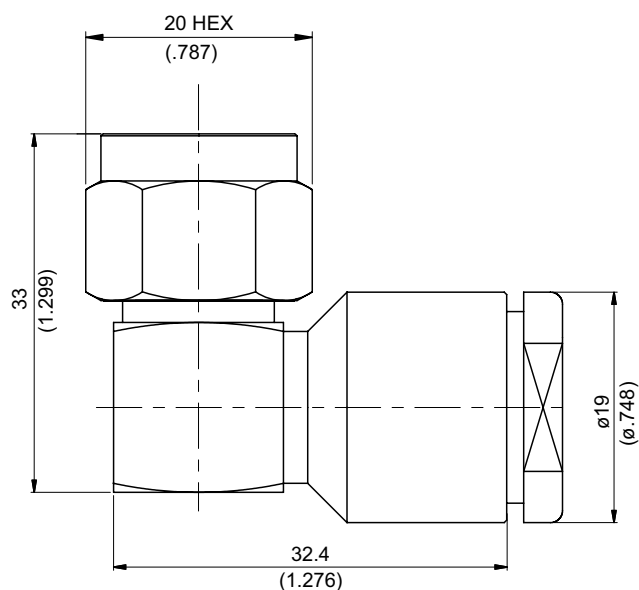

Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Center Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: RG11

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N3200BA-9011

JYE BAO CO., LTD.

N3200BA-0011

DATE

2014/04/29

REV

—

A

B


C

D

E

F

G

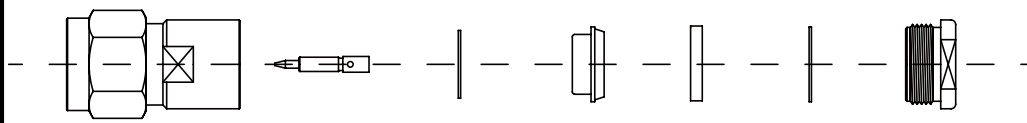

BODY

CONTACT
PIN

WASHER

BRAID
CLAMP


GASKET

WASHER


NUT

DIAGRAM


ASSEMBLY INSTRUCTION

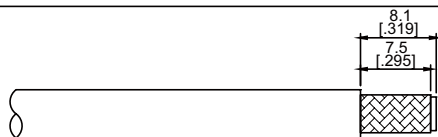


Step 1: STRIP AS SHOWN.

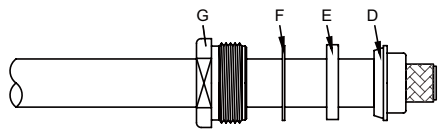


Step 2: SLIDE NUT " G " - WASHER " F " - GASKET " E " AND BRAID CLAMP " D " OVER CABLE.

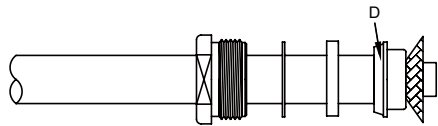


Step 3: WRAP THE BRAIDING OVER " D ".

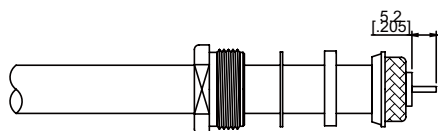

Step 4: STRIP AS SHOWN.

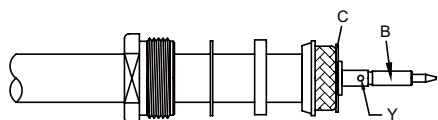

Step 5: PUT WASHER " C " AND CONTACT PIN " B " ON CENTER CONDUCTOR. SOLDER IN " Y ".

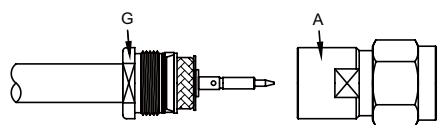

Step 6: FINALLY SCREW NUT " G " ON THE CONNECTOR BODY " A ".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.