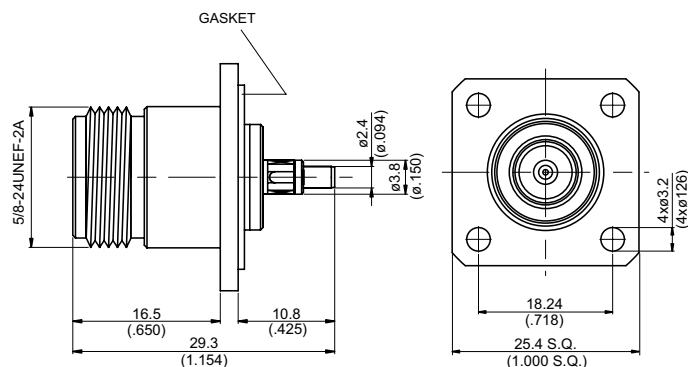
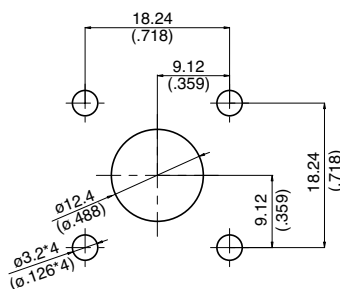


N8146A-0178

N Jack Crimp For Panel Receptacle 50Ω



MOUNTING HOLE



Parts	Material	Plating (Micro-inch)
Gasket	Silicon	
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Cover	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Beryllium Copper	Gold 4 Over Nickel Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:
Suitable Cables: RG178, RG178-FEP, RG196

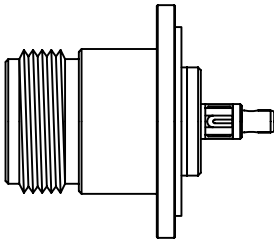
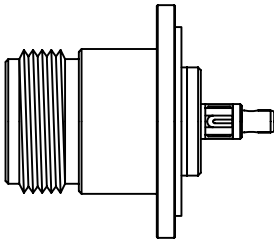
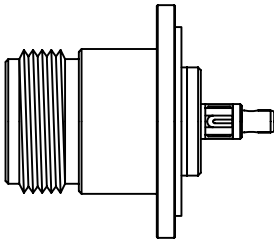
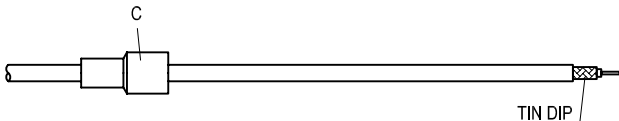
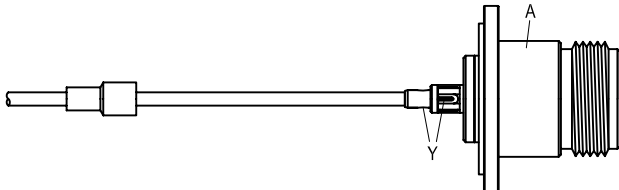
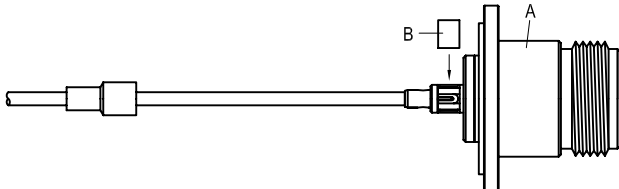
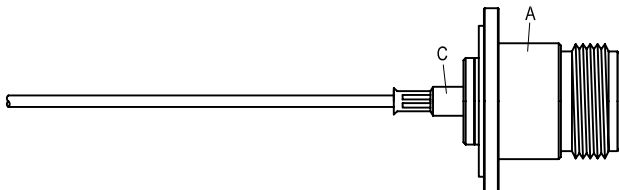
IP67(Mated)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N8146A-0178		DATE	2015/07/20	REV	—									
<table><tr><td>A</td><td>B</td><td>C</td></tr><tr><td></td><td></td><td></td></tr><tr><td>BODY + GASKET</td><td>COVER</td><td>FERRULE</td></tr></table>						A	B	C				BODY + GASKET	COVER	FERRULE
A	B	C												
														
BODY + GASKET	COVER	FERRULE												
DIAGRAM			ASSEMBLY INSTRUCTION											
			Step 1: STRIP AS SHOWN.											
			Step 2: TIN DIP BRAIDING. Step 3: SLIDE FERRULE " C " OVER CABLE.											
			Step4: INSERT CABLE'S CENTER CONDUCTOR INTO CONNECTOR BODY " A " AND SOLDER IN " Y ".											
			Step 4: PUT COVER " B " ON BODY " A ".											
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 2.7mm/0.106inch HEX SECTION OF INSERT-A)											
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.														
APPROVED		CHECKED		DRAWING										
				Albert										