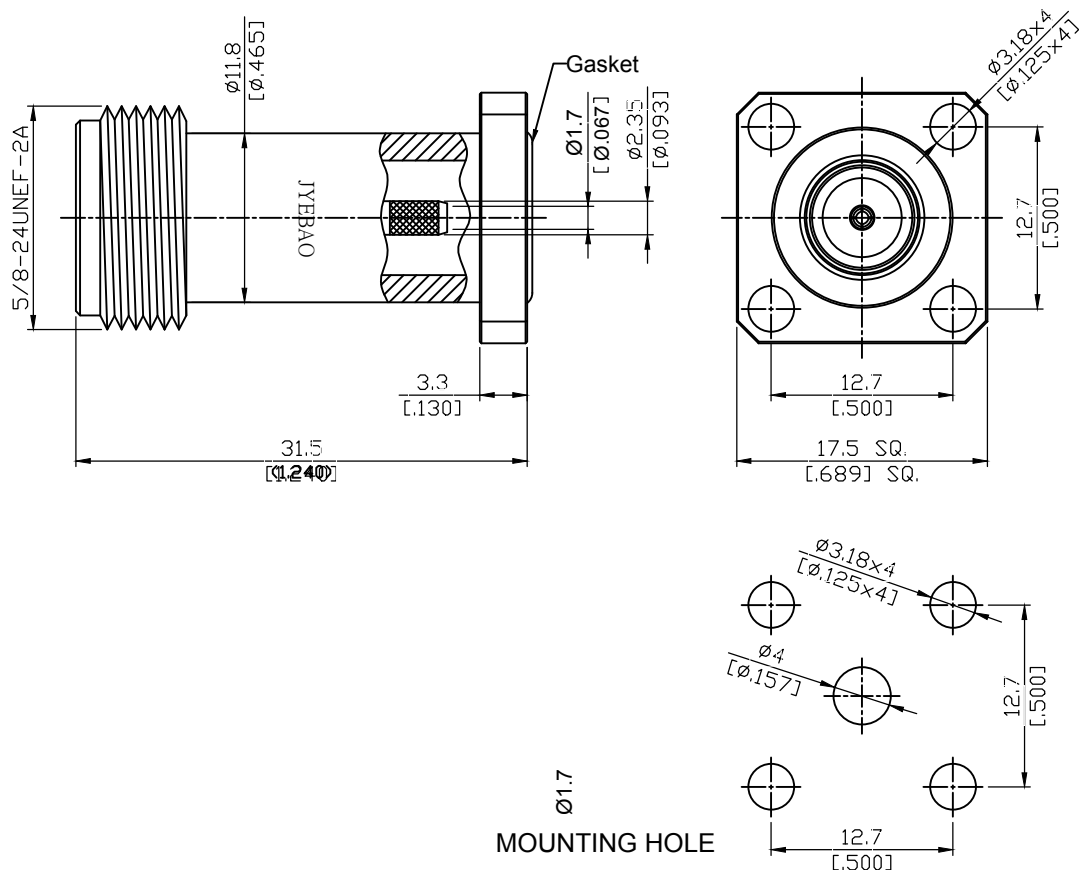


N8146L9-L100/NI

N Jack Crimp 4 Hole Flange For
JBY100, LMR100

50Ω



Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Nickel 200 Over Copper 50
Barrel	Brass	Nickel 200 Over Copper 50
Small Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Gasket	Silicone	
Contact Pin	P.Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Nickel 200 Over Copper 50

Suitable Cables: JBY100, LMR100

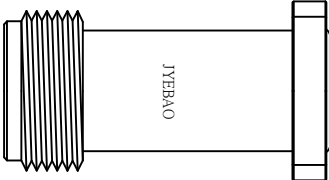

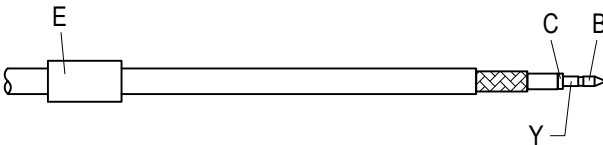
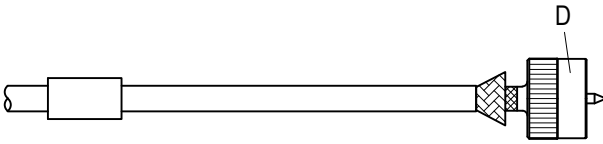
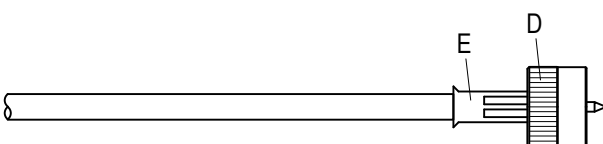
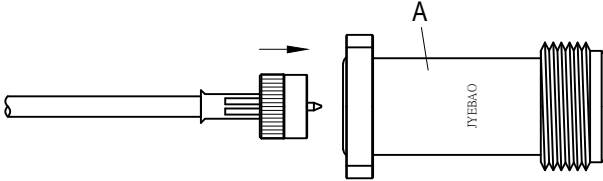
IP67 (Mated)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications demand appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N8146L9-L100/NI		DATE		REV	—
A	B	C	D	E	
					
BODY	CONTACT PIN	INSULATOR	BARREL	FERRULE	
DIAGRAM		ASSEMBLY INSTRUCTION			
		Step 1: STRIP AS SHOWN.			
		Step 2: SLIDE FERRULE " E " OVER CABLE. Step 3: PUT INSULATOR " C " AND PIN " B " ON CENTER CONDUCTOR AND CRIMP IN " Y ". (USE SQUARE 0.7mm/0.028inch SECTION OF INSERT-A)			
		Step 4: LOOSEN BRAIDING AND SLIDE BARREL " D " IN PLACE.			
		Step 5: SLIDE FERRULE " E " TOWARDS THE BARREL " D " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)			
		Step 6: PRESS FIT CABLE INTO CONNECTOR BODY " A ".			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	