



N8246-0214

N Jack Clamp For Panel Receptacle 50Ω

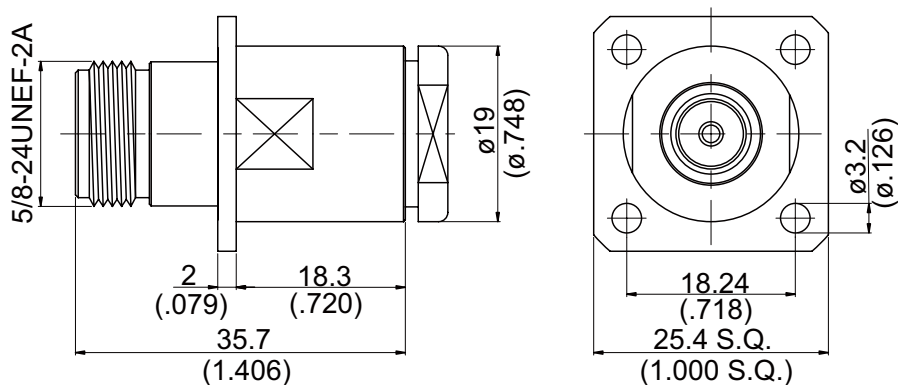

MOUNTING HOLE :

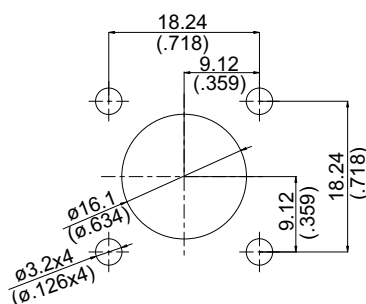

Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Phosphor Bronze	Gold 5 Over Nickel 50 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 56.04 g

Suitable Cables: RG214

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N8246-0214

JYE BAO CO., LTD.

N8246-0214

DATE

2014/04/29

REV

—

A

B


C

D

E

F

G



BODY

CONTACT
PIN

WASHER

BRAID
CLAMP

GASKET

WASHER


NUT

DIAGRAM


ASSEMBLY INSTRUCTION




Step 1: STRIP AS SHOWN.




Step 2: SLIDE NUT " G ", WASHER " F ", GASKET " E " AND BRAID CLAMP " D " OVER CABLE.

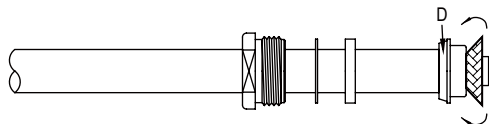


Step 3: WRAP THE BRAIDING OVER " D ".

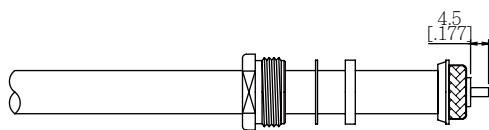

Step 4: STRIP AS SHOWN.



Step 5: SLIDE PREPARED CABLE INTO WASHER " C ".
Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ".
(USE SQUARE 2.4mm/0.094inch SECTION OF INSERT-A IF CRIMPED)

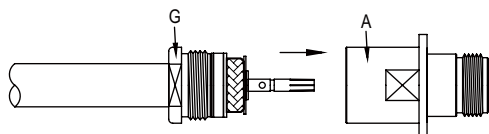

Step 7: FINALLY SCREW " G " ON THE CONNECTOR BODY " A ".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.