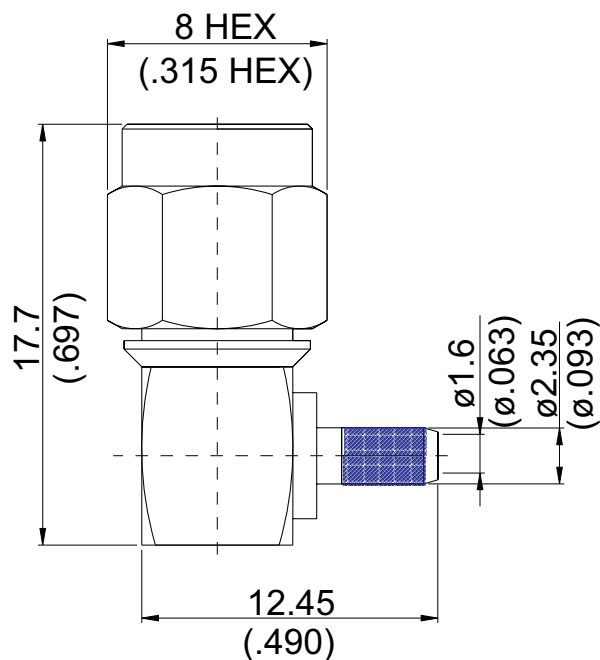


SMA3100DS-9316

SMA Plug Crimp Right Angle
For RD316,RD316-FEP; 11GHz VSWR 1.25 **50Ω**



Parts	Material	Plating(Micro-inch)
Ferrule	Copper	Tin-zinc-Copper-alloy 100 Over Oppor 50
Cover	Brass	Tin-zinc-Copper-alloy 100 Over Oppor 50
Retainer Ring	Beryllium Copper	Tin-zinc-Copper-alloy 100 Over Oppor 50
Gasket	Silicon	
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Barrel	Stainless	Passivated
Body	Stainless	Passivated
Coupling Nut	Stainless	Passivated

Suitable Cables: RD316, RD316-FEP

This part number complies with RoHS.

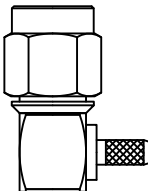
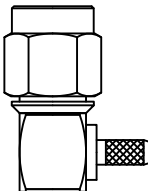
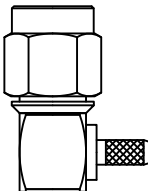
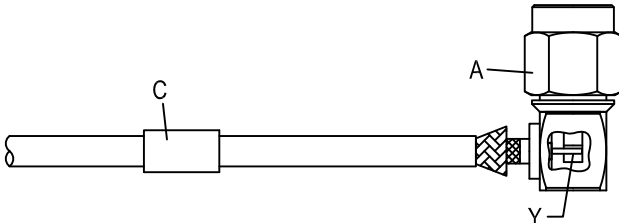
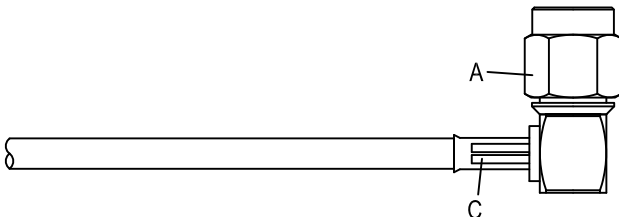
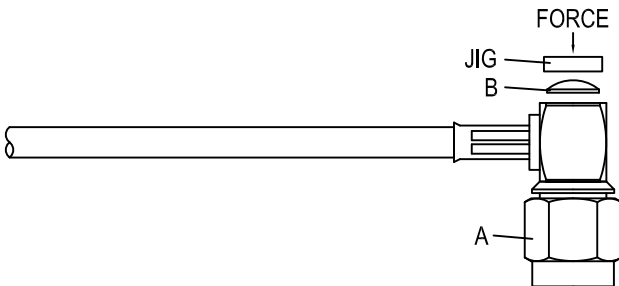
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SMA	SMA3100DS-9316
Interface MIL-STD-348B Mechanically compatible with 2.92 & 3.5	
Electrical Data Impedance 50Ω Frequency range DC to 11GHz VSWR ≤ 1.25 (DC to 11GHz) Insertion loss $\leq 0.04 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 5000\text{M}\Omega$ Contact resistance inner conductor $\leq 3\text{m}\Omega$ Contact resistance outer conductor $\leq 2\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 750 V rms Working voltage (at sea level) 250 V rms	
Mechanical Data Recommended coupling nut torque 7 to 9.5 inch lbs Coupling proof torque 15 inch lbs Coupling nut retention force ≥ 60.7 lbs Contact Captivation-axial ≥ 6.1 lbs Durability (mating) ≥ 500	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-A	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMA3100DS-9316		DATE	2019/11/10	REV	—									
<table><tr><td>A</td><td>B</td><td>C</td></tr><tr><td></td><td></td><td></td></tr><tr><td>BODY</td><td>COVER</td><td>FERRULE</td></tr></table>						A	B	C				BODY	COVER	FERRULE
A	B	C												
														
BODY	COVER	FERRULE												
DIAGRAM			ASSEMBLY INSTRUCTION											
			Step 1: STRIP AS SHOWN.											
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".											
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)											
			Step 6: PRESS ON THE TOP OF " B " WITH JIGS.											
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.														
APPROVED		CHECKED		DRAWING										
				Albert										

SMA3100DS-9316

