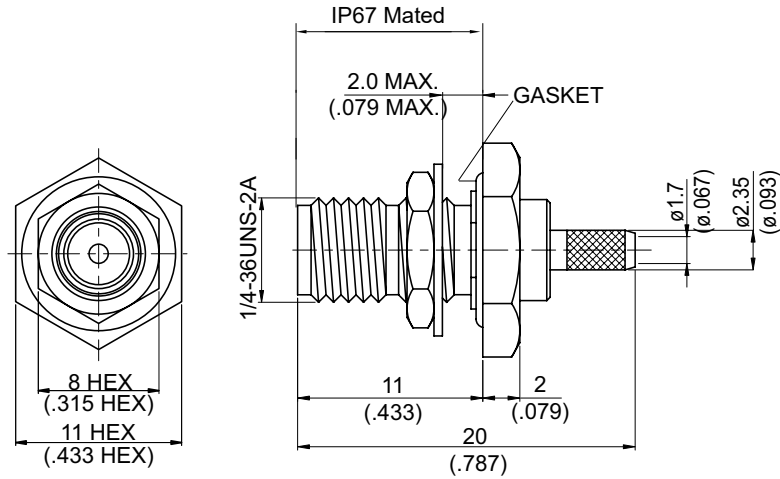
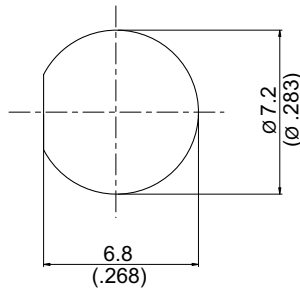


SMA9105-L100

SMA jack reverse polarity crimp bulkhead, 50Ω
IP67 mated, For JBY100, LMR100; 3GHz VSWR 1.2



MOUNTING HOLE



Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Hex Nut	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Lock Washer	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Gasket	Silicon	
Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20

Weight: 4.34g

Suitable Cables: JBY100, LMR100

This part number complies with RoHS.

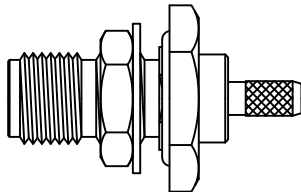


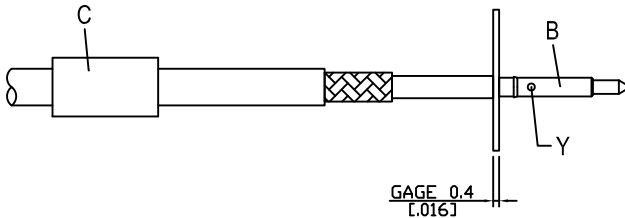
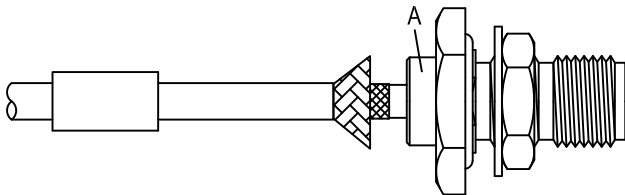
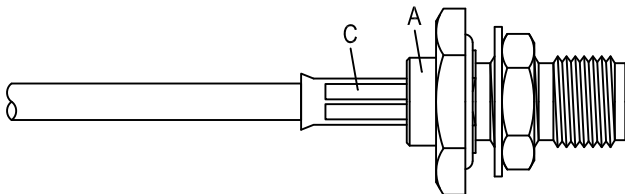
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

SMA	SMA9105-L100
Interface Per JYEBAO SMA Reverse Polarity Jack derived from MIL-STD-348B	
Electrical Data	
Impedance	50Ω
Frequency range	DC to 3GHz
VSWR	≤ 1.2 (DC to 3GHz)
Insertion loss	$\leq 0.04 \times \sqrt{f(\text{GHz})}$ dB
Insulation resistance	$\geq 5000\text{M}\Omega$
Contact resistance inner conductor	$\leq 3\text{m}\Omega$
Contact resistance outer conductor	$\leq 2\text{m}\Omega$
Dielectric withstanding voltage (at sea level)	750 V rms
Working voltage (at sea level)	250 V rms
Mechanical Data	
Recommended coupling nut torque	4 inch lbs
Coupling proof torque	5.3 inch lbs
Contact Captivation-axial	≥ 6.1 lbs
Durability (mating)	≥ 100
Environmental Data	
Temperature range	-65°C to +165°C
Thermal shock	MIL-STD-202, Method 107, Condition B
Moisture resistance	MIL-STD-202, Method 106
Corrosion	MIL-STD-202, Method 101, Condition B
RoHS	Compliant
Tooling	
Crimping tool	CRT-1 or CRT-2
Crimp insert	INSERT-A
Soldering gauge	ST-0.4

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMA9105-L100		DATE	2015/12/15	REV	—
A		B		C	
					
BODY		CONTACT PIN		FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT 0.4 MM GAGE IN PLACE, INSERT CABLE'S CENTER CONDUCTOR INTO CENTER PIN " B " AND SOLDER IN " Y ". (USE SQUARE 0.98mm/0.039inch SECTION OF INSERT-A IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

SMA9105-L100

S11

