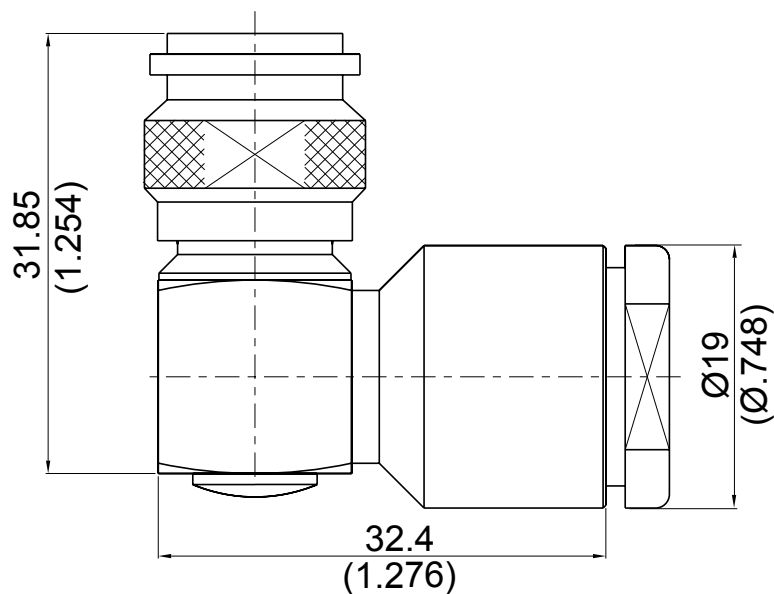


TNC3200B-9011

TNC Plug Clamp Right Angle 75Ω



Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 3 Over Nickel 50 Over Copper 50
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Spring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

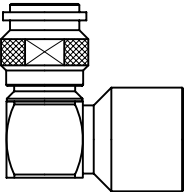

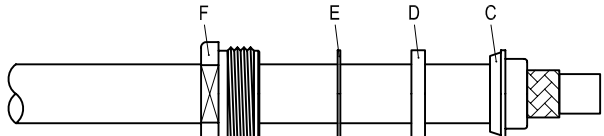
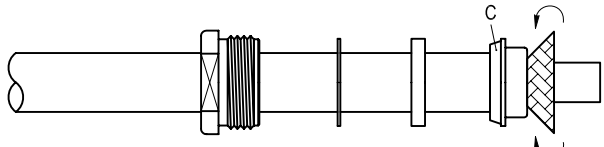
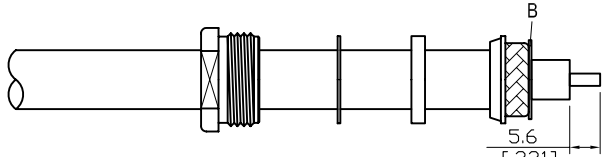
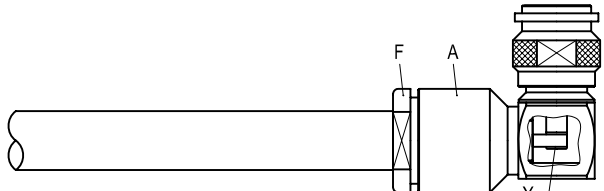
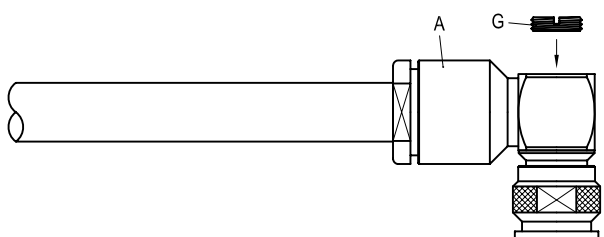
Suitable Cables: RG11

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

TNC3200B-9011			DATE	2017/07/06		REV	—
A	B	C	D	E	F	G	
							
BODY	WASHER	BRAID CLAMP	GASKET	WASHER	NUT	NUT	
DIAGRAM			ASSEMBLY INSTRUCTION				
			Step 1: STRIP AS SHOWN.				
			Step 2: SLIDE NUT " F " 、 WASHER " E " 、 GASKET " D " AND BRAID CLAMP " C " OVER CABLE.				
			Step 3: WRAP THE BRAIDING OVER " C ".				
			Step 4: STRIP AS SHOWN. Step 5: SLIDE PREPARED CABLE INTO WASHER " B ".				
			Step 6: SCREW NUT " F " ON THE CONNECTOR BODY " A " AND SOLDER IN " Y ".				
			Step 7: FINALLY SCREW NUT " G " ON THE CONNECTOR BODY " A ".				
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.							
APPROVED		CHECKED			DRAWING		
					Albert		