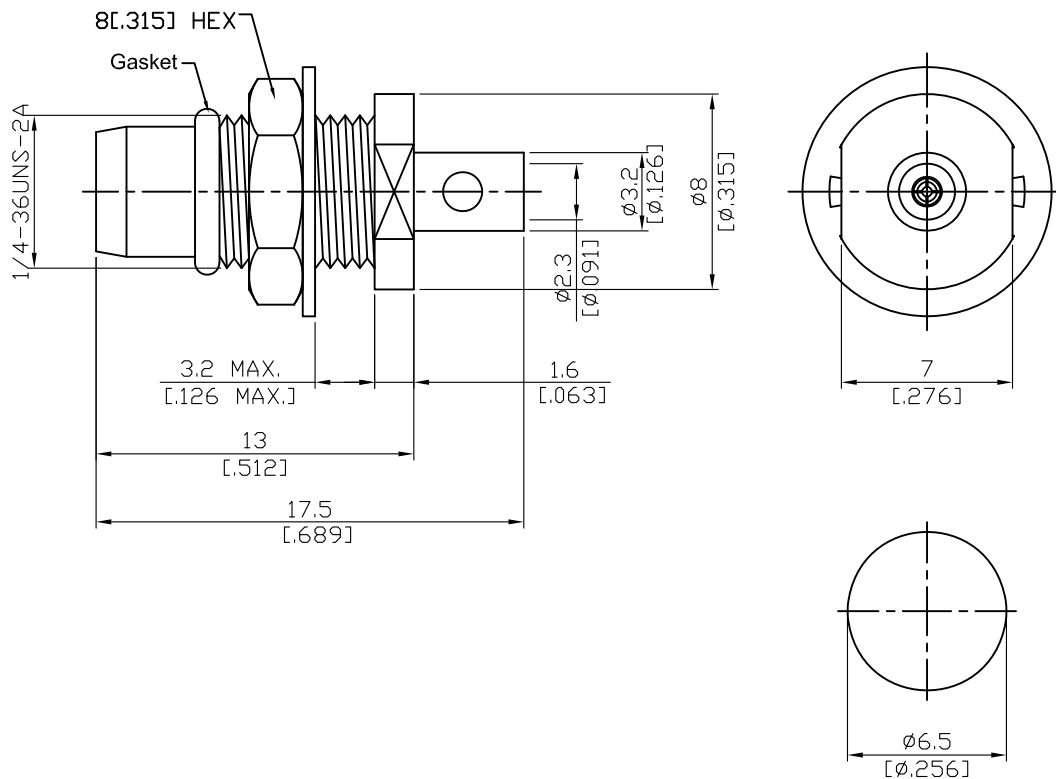


BMA3305BS-0085/50G

BMA Plug Solder Bulkhead For RG405;
18GHz VSWR 1.25

50Ω



MOUNTING HOLE

Parts	Material	Plating (Micro-inch)
Body	Stainless Steel	Gold 5 over Nickel 50 over Copper 50
Contact Pin	Beryllium Copper	Gold 50 over Nickel 50 over Copper 50
Insulator	Teflon	
Gasket	Silicone	
Lock Washer	Stainless Steel	Passivated
Hex Nut	Stainless Steel	Passivated

Suitable Cables: .085semi-rigid; .085 conformable

This part number complies with RoHS.

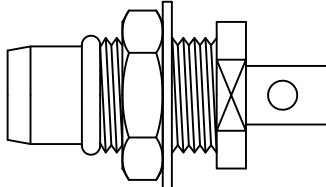

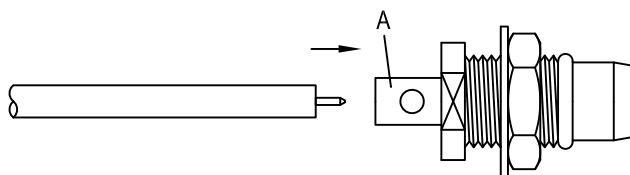
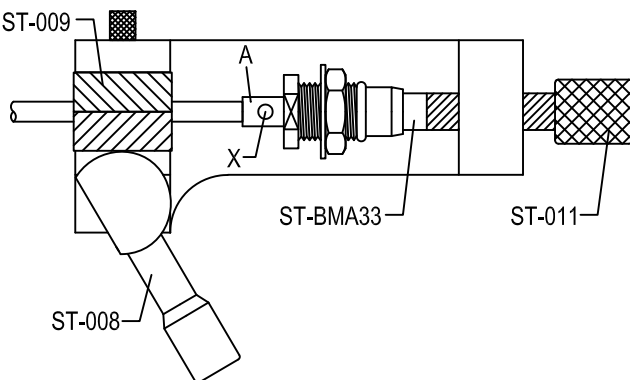
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

BMA	BMA3305BS-0085/50G																		
Interface MIL-STD-348B																			
Electrical Data <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 18GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.25 (DC to 18GHz)</td></tr> <tr> <td>Insertion loss</td><td>≤ 0.03 x √f(GHz) dB</td></tr> <tr> <td>Insulation resistance</td><td>≥ 5000MΩ</td></tr> <tr> <td>Contact resistance inner conductor</td><td>≤ 2mΩ</td></tr> <tr> <td>Contact resistance outer conductor</td><td>≤ 2mΩ</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>1000 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>670 V rms</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 18GHz	VSWR	≤ 1.25 (DC to 18GHz)	Insertion loss	≤ 0.03 x √f(GHz) dB	Insulation resistance	≥ 5000MΩ	Contact resistance inner conductor	≤ 2mΩ	Contact resistance outer conductor	≤ 2mΩ	Dielectric withstanding voltage (at sea level)	1000 V rms	Working voltage (at sea level)	670 V rms
Impedance	50Ω																		
Frequency range	DC to 18GHz																		
VSWR	≤ 1.25 (DC to 18GHz)																		
Insertion loss	≤ 0.03 x √f(GHz) dB																		
Insulation resistance	≥ 5000MΩ																		
Contact resistance inner conductor	≤ 2mΩ																		
Contact resistance outer conductor	≤ 2mΩ																		
Dielectric withstanding voltage (at sea level)	1000 V rms																		
Working voltage (at sea level)	670 V rms																		
Mechanical Data <table> <tr> <td>Engagement force</td><td>≤ 3 lbs</td></tr> <tr> <td>Disengagement force</td><td>≤ 1.5 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.1 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 1000</td></tr> </table>		Engagement force	≤ 3 lbs	Disengagement force	≤ 1.5 lbs	Contact captivation-axial	≥ 6.1 lbs	Durability (mating)	≥ 1000										
Engagement force	≤ 3 lbs																		
Disengagement force	≤ 1.5 lbs																		
Contact captivation-axial	≥ 6.1 lbs																		
Durability (mating)	≥ 1000																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling <table> <tr> <td>Locator tool</td><td>ST-011, ST-BMA33</td></tr> <tr> <td>Soldering fixture</td><td>ST-008</td></tr> <tr> <td>Insert for .085inch semi-rigid cable</td><td>ST-009</td></tr> </table>		Locator tool	ST-011, ST-BMA33	Soldering fixture	ST-008	Insert for .085inch semi-rigid cable	ST-009												
Locator tool	ST-011, ST-BMA33																		
Soldering fixture	ST-008																		
Insert for .085inch semi-rigid cable	ST-009																		

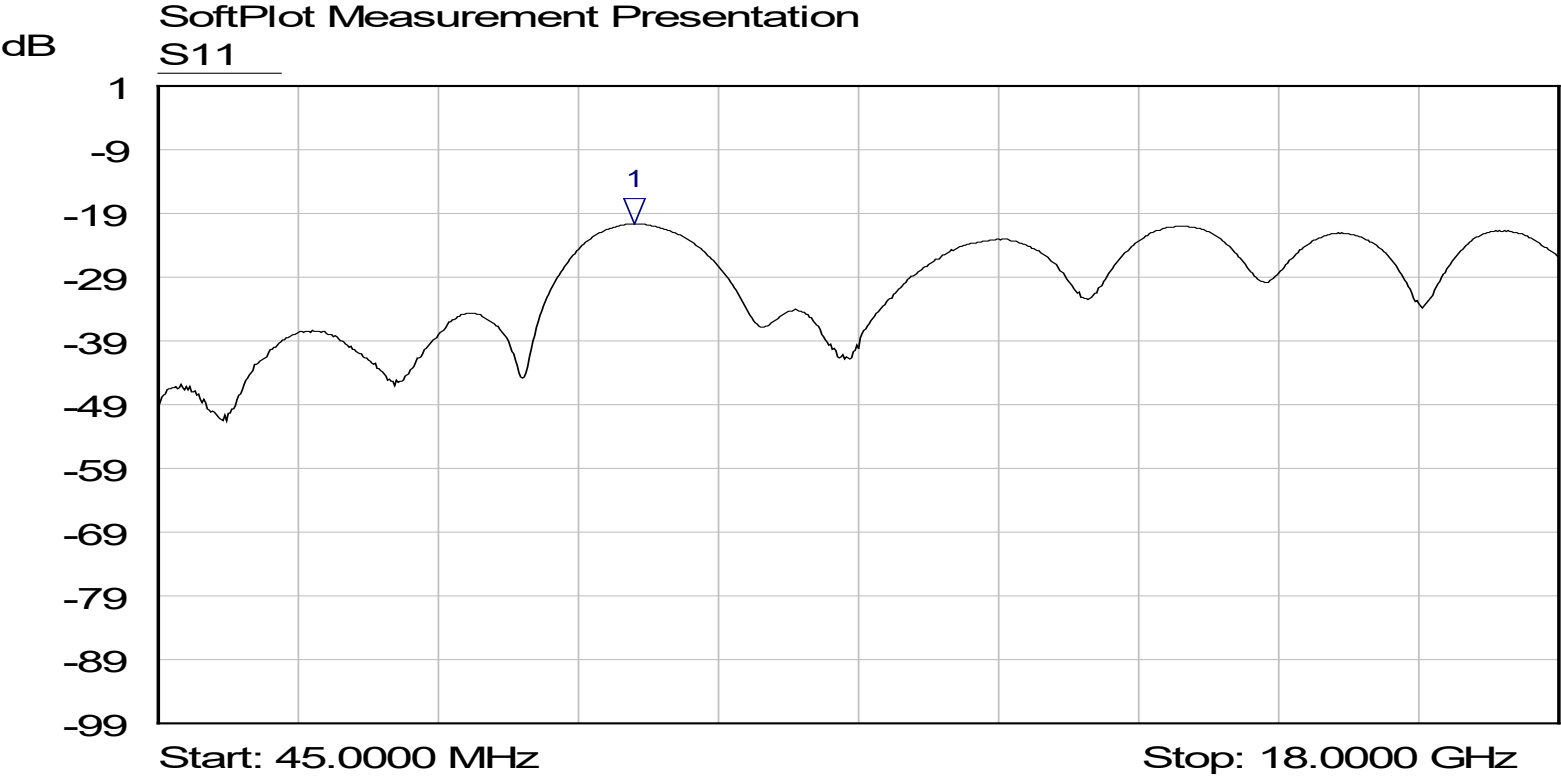
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

BMA3305BS-0085/50G		DATE	2021/02/24	REV	A
A  BODY + GASKET + WASHER + HEX NUT					
DIAGRAM		ASSEMBLY INSTRUCTION			
		Step 1: STRIP AS SHOWN.			
		Step 2: SHARPEN CENTER CONDUCTOR TIP.			
		Step 3: SLIDE CABLE INTO CONNECTOR BODY "A".			
		Step 4: USE SOLDERING FIXTURE " ST-008 ", INSERT TOOL " ST-009 " AND LOCATOR TOOL " ST-011 " AND " ST-BMA33 " TO FIX THE CONNECTOR. SOLDER IN " X ".			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

BMA3305BS-0085/50G



Mkr	Trace	X-Axis	Value	Notes
1 ▽	S11	6.1497 GHz	-20.64 dB	