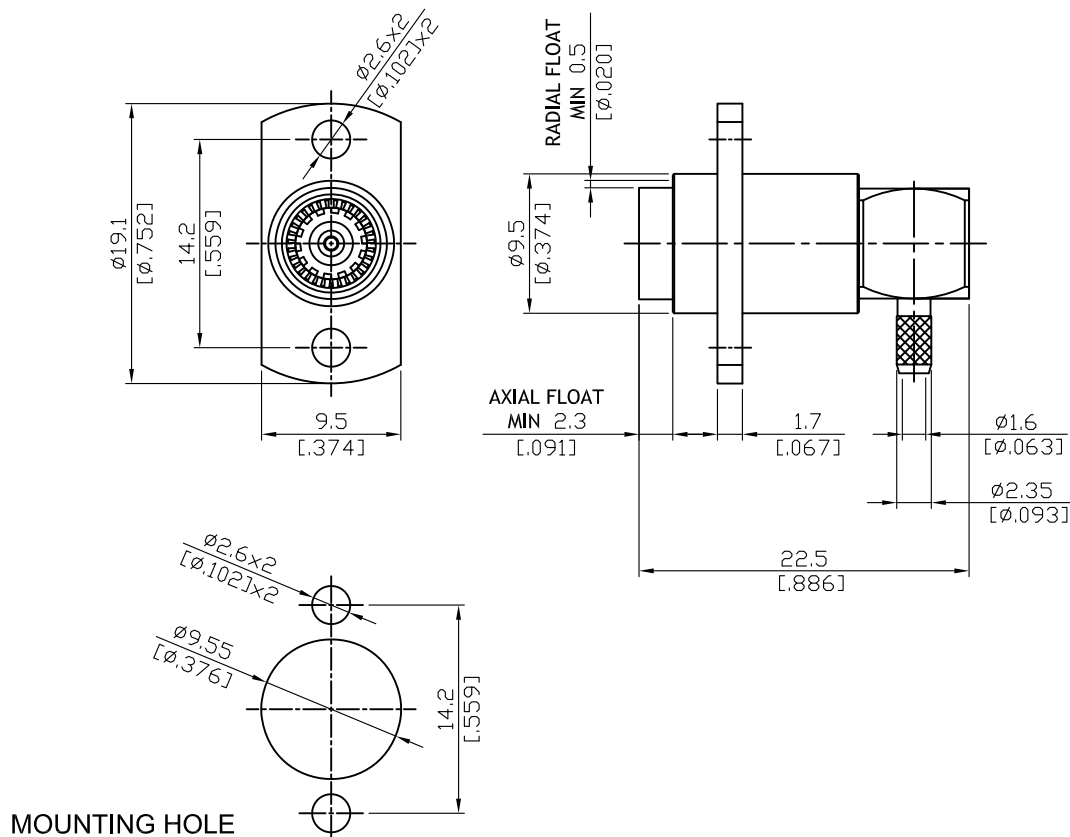


BMA8126A-9316/W

BMA Jack Crimp Right Angle $\phi 19.1\text{mm}$ 2 Hole Flange
For RG174, RG188, RG316; 4.5GHz VSWR 1.2

50 Ω



Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Cover	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Spring	Stainless Steel	
Contact Pin	Beryllium Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Contact Body	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Spring Washer	Beryllium Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Spring Ring	Beryllium Copper	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Suitable Cables: RG174; RG188; RG316; RG316-FEP

This part number complies with RoHS.

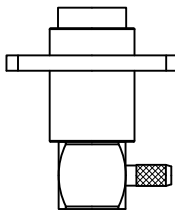
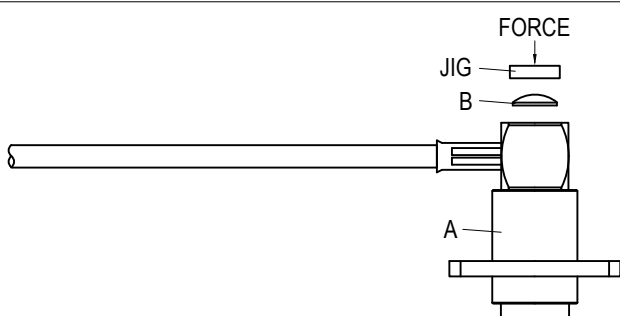
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

BMA		BMA8126A-9316/W	
Interface		MIL-STD-348B	
Electrical Data		Impedance 50Ω Frequency range DC to 4.5GHz VSWR ≤ 1.2 (DC to 4.5GHz) Insertion loss $\leq 0.03 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 5000\text{M}\Omega$ Contact resistance inner conductor $\leq 2\text{m}\Omega$ Contact resistance outer conductor $\leq 2\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 1000 V rms Working voltage (at sea level) 670 V rms	
Mechanical Data		Engagement force ≤ 3 lbs Disengagement force ≤ 1.5 lbs Contact captivation-axial ≥ 6.1 lbs Durability (mating) ≥ 1000	
Environmental Data		Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling		Crimping tool CRT-1 or CRT-2 Crimp Insert INSERT-A	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

BMA8126A-9316/W		DATE	2017/02/02	REV	—
A  BODY B  COVER C  FERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)		
			Step 6: PRESS ON THE TOP OF " B " WITH JIGS.		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	