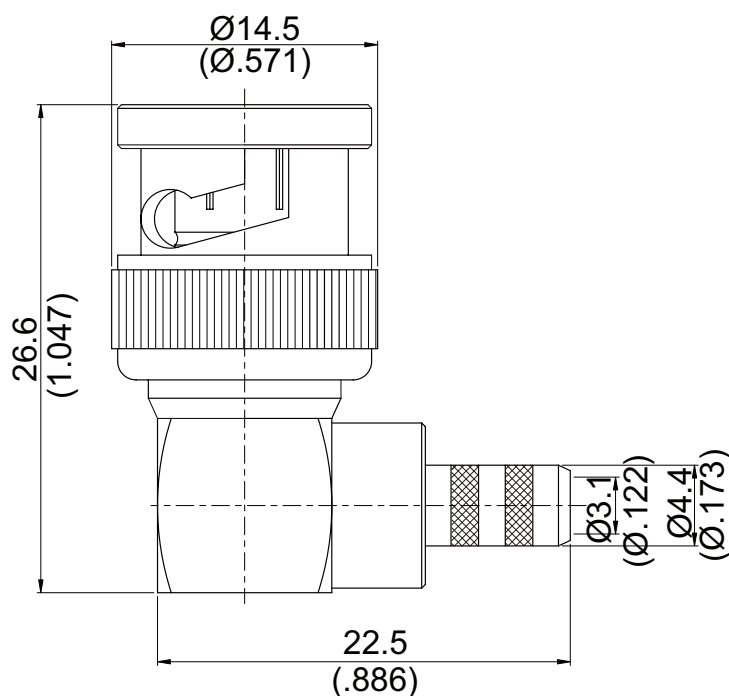


BNC3100-9142

BNC plug crimp right angle
For RG142,RG400; 1.3GHz VSWR 1.2

50Ω



Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicone	
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Spring	SK5	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 18.50 g

Suitable Cables: RG55, RG142, RG400

This part number complies with RoHS.

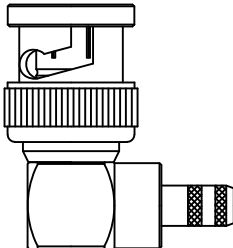

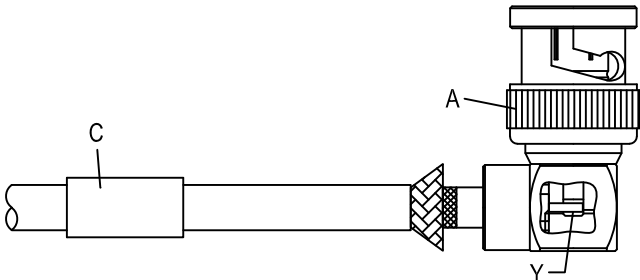
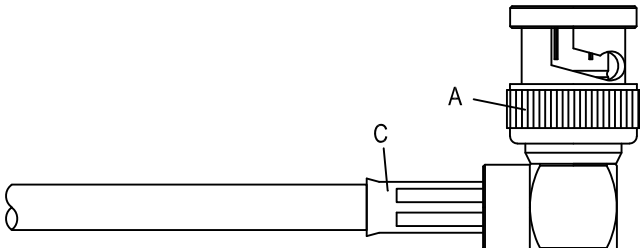
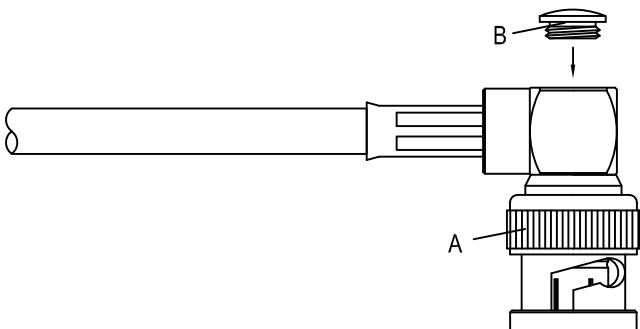
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

BNC		BNC3100-9142	
Interface		MIL-STD-348B	
Electrical Data			
Impedance		50Ω	
Frequency range		DC to 1.3GHz	
VSWR		≤ 1.2 (DC to 1.3GHz)	
Insertion loss		$\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB	
Insulation resistance		$\geq 5000\text{M}\Omega$	
Contact resistance inner conductor		$\leq 1.5\text{m}\Omega$	
Contact resistance outer conductor		$\leq 1\text{m}\Omega$	
Dielectric withstanding voltage (at sea level)		1500 V rms	
Working voltage (at sea level)		500 V rms	
Mechanical Data			
Recommended coupling nut torque		0.6 to 2.5 inch lbs	
Coupling nut retention force		≥ 101.2 lbs	
Contact captivation-axial		≥ 6.1 lbs	
Durability (mating)		≥ 500	
Environmental Data			
Temperature range		-65°C to +165°C	
Thermal shock		MIL-STD-202, Method 107, Condition B	
Moisture resistance		MIL-STD-202, Method 106	
Corrosion		MIL-STD-202, Method 101, Condition B	
RoHS		Compliant	
Tooling			
Crimping tool		CRT-1 or CRT-2	
Crimp insert		INSERT-B	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

BNC3100-9142		DATE	2020/05/05	REV	—
A  BODY B  NUT C  FERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)		
			Step 6: FINALLY SCREW " B " ON THE CONNECTOR BODY " A ".		
This part number complies with RoHS. Notice: JYBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

BNC3100-9142

S11

