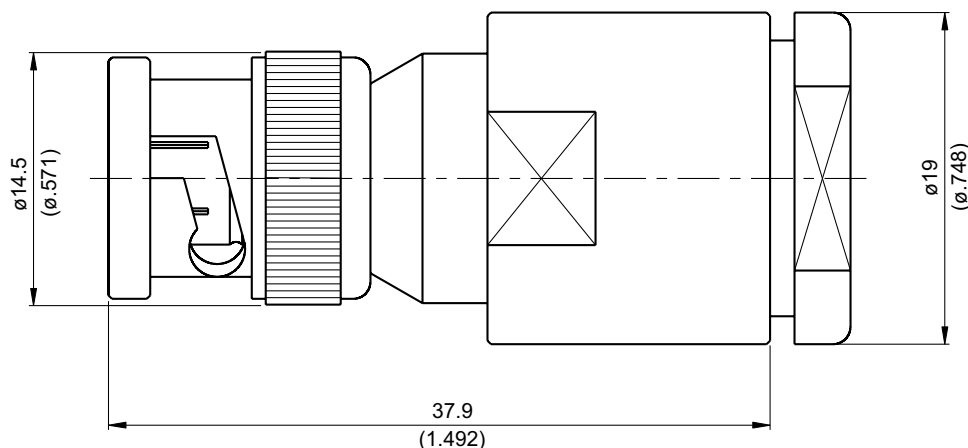


BNC3200-0214

BNC Plug Clamp
For RG214; 1.9GHz VSWR 1.2

50Ω



Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Top Hat	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Gasket	Silicone	
Spring	SK5	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 37.54 g

Suitable Cables: RG214

This part number complies with RoHS.




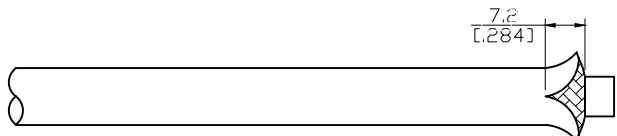
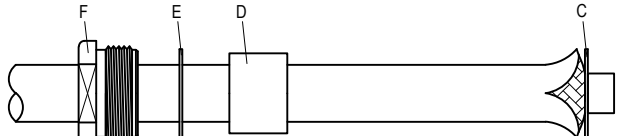
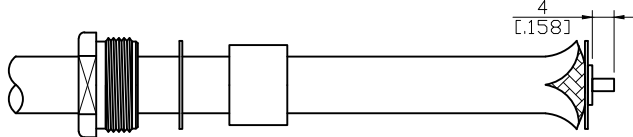

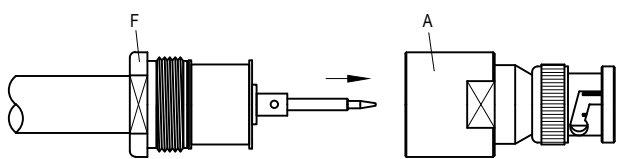
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

BNC	BNC3200-0214																		
Interface MIL-STD-348B																			
Electrical Data <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 1.9GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 1.9GHz)</td></tr> <tr> <td>Insertion loss</td><td>≤ 0.1 x √f(GHz)dB</td></tr> <tr> <td>Insulation resistance</td><td>≥ 5000MΩ</td></tr> <tr> <td>Contact resistance inner conductor</td><td>≤ 1.5mΩ</td></tr> <tr> <td>Contact resistance outer conductor</td><td>≤ 1mΩ</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>1500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>500 V rms</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 1.9GHz	VSWR	≤ 1.2 (DC to 1.9GHz)	Insertion loss	≤ 0.1 x √f(GHz)dB	Insulation resistance	≥ 5000MΩ	Contact resistance inner conductor	≤ 1.5mΩ	Contact resistance outer conductor	≤ 1mΩ	Dielectric withstanding voltage (at sea level)	1500 V rms	Working voltage (at sea level)	500 V rms
Impedance	50Ω																		
Frequency range	DC to 1.9GHz																		
VSWR	≤ 1.2 (DC to 1.9GHz)																		
Insertion loss	≤ 0.1 x √f(GHz)dB																		
Insulation resistance	≥ 5000MΩ																		
Contact resistance inner conductor	≤ 1.5mΩ																		
Contact resistance outer conductor	≤ 1mΩ																		
Dielectric withstanding voltage (at sea level)	1500 V rms																		
Working voltage (at sea level)	500 V rms																		
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>0.6 to 2.5 inch lbs</td></tr> <tr> <td>Coupling nut retention force</td><td>≥ 101.2 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.1 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	0.6 to 2.5 inch lbs	Coupling nut retention force	≥ 101.2 lbs	Contact captivation-axial	≥ 6.1 lbs	Durability (mating)	≥ 500										
Recommended coupling nut torque	0.6 to 2.5 inch lbs																		
Coupling nut retention force	≥ 101.2 lbs																		
Contact captivation-axial	≥ 6.1 lbs																		
Durability (mating)	≥ 500																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling <table> <tr> <td>Crimping tool</td><td>CRT-1 or CRT-2</td></tr> <tr> <td>Crimp insert</td><td>INSERT- C</td></tr> </table>		Crimping tool	CRT-1 or CRT-2	Crimp insert	INSERT- C														
Crimping tool	CRT-1 or CRT-2																		
Crimp insert	INSERT- C																		

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

BNC3200-0214		DATE	2017/03/27	REV	—
A	B	C	D	E	F
					
BODY	CONTACT PIN	TOP HAT	GASKET	WASHER	NUT
DIAGRAM		ASSEMBLY INSTRUCTION			
		Step 1: STRIP AS SHOWN.			
		Step 2: MAKE A 7.2MM LONG CUT IN THE JACKET WITHOUT DAMAGING THE BRAIDING.			
		Step 3: SLIDE NUT " F " 、 WASHER " E " AND GASKET " D " OVER CABLE. Step 4: LOOSEN BRAIDING AND SLIDE TOP HAT " C " BETWEEN DIELECTRIC AND BRAIDING.			
		Step 5: STRIP AS SHOWN.			
		Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". (USE 3.3mm/0.130inch HEX SECTION OF INSERT-C IF CRIMPED)			
		Step 7: FINALLY SCREW NUT " F " ON THE CONNECTOR BODY " A ".			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

BNC3200-0214

S11

