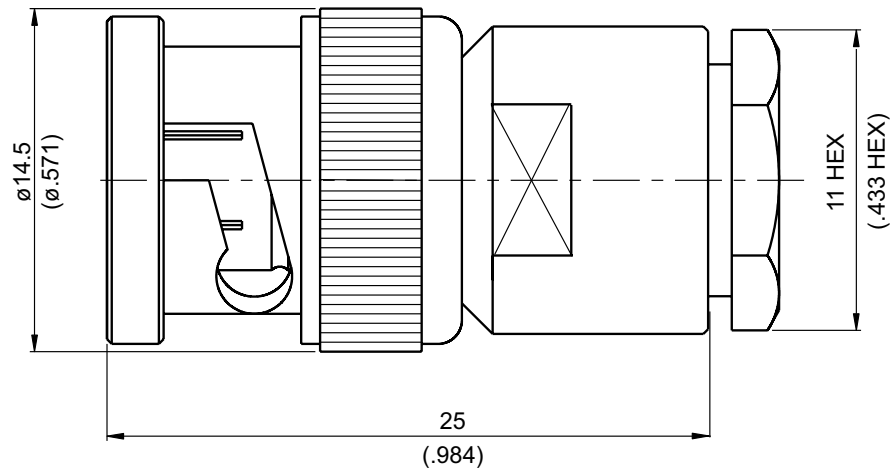


BNC3200B-0059

BNC Plug Clamp

75Ω



Parts	Material	Plating (Micro-inch)
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 3 Over Nickel 50 Over Copper 50
Gasket	Silicone	
Spring	SK5	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 14.72 g


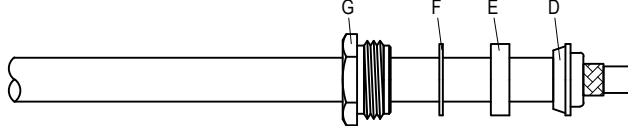
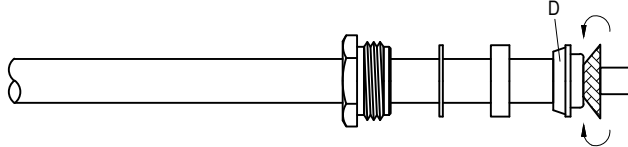
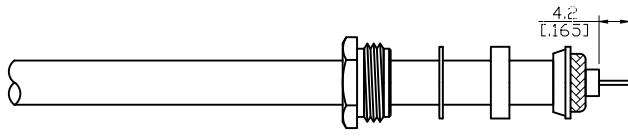
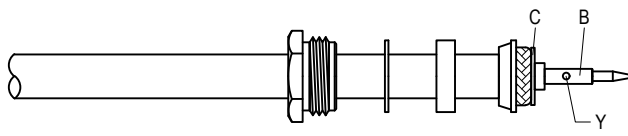
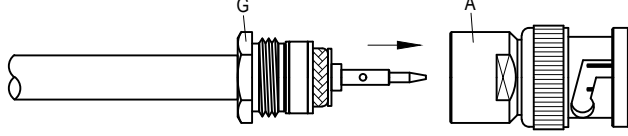
Suitable Cables: RG59

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

BNC3200B-0059			DATE	2017/02/02	REV	—
A	B	C	D	E	F	G
						
BODY	CONTACT PIN	WASHER	BRAID CLAMP	GASKET	WASHER	NUT
DIAGRAM			ASSEMBLY INSTRUCTION			
			Step 1: STRIP AS SHOWN.			
			Step 2: SLIDE NUT "G" 、 WASHER "F" 、 GASKET "E" AND BRAID CLAMP "D" OVER CABLE.			
			Step 3: WRAP THE BRAIDING OVER "D" .			
			Step 4: STRIP AS SHOWN.			
			Step 5: SLIDE PREPARED CABLE INTO WASHER "C" . Step 6: PUT CONTACT PIN "B" ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN "Y" . (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-A IF CRIMPED)			
			Step 7: FINALLY SCREW "G" ON THE CONNECTOR BODY "A" .			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.						
APPROVED		CHECKED		DRAWING		
				Albert		