



BNC8205-0142

BNC Jack Clamp For Bulkhead

50Ω

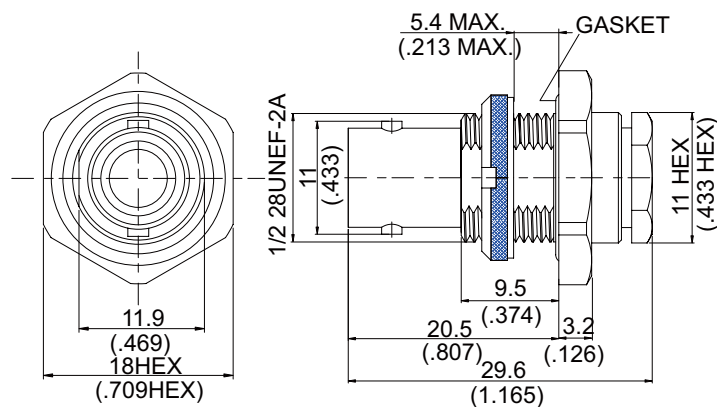

MOUNTING HOLE

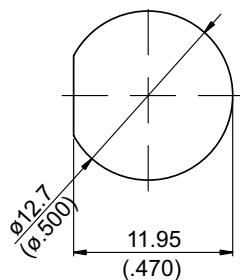

Parts	Material	Plating (Micro-inch)
Nut Hex	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Contact Pin	Phosphor Bronze	Gold 5 Over Nickel 50 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 26.2 g

Suitable Cables: RG55, RG58, RG142, RG142-E, RG400, JBY195

IP67(Mated)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

BNC8205-0142

JYE BAO CO., LTD.

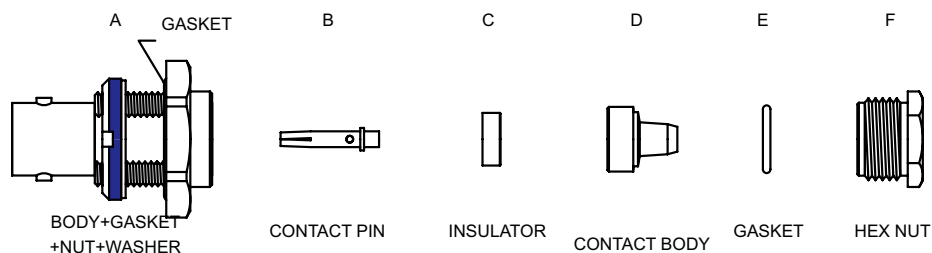


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN .
	Step 2: MAKE A 5MM LONG CUT IN THE JACKET WITHOUT DAMAGING THE BRAIDING.
	Step 3: SLIDE GASKET "E" AND HEX NUT "F" OVER CABLE. Step 4: LOOSEN BRAIDING AND SLIDE CONTACT BODY "D" IN PLACE.
	Step 5: SLIDE PREPARED CABLE INTO INSULATOR "C". Step 6: PUT CONTACT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y".
	Step 7: FINALLY SCREW "F" ON THE CONNECTOR BODY "A".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.