


BNC91EZ-L400

BNC Reverse Polarity Jack Crimp 50Ω

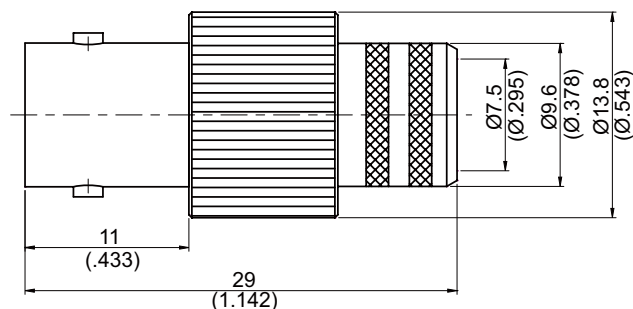

NOTE : Spring finger design, easy assembly

Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: JBY400, LMR400


This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION


BNC91EZ-L400

JYE BAO CO., LTD.
TAIPEI TAIWAN R.O.C

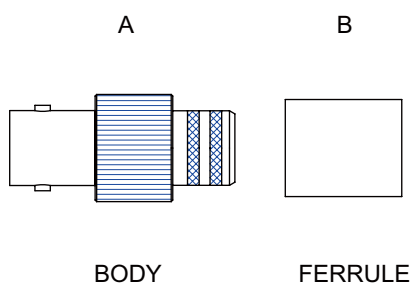


DIAGRAM

ASSEMBLY INSTRUCTION

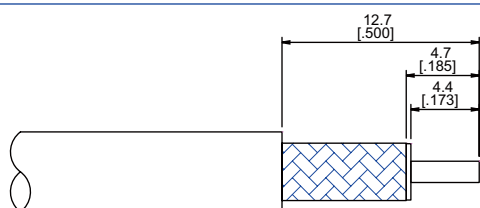


Step 1: STRIP AS SHOWN .

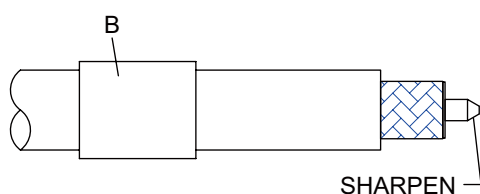


Step 2: SHARPEN CENTER CONDUCTOR TIP.
Step 3: SLIDE FERRULE " B " OVER CABLE.

NOTE: THE STRIPPED CABLE AND POINTED CENTER CONDUCTOR MUST BE STRAIGHT (180°).

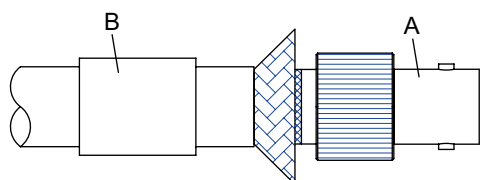

Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.

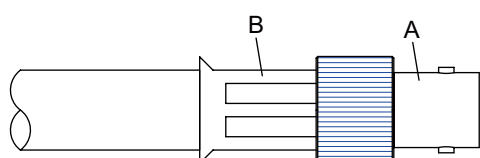

Step 5: SLIDE FERRULE " B " TOWARDS THE CONNECTOR " A " AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.