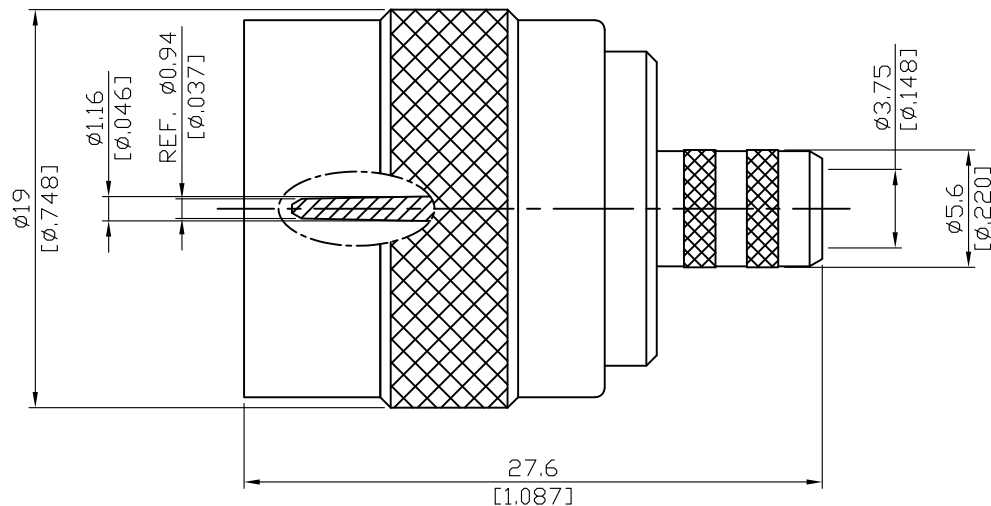


C3100-0L59

C Plug Crimp For JBY59, LMR240-75
600MHz VSWR 1.2

75Ω



Note: This Connector Has A 75Ω C Connector Interface.
This Connector Does **Not** Mate With 50Ω C Connector Interface.

Parts	Material	Plating (Micro-inch)
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicone	
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Suitable Cables: JBY59; LMR240-75

This part number complies with RoHS.

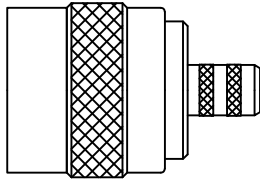
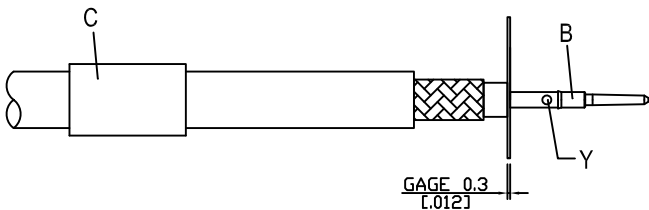
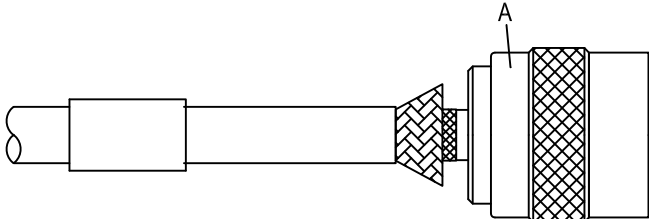
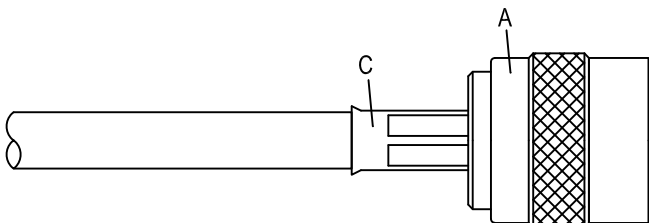
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

C	C3100-0L59
Interface MIL-STD-348B	
Electrical Data Impedance 50Ω Frequency range DC to 600MHz VSWR ≤ 1.2 (DC to 600MHz) Insertion loss $\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 10000\text{M}\Omega$ Contact resistance inner conductor $\leq 1\text{m}\Omega$ Contact resistance outer conductor $\leq 0.25\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 3000 V rms Working Voltage (at sea level) 1000 V rms Power Handling $\leq 400\text{W}$ (1GHz)	
Mechanical Data 2 stud bayonet Coupling Per MIL-C-39012 Coupling nut retention force ≥ 100 lbs Contact Captivation-axial ≥ 6 lbs Durability (mating) ≥ 500	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 206 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-E Soldering gauge ST-0.3	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY RECOMMENDATION

C3100-0L59		DATE	2019/09/19	REV	A
A B C    BODYCONTACT PINFERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT 0.3 MM GAGE IN PLACE, INSERT CABLE'S CENTER CONDUCTOR INTO CENTER PIN " B " AND SOLDER IN " Y ".		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 6.5mm/0.256inch HEX SECTION OF INSERT-E)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

C3100-0L59

S11

