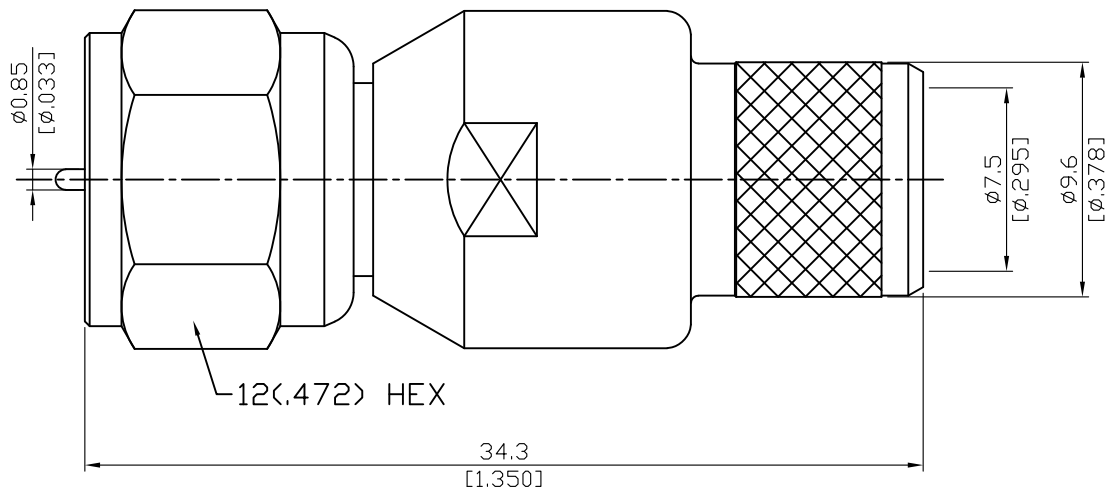


F3175-L400

F Plug Crimp For LMR400-75, LMR400-75
1.75GHz VSWR 1.2

75Ω



Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicone	
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Suitable Cables: JBY400-75, LMR400-75

This part number complies with RoHS.



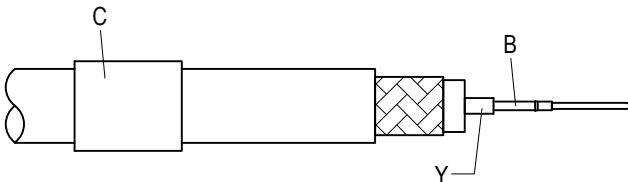
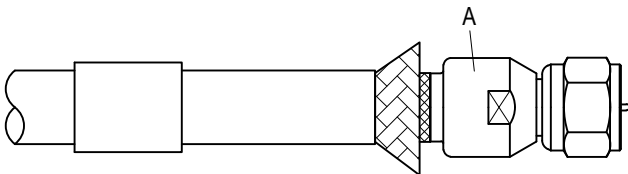
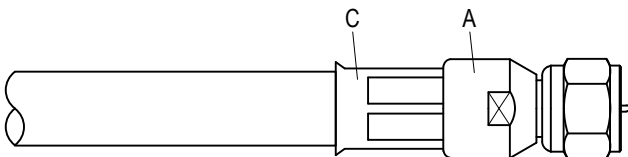
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

F	F3175-L400																		
Interface IEC 61169-24																			
Electrical Data <table> <tr> <td>Impedance</td><td>75Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 1.75GHz</td></tr> <tr> <td>VSWR</td><td>≤1.2 (DC to 1.75GHz)</td></tr> <tr> <td>Insertion loss</td><td>≤0.1dB at 1GHz; ≤0.2dB at 2GHz; ≤0.3dB at 3GHz</td></tr> <tr> <td>Insulation resistance</td><td>≥10000MΩ</td></tr> <tr> <td>Contact resistance inner conductor</td><td>≤5mΩ</td></tr> <tr> <td>Contact resistance outer conductor</td><td>≤2.5mΩ</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>1500 V rms</td></tr> <tr> <td>Working Voltage (at sea level)</td><td>500 V rms</td></tr> </table>		Impedance	75Ω	Frequency range	DC to 1.75GHz	VSWR	≤1.2 (DC to 1.75GHz)	Insertion loss	≤0.1dB at 1GHz; ≤0.2dB at 2GHz; ≤0.3dB at 3GHz	Insulation resistance	≥10000MΩ	Contact resistance inner conductor	≤5mΩ	Contact resistance outer conductor	≤2.5mΩ	Dielectric withstanding voltage (at sea level)	1500 V rms	Working Voltage (at sea level)	500 V rms
Impedance	75Ω																		
Frequency range	DC to 1.75GHz																		
VSWR	≤1.2 (DC to 1.75GHz)																		
Insertion loss	≤0.1dB at 1GHz; ≤0.2dB at 2GHz; ≤0.3dB at 3GHz																		
Insulation resistance	≥10000MΩ																		
Contact resistance inner conductor	≤5mΩ																		
Contact resistance outer conductor	≤2.5mΩ																		
Dielectric withstanding voltage (at sea level)	1500 V rms																		
Working Voltage (at sea level)	500 V rms																		
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>15 to 20 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>60 inch lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥500</td></tr> </table>		Recommended coupling nut torque	15 to 20 inch lbs	Coupling proof torque	60 inch lbs	Durability (mating)	≥500												
Recommended coupling nut torque	15 to 20 inch lbs																		
Coupling proof torque	60 inch lbs																		
Durability (mating)	≥500																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling <table> <tr> <td>Crimping tool</td><td>CRT-1 or CRT-2</td></tr> <tr> <td>Crimp insert</td><td>INSERT-C</td></tr> </table>		Crimping tool	CRT-1 or CRT-2	Crimp insert	INSERT-C														
Crimping tool	CRT-1 or CRT-2																		
Crimp insert	INSERT-C																		

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

F3175-L400		DATE	2015/12/04	REV	—
A		B		C	
					
BODY		CONTACT PIN		FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND CRIMP IN " Y ". (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-C)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 10.7mm/0.421inch HEX SECTION OF INSERT-C)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	