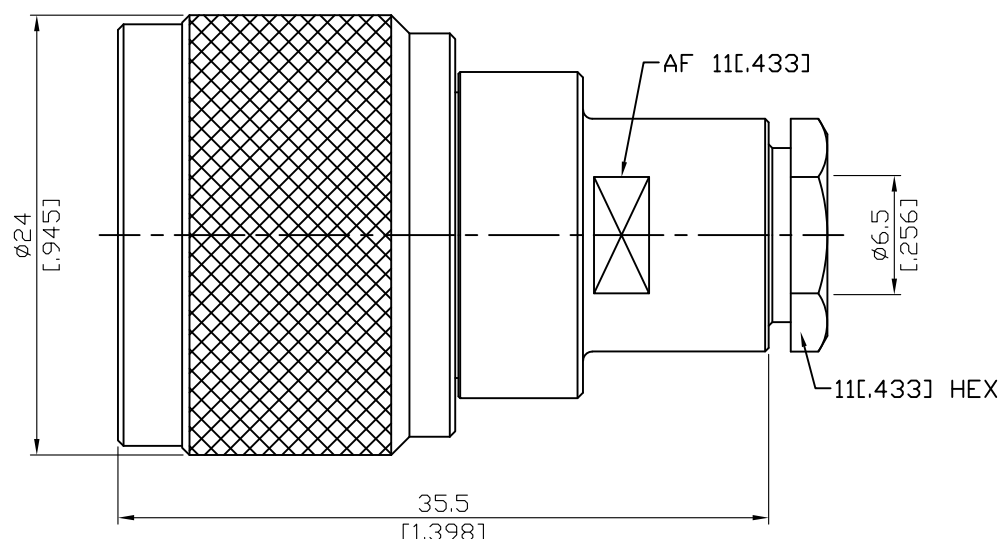


HN3200-0059

HN plug clamp for RG59

50Ω



Note:

HN interface is 50Ω whereas RG59 cable is 75Ω resulting in an impedance mismatch and poor RF performance.

Parts	Material	Plating (Micro-inch)
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicone	
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Silver 150 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

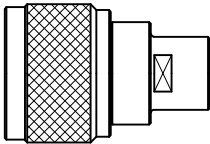

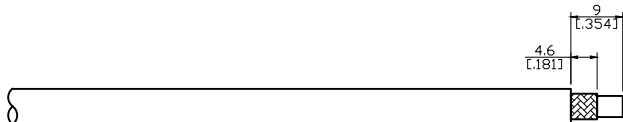

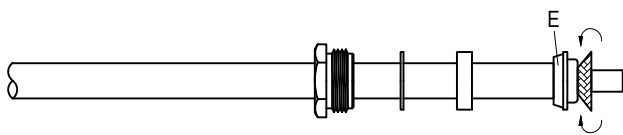

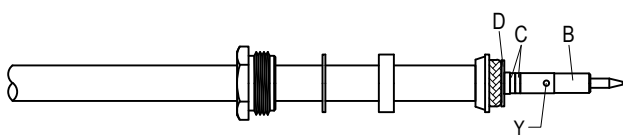
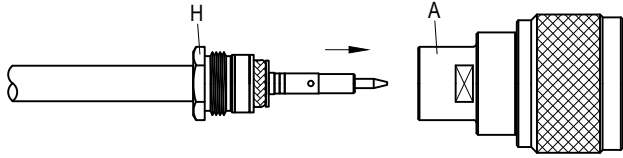
Suitable Cables: RG59

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

HN3200-0059			DATE	2021/07/02	REV	—	
A	B	C	D	E	F	G	H
							
BODY	CONTACT PIN	INSULATOR (x2)	WASHER	BRAID CLAMP	GASKET	WASHER	NUT
DIAGRAM			ASSEMBLY INSTRUCTION				
			Step 1: STRIP AS SHOWN.				
			Step 2: SLIDE NUT " H " 、 WASHER " G " 、 GASKET " F " AND BRAID CLAMP " E " OVER CABLE.				
			Step 3: WRAP THE BRAIDING OVER BRAID CLAMP " E " .				
			Step 4: STRIP AS SHOWN.				
			Step 5: SLIDE PREPARED CABLE INTO WASHER " D " . Step 6: PUT INSULATOR " C " AND PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y " .				
			Step 6: FINALLY SCREW NUT " H " ON THE CONNECTOR BODY " A " .				
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.							
APPROVED		CHECKED			DRAWING		
					Albert		