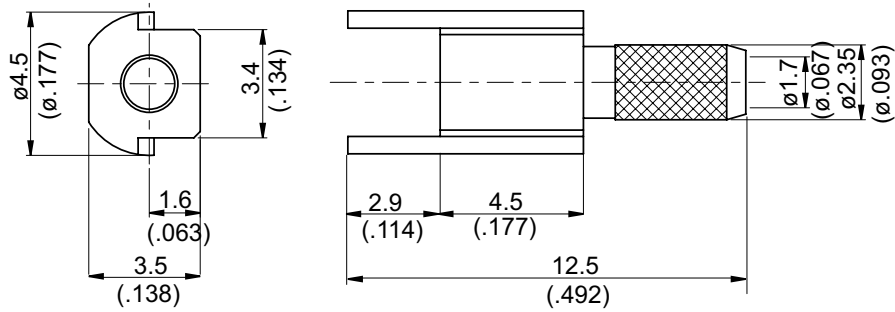
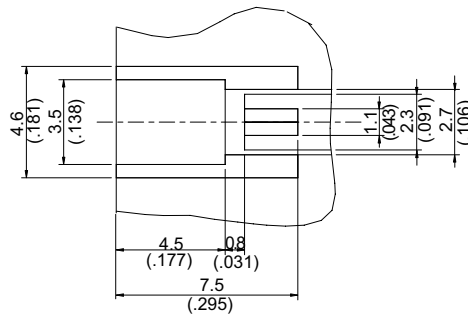


MCX0400A-L100

Terminal Crimp For P.C.B. Cut Edge Mount



MOUNTING HOLE



Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Body	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20


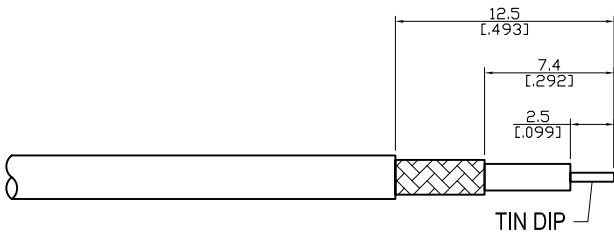
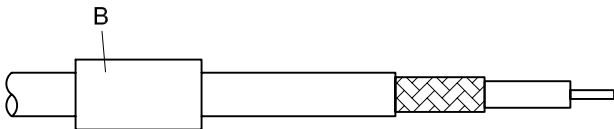
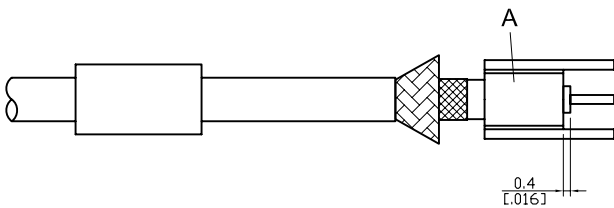
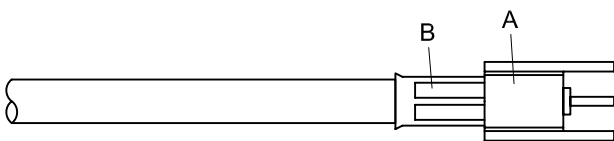
Weight:
Suitable Cables: JBY100

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

MCX0400A-L100		DATE	2017/09/25	REV	—
A		B			
					
BODY		FERRULE			
DIAGRAM		ASSEMBLY INSTRUCTION			
		Step 1: STRIP AS SHOWN. Step 2: TIN DIP.			
		Step 3: SLIDE FERRULE " B " OVER CABLE.			
		Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE. NOTE: DIELECTRIC SHOULD PROTRUDE 0.4MM FROM THE TERMINAL TO PREVENT FLUX FROM GETTING TRAPPED.			
		Step 5: SLIDE FERRULE " B " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	