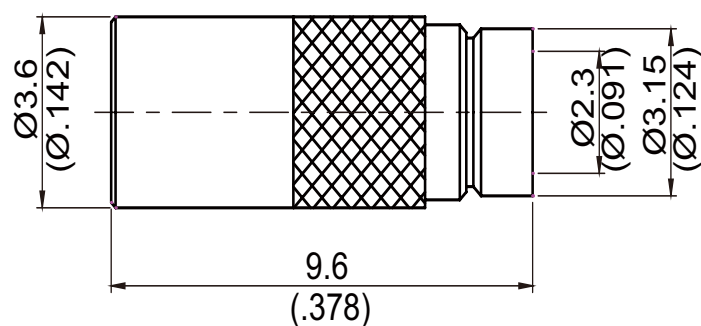


MMCX8100B-0178

MMCX Jack Crimp

50Ω



Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Insulator	Teflon	
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Barrel	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Body	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20

Weight:

Suitable Cables:RG178,RG178-FEP,RG178-LSFH,RG196


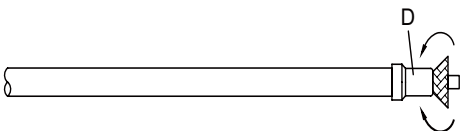

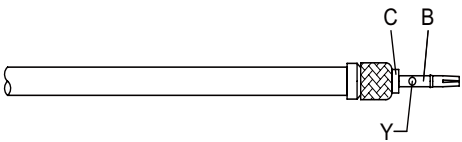
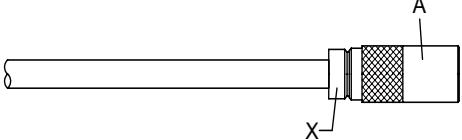
This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

MMCX8100B-0178

JYE BAO CO., LTD.

A	B	C	D
			
BODY	CONTACT PIN	INSULATOR	FERRULE
DIAGRAM	ASSEMBLY INSTRUCTION		
	Step 1: STRIP AS SHOWN.		
	Step 2: SLIDE FERRULE " D " OVER CABLE. Step 3: WRAP THE BRAIDING OVER " D ".		
	Step 4: STRIP AS SHOWN.		
	Step 5: SLIDE PREPARED CABLE INTO INSULATOR " C ". Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". (USE SQUARE 0.54mm/0.021inch SECTION OF INSERT-A IF CRIMPED)		
	Step 7: PUT PREPARED CABLE INTO CONNECTOR BODY " A " AND CRIMP IN " X ". (USE 2.55mm/0.100inch HEX SECTION OF INSERT-A) NOTE: CONNECTOR BARREL ALSO FUNCTIONS AS FERRULE.		

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.