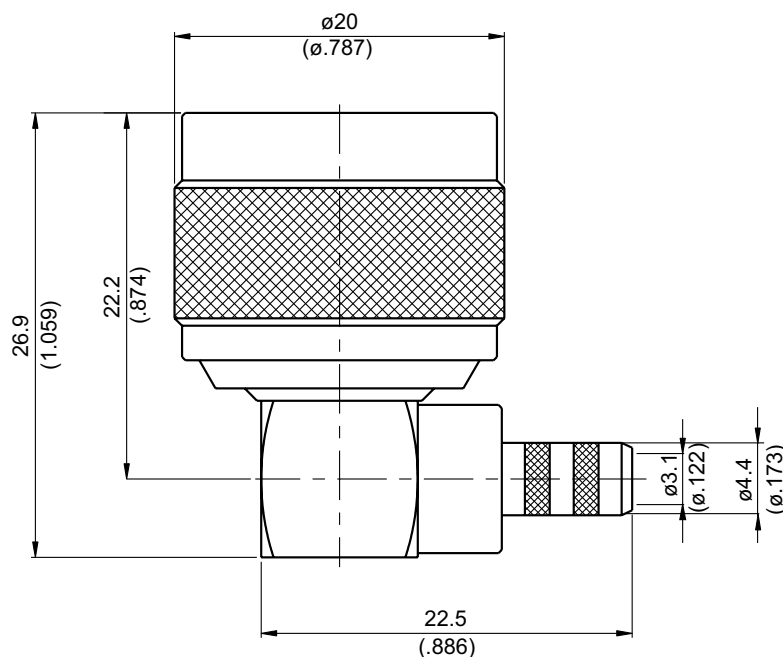


N3100-9058

N Plug Crimp Right Angle
For RG58, JBY195, LMR195; 6GHz VSWR 1.2* 50Ω



*Using JBY195

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Center Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 30.2 g

Suitable Cables: RG58, JBY195, LMR195

This part number complies with RoHS.

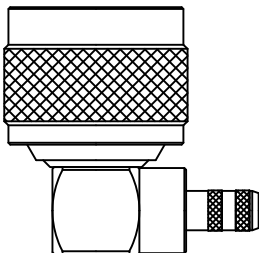

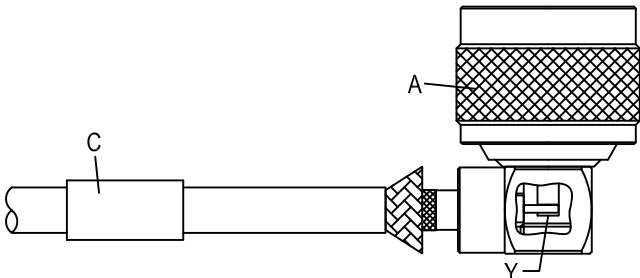
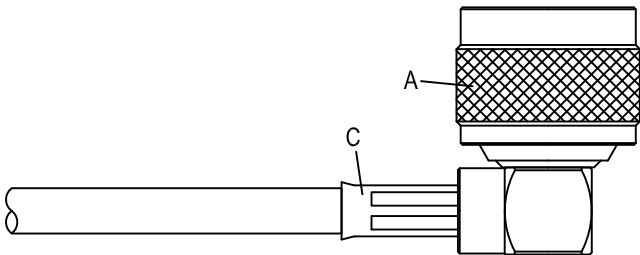
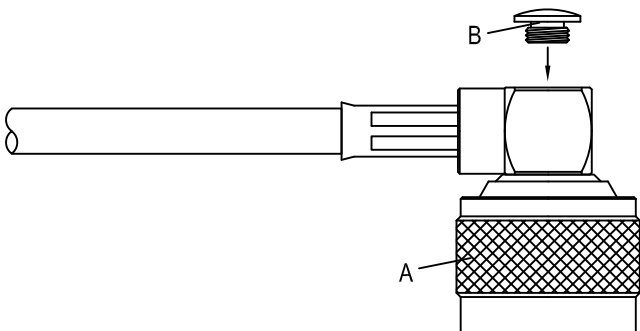
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N		N3100-9058	
Interface		MIL-STD-348B	
Electrical Data		Impedance 50Ω Frequency range DC to 6GHz VSWR ≤ 1.2 (DC to 6GHz) Insertion loss $\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 5000\text{M}\Omega$ Contact resistance inner conductor $\leq 1.5\text{m}\Omega$ Contact resistance outer conductor $\leq 1\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 2500 V rms Working voltage (at sea level) 1000 V rms	
Mechanical Data		Recommended coupling nut torque 6 to 10 inch lbs Coupling proof torque 15 inch lbs Coupling nut retention force ≥ 101.2 lbs Contact captivation-axial ≥ 6.3 lbs Durability (mating) ≥ 500	
Environmental Data		Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling		Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-B	

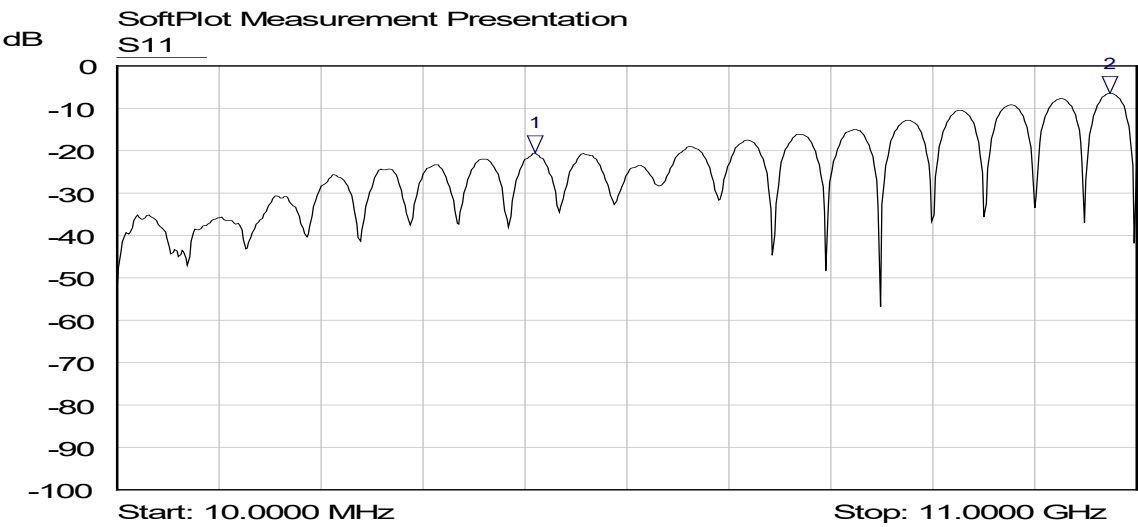
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3100-9058		DATE	2014/04/29	REV	—
A  BODY B  NUT C  FERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)		
			Step 6: FINALLY SCREW " B " ON THE CONNECTOR BODY " A ".		
This part number complies with RoHS. Notice: JYEBao reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

N3100-9058(using JBY195 cable)



Mkr	Trace	X-Axis	Value	Notes
1 ▽	S11	4.5125 GHz	-20.50 dB	
2 ▽	S11	10.7160 GHz	-6.50 dB	