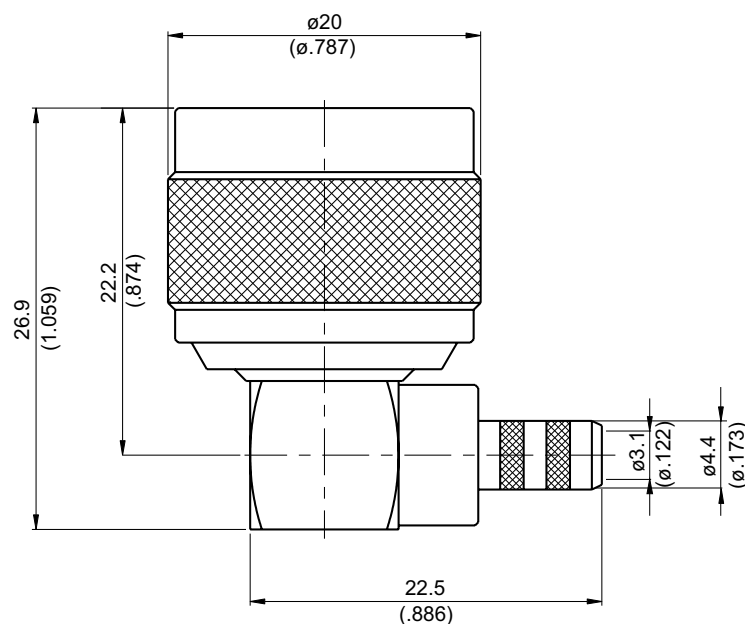


N3100-9142

N Plug Crimp Right Angle
For RG142, RG400; 6GHz VSWR 1.2

50Ω



Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Center Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 29.22 g

Suitable Cables: RG142, RG400

This part number complies with RoHS.

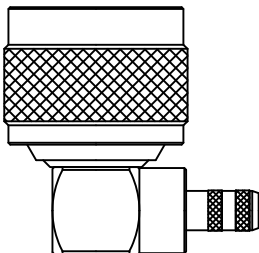

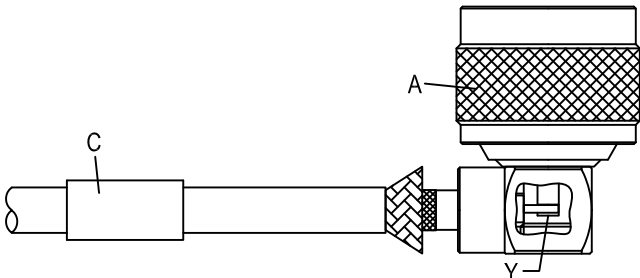
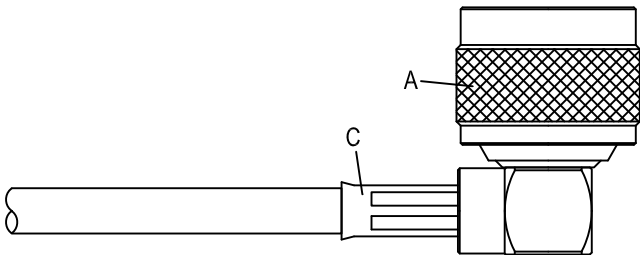
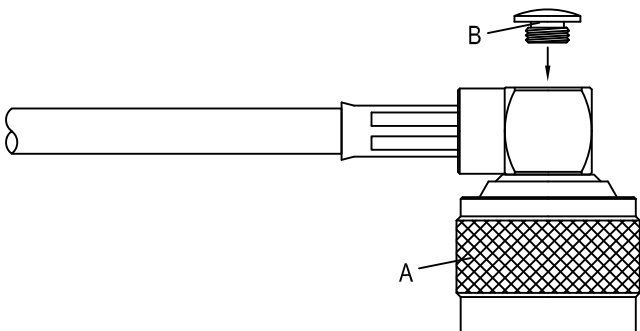
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N	N3100-9142																		
Interface MIL-STD-348B																			
Electrical Data <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 6GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 6GHz)</td></tr> <tr> <td>Insertion loss</td><td>$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB</td></tr> <tr> <td>Insulation resistance</td><td>$\geq 5000\text{M}\Omega$</td></tr> <tr> <td>Contact resistance inner conductor</td><td>$\leq 1.5\text{m}\Omega$</td></tr> <tr> <td>Contact resistance outer conductor</td><td>$\leq 1\text{m}\Omega$</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>2500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>1000 V rms</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 6GHz	VSWR	≤ 1.2 (DC to 6GHz)	Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB	Insulation resistance	$\geq 5000\text{M}\Omega$	Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$	Contact resistance outer conductor	$\leq 1\text{m}\Omega$	Dielectric withstanding voltage (at sea level)	2500 V rms	Working voltage (at sea level)	1000 V rms
Impedance	50Ω																		
Frequency range	DC to 6GHz																		
VSWR	≤ 1.2 (DC to 6GHz)																		
Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB																		
Insulation resistance	$\geq 5000\text{M}\Omega$																		
Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$																		
Contact resistance outer conductor	$\leq 1\text{m}\Omega$																		
Dielectric withstanding voltage (at sea level)	2500 V rms																		
Working voltage (at sea level)	1000 V rms																		
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>6 to 10 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>15 inch lbs</td></tr> <tr> <td>Coupling nut retention force</td><td>≥ 101.2 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.3 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	6 to 10 inch lbs	Coupling proof torque	15 inch lbs	Coupling nut retention force	≥ 101.2 lbs	Contact captivation-axial	≥ 6.3 lbs	Durability (mating)	≥ 500								
Recommended coupling nut torque	6 to 10 inch lbs																		
Coupling proof torque	15 inch lbs																		
Coupling nut retention force	≥ 101.2 lbs																		
Contact captivation-axial	≥ 6.3 lbs																		
Durability (mating)	≥ 500																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling <table> <tr> <td>Crimping tool</td><td>CRT-1 or CRT-2</td></tr> <tr> <td>Crimp insert</td><td>INSERT-B</td></tr> </table>		Crimping tool	CRT-1 or CRT-2	Crimp insert	INSERT-B														
Crimping tool	CRT-1 or CRT-2																		
Crimp insert	INSERT-B																		

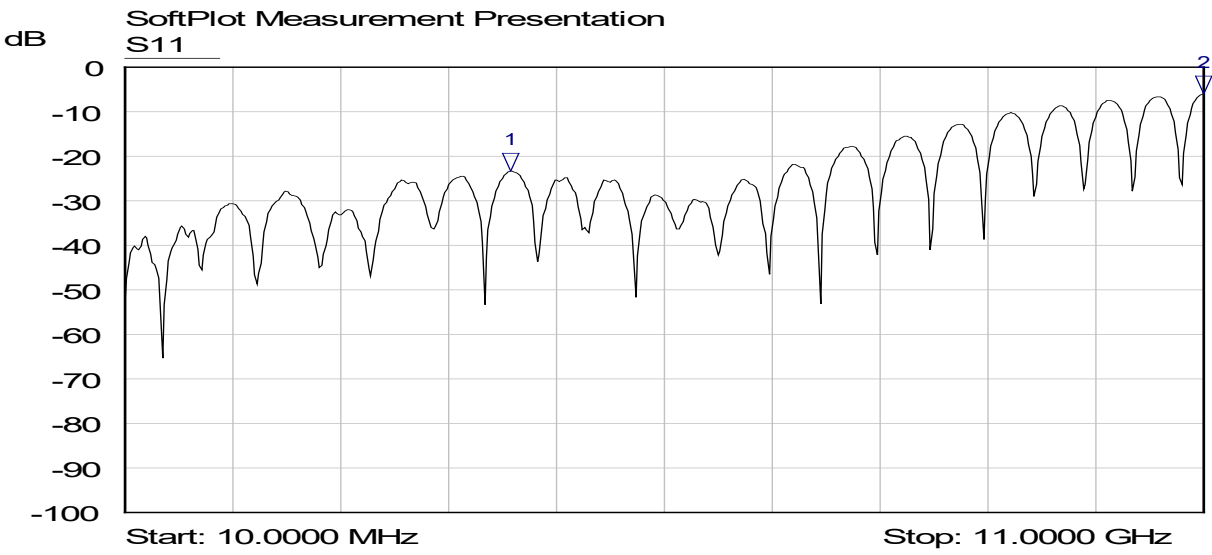
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3100-9142		DATE	2014/04/29	REV	—
A  BODY B  NUT C  FERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)		
			Step 6: FINALLY SCREW " B " ON THE CONNECTOR BODY " A ".		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

N3100-9142



Mkr	Trace	X-Axis	Value	Notes
1 ▾	S11	3.9322 GHz	-23.39 dB	
2 ▾	S11	10.9961 GHz	-6.04 dB	