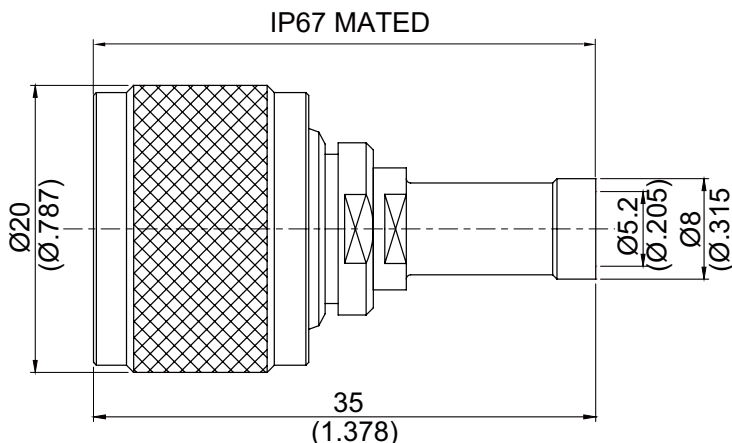


N3100B-0142/HS	N plug crimp, IP67 mated, For RG142,RG400; 3GHz VSWR1.2	50Ω																					
																							
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Ferrule</td><td>Copper</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Contact Pin</td><td>Brass</td><td>Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>			Parts	Material	Plating (Micro-inch)	Gasket	Silicon		Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																					
Gasket	Silicon																						
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50																					
Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20																					
Insulator	Teflon																						
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																					
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																					
Weight: Suitable Cables:RG55,RG142,RG400																							

This part number complies with RoHS.

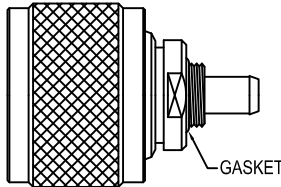

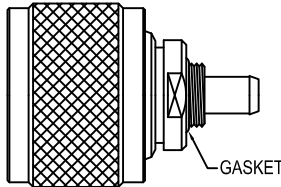

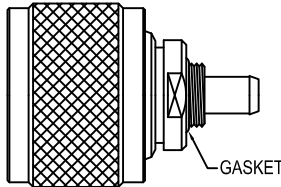

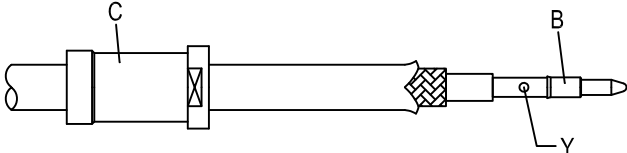
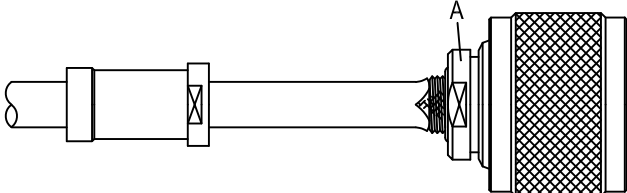
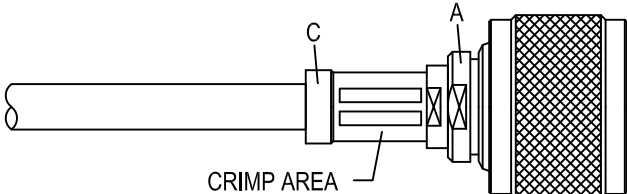
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N	N3100B-0142/HS																		
Interface MIL-STD-348B																			
Electrical Data <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 3GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 3GHz)</td></tr> <tr> <td>Insertion loss</td><td>$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB</td></tr> <tr> <td>Insulation resistance</td><td>$\geq 5000\text{M}\Omega$</td></tr> <tr> <td>Contact resistance inner conductor</td><td>$\leq 1.5\text{m}\Omega$</td></tr> <tr> <td>Contact resistance outer conductor</td><td>$\leq 1\text{m}\Omega$</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>2500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>1000 V rms</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 3GHz	VSWR	≤ 1.2 (DC to 3GHz)	Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB	Insulation resistance	$\geq 5000\text{M}\Omega$	Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$	Contact resistance outer conductor	$\leq 1\text{m}\Omega$	Dielectric withstanding voltage (at sea level)	2500 V rms	Working voltage (at sea level)	1000 V rms
Impedance	50Ω																		
Frequency range	DC to 3GHz																		
VSWR	≤ 1.2 (DC to 3GHz)																		
Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB																		
Insulation resistance	$\geq 5000\text{M}\Omega$																		
Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$																		
Contact resistance outer conductor	$\leq 1\text{m}\Omega$																		
Dielectric withstanding voltage (at sea level)	2500 V rms																		
Working voltage (at sea level)	1000 V rms																		
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>6 to 10 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>15 inch lbs</td></tr> <tr> <td>Coupling nut retention force</td><td>≥ 101.2 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.3 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	6 to 10 inch lbs	Coupling proof torque	15 inch lbs	Coupling nut retention force	≥ 101.2 lbs	Contact captivation-axial	≥ 6.3 lbs	Durability (mating)	≥ 500								
Recommended coupling nut torque	6 to 10 inch lbs																		
Coupling proof torque	15 inch lbs																		
Coupling nut retention force	≥ 101.2 lbs																		
Contact captivation-axial	≥ 6.3 lbs																		
Durability (mating)	≥ 500																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling <table> <tr> <td>Crimping tool</td><td>CRT-1 or CRT-2</td></tr> <tr> <td>Crimp insert</td><td>INSERT-E</td></tr> </table>		Crimping tool	CRT-1 or CRT-2	Crimp insert	INSERT-E														
Crimping tool	CRT-1 or CRT-2																		
Crimp insert	INSERT-E																		

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3100B-0142/HS		DATE	2014/05/06	REV	—									
<table><tr><td>A</td><td>B</td><td>C</td></tr><tr><td></td><td></td><td></td></tr><tr><td>BODY+GASKET</td><td>CONTACT PIN</td><td>FERRULE+GASKET</td></tr></table>						A	B	C				BODY+GASKET	CONTACT PIN	FERRULE+GASKET
A	B	C												
														
BODY+GASKET	CONTACT PIN	FERRULE+GASKET												
DIAGRAM		ASSEMBLY INSTRUCTION												
		Step 1: STRIP AS SHOWN.												
		Step 2: MAKE A 3.0MM LONG CUT IN THE JACKET WITHOUT DAMAGING THE BRAIDING.												
		Step 3: SLIDE FERRULE " C " OVER CABLE. Step 4: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". (USE SQUARE 1.6mm/0.063inch SECTION OF JYEBAO INSERT-E IF CRIMPED)												
		Step 5: INSERT PREPARED CABLE INTO CONNECTOR BODY " A ".												
		Step 6: SCREW FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 6.5mm/0.256inch HEX SECTION OF JYEBAO INSERT-E)												
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.														
APPROVED		CHECKED		DRAWING										
				Albert										

N3100B-0142/HS

S11

