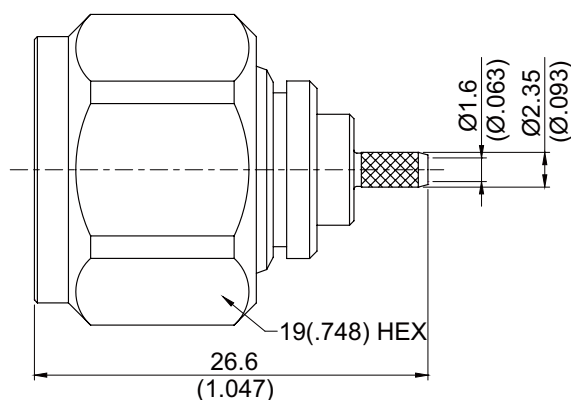


N3100BAD-0316

N Plug Crimp For RD316,RD316-FEP
7GHz VSWR 1.2

50Ω



Parts	Material	Plating (Micro-inch)
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Small Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Gasket	Silicon	
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Suitable Cables: RD316,RD316-FEP

This part number complies with RoHS.

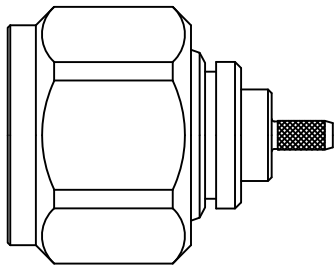
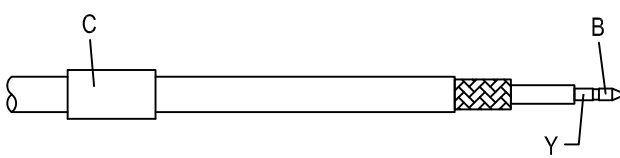
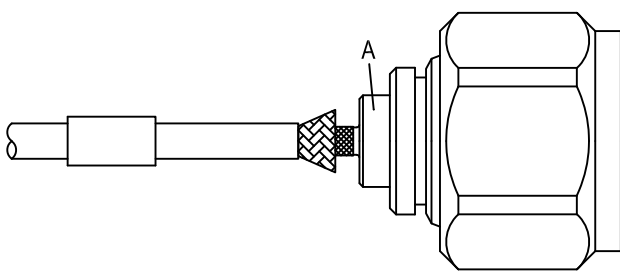
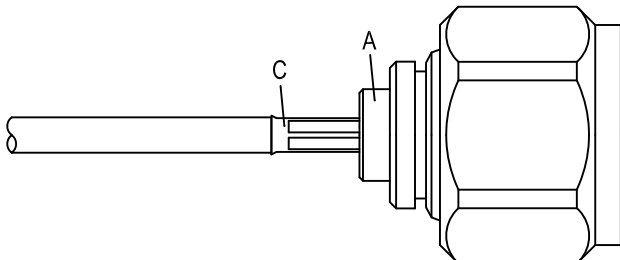
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N		N3100BAD-0316	
Interface		MIL-STD-348B	
Electrical Data		Impedance 50Ω Frequency range DC to 7GHz VSWR ≤ 1.2 (DC to 7GHz) Insertion loss $\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 5000\text{M}\Omega$ Contact resistance inner conductor $\leq 1.5\text{m}\Omega$ Contact resistance outer conductor $\leq 1\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 2500 V rms Working voltage (at sea level) 1000 V rms	
Mechanical Data		Recommended coupling nut torque 6 to 10 inch lbs Coupling proof torque 15 inch lbs Coupling nut retention force ≥ 101.2 lbs Contact captivation-axial ≥ 6.3 lbs Durability (mating) ≥ 500	
Environmental Data		Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling		Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-A	

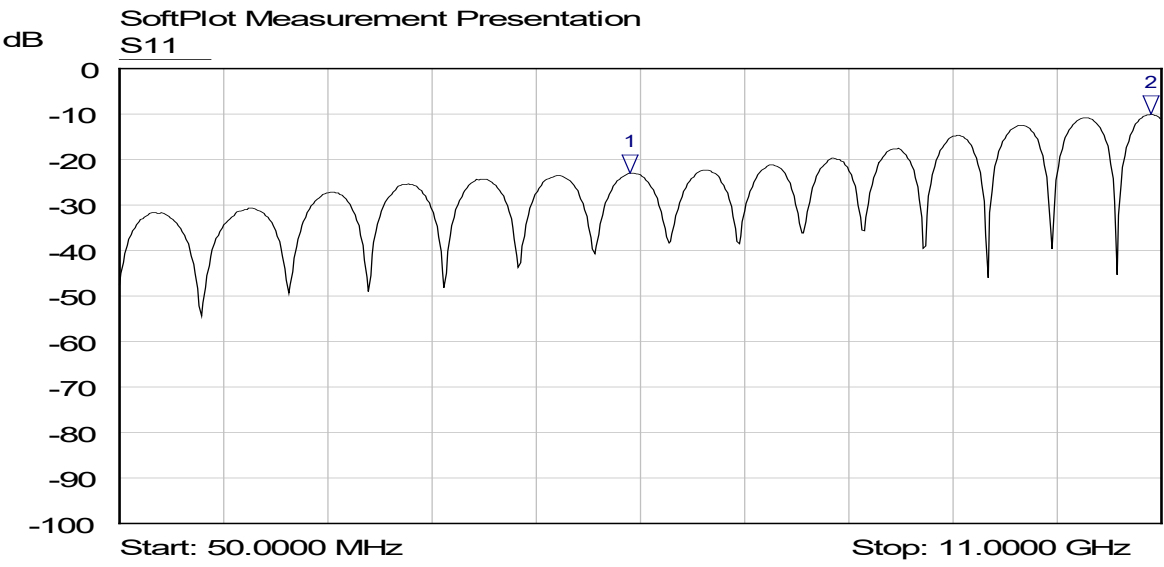
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY RECOMMENDATION

N3100BAD-0316		DATE	2014/04/29	REV	—
A  BODY B  SMALL PIN C  FERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND CRIMP IN " Y ". (USE SQUARE 0.7mm/0.028inch SECTION OF INSERT-A IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

N3100BAD-0316



Mkr	Trace	X-Axis	Value	Notes
1 ▽	S11	5.4210 GHz	-22.95 dB	
2 ▽	S11	10.8919 GHz	-10.04 dB	