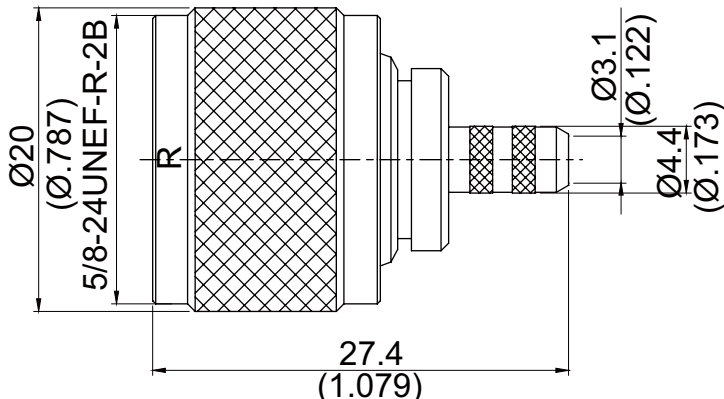


N3100BR-0058	N Plug Crimp With Reverse Thread For RG58,JBY195,LMR195; 6GHz VSWR 1.25*		50Ω																					
																								
*Using JBY195 cable																								
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Ferrule</td><td>Copper</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Contact Pin</td><td>Brass</td><td>Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>				Parts	Material	Plating (Micro-inch)	Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																						
Ferrule	Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50																						
Gasket	Silicon																							
Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20																						
Insulator	Teflon																							
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																						
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																						
Suitable Cables:RG58,JBY195,JBY195-LSFH																								

This part number complies with RoHS.

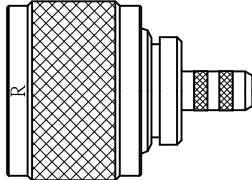


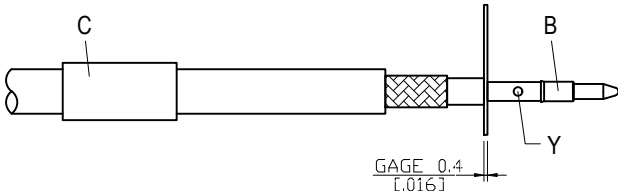
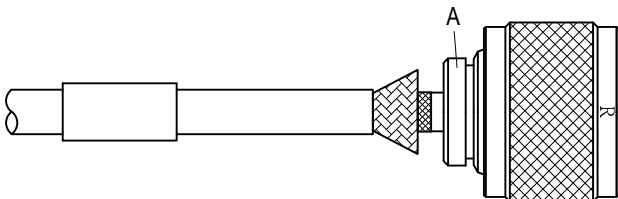
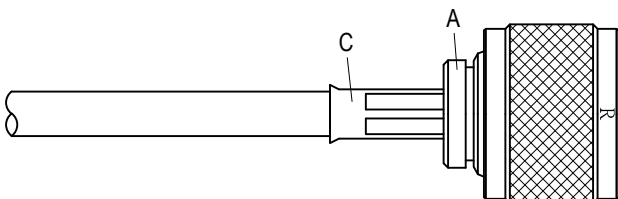
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N		N3100BR-0058																			
Interface MIL-STD-348B																					
Electrical Data <table><tr><td>Impedance</td><td>50Ω</td></tr><tr><td>Frequency range</td><td>DC to 6GHz</td></tr><tr><td>VSWR</td><td>≤ 1.25 (DC to 6GHz)</td></tr><tr><td>Insertion loss</td><td>≤ 0.05 x √f(GHz) dB</td></tr><tr><td>Insulation resistance</td><td>≥ 5000MΩ</td></tr><tr><td>Contact resistance inner conductor</td><td>≤ 1.5mΩ</td></tr><tr><td>Contact resistance outer conductor</td><td>≤ 1mΩ</td></tr><tr><td>Dielectric withstanding voltage (at sea level)</td><td>2500 V rms</td></tr><tr><td>Working voltage (at sea level)</td><td>1000 V rms</td></tr></table>				Impedance	50Ω	Frequency range	DC to 6GHz	VSWR	≤ 1.25 (DC to 6GHz)	Insertion loss	≤ 0.05 x √f(GHz) dB	Insulation resistance	≥ 5000MΩ	Contact resistance inner conductor	≤ 1.5mΩ	Contact resistance outer conductor	≤ 1mΩ	Dielectric withstanding voltage (at sea level)	2500 V rms	Working voltage (at sea level)	1000 V rms
Impedance	50Ω																				
Frequency range	DC to 6GHz																				
VSWR	≤ 1.25 (DC to 6GHz)																				
Insertion loss	≤ 0.05 x √f(GHz) dB																				
Insulation resistance	≥ 5000MΩ																				
Contact resistance inner conductor	≤ 1.5mΩ																				
Contact resistance outer conductor	≤ 1mΩ																				
Dielectric withstanding voltage (at sea level)	2500 V rms																				
Working voltage (at sea level)	1000 V rms																				
Mechanical Data <table><tr><td>Recommended coupling nut torque</td><td>6 to 10 inch lbs</td></tr><tr><td>Coupling proof torque</td><td>15 inch lbs</td></tr><tr><td>Coupling nut retention force</td><td>≥ 101.2 lbs</td></tr><tr><td>Contact captivation-axial</td><td>≥ 6.3 lbs</td></tr><tr><td>Durability (mating)</td><td>≥ 500</td></tr></table>				Recommended coupling nut torque	6 to 10 inch lbs	Coupling proof torque	15 inch lbs	Coupling nut retention force	≥ 101.2 lbs	Contact captivation-axial	≥ 6.3 lbs	Durability (mating)	≥ 500								
Recommended coupling nut torque	6 to 10 inch lbs																				
Coupling proof torque	15 inch lbs																				
Coupling nut retention force	≥ 101.2 lbs																				
Contact captivation-axial	≥ 6.3 lbs																				
Durability (mating)	≥ 500																				
Environmental Data <table><tr><td>Temperature range</td><td>-65°C to +165°C</td></tr><tr><td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr><tr><td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr><tr><td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr><tr><td>RoHS</td><td>Compliant</td></tr></table>				Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																				
Thermal shock	MIL-STD-202, Method 107, Condition B																				
Moisture resistance	MIL-STD-202, Method 106																				
Corrosion	MIL-STD-202, Method 101, Condition B																				
RoHS	Compliant																				
Tooling <table><tr><td>Crimping tool</td><td>CRT-1 or CRT-2</td></tr><tr><td>Crimp insert</td><td>INSERT-B</td></tr><tr><td>Soldering gauge</td><td>ST-0.4</td></tr></table>				Crimping tool	CRT-1 or CRT-2	Crimp insert	INSERT-B	Soldering gauge	ST-0.4												
Crimping tool	CRT-1 or CRT-2																				
Crimp insert	INSERT-B																				
Soldering gauge	ST-0.4																				

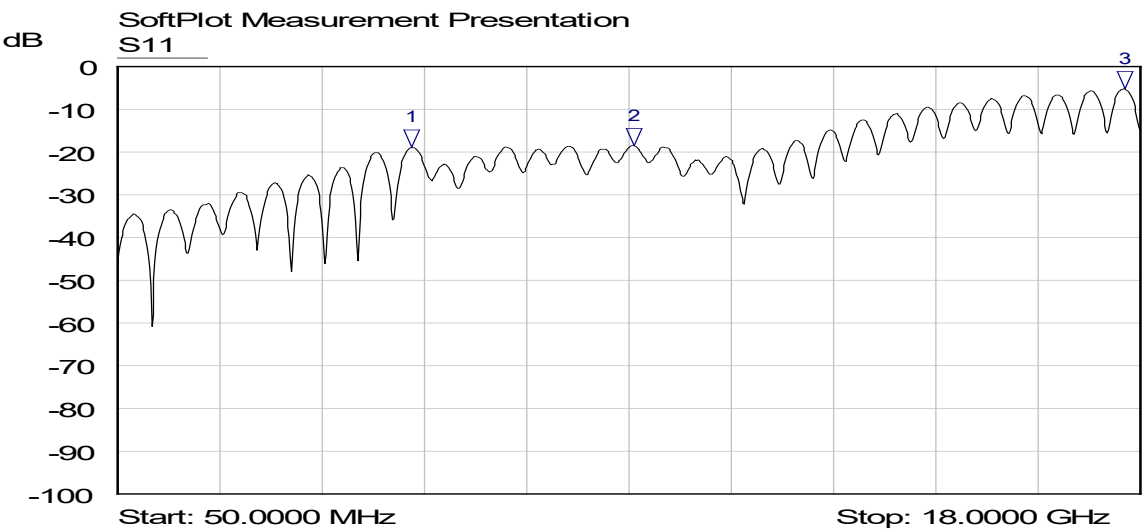
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3100BR-0058		DATE	2018/02/13	REV	A
A		B		C	
					
BODY		CONTACT PIN		FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT 0.4 MM GAGE IN PLACE, INSERT CABLE'S CENTER CONDUCTOR INTO CENTER PIN " B " AND SOLDER OR CRIMP IN " Y ". (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-B IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	

N3100BR-0058 (using JBY195)



Mkr	Trace	X-Axis	Value	Notes
1 ▽	S11	5.2014 GHz	-18.89 dB	
2 ▽	S11	9.1148 GHz	-18.50 dB	
3 ▽	S11	17.7205 GHz	-5.21 dB	