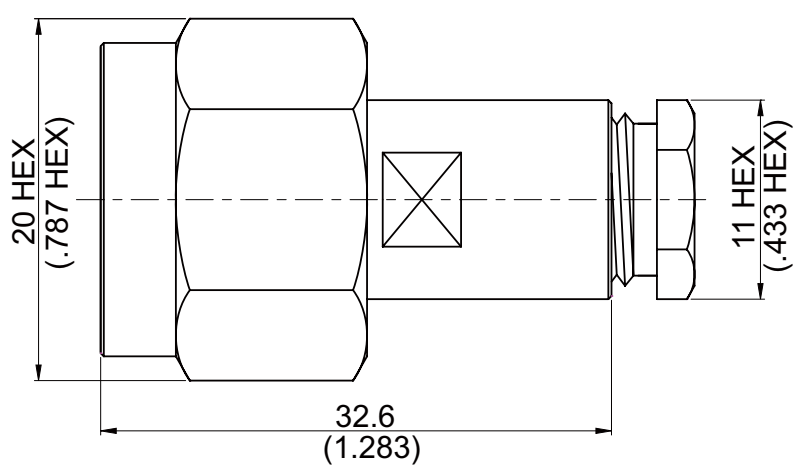


N3200A-0059	N Plug Clamp For RG59; 1.4GHz VSWR 1.2 & 2GHz VSWR 1.3		75Ω
			

This part number complies with RoHS.

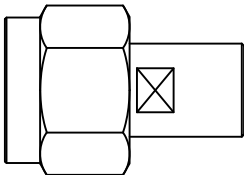
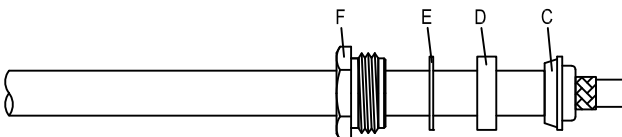
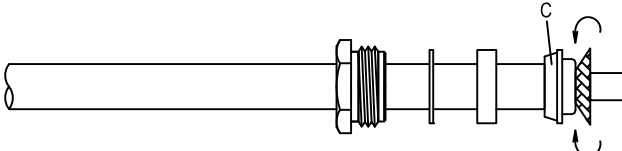
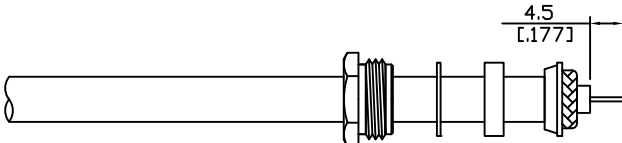

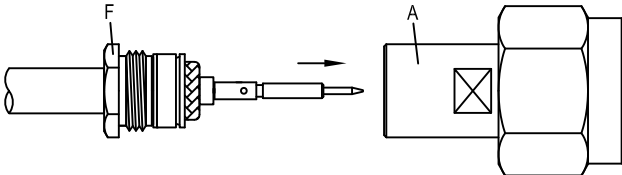
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N	N3200A-0059																				
Interface MIL-STD-348B																					
Electrical Data <table> <tr> <td>Impedance</td><td>75Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 2GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (1.4GHz); ≤ 1.3 (2GHz)</td></tr> <tr> <td>Insertion loss</td><td>$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB</td></tr> <tr> <td>Insulation resistance</td><td>$\geq 5000\text{M}\Omega$</td></tr> <tr> <td>Contact resistance inner conductor</td><td>$\leq 1\text{m}\Omega$</td></tr> <tr> <td>Contact resistance outer conductor</td><td>$\leq 1\text{m}\Omega$</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>2500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>1000 V rms</td></tr> <tr> <td>RF leakage</td><td>$\geq 128\text{dB}$ to 1GHz</td></tr> </table>		Impedance	75Ω	Frequency range	DC to 2GHz	VSWR	≤ 1.2 (1.4GHz); ≤ 1.3 (2GHz)	Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB	Insulation resistance	$\geq 5000\text{M}\Omega$	Contact resistance inner conductor	$\leq 1\text{m}\Omega$	Contact resistance outer conductor	$\leq 1\text{m}\Omega$	Dielectric withstanding voltage (at sea level)	2500 V rms	Working voltage (at sea level)	1000 V rms	RF leakage	$\geq 128\text{dB}$ to 1GHz
Impedance	75Ω																				
Frequency range	DC to 2GHz																				
VSWR	≤ 1.2 (1.4GHz); ≤ 1.3 (2GHz)																				
Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB																				
Insulation resistance	$\geq 5000\text{M}\Omega$																				
Contact resistance inner conductor	$\leq 1\text{m}\Omega$																				
Contact resistance outer conductor	$\leq 1\text{m}\Omega$																				
Dielectric withstanding voltage (at sea level)	2500 V rms																				
Working voltage (at sea level)	1000 V rms																				
RF leakage	$\geq 128\text{dB}$ to 1GHz																				
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>6 to 10 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>15 inch lbs</td></tr> <tr> <td>Coupling nut retention force</td><td>≥ 101.2 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.3 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	6 to 10 inch lbs	Coupling proof torque	15 inch lbs	Coupling nut retention force	≥ 101.2 lbs	Contact captivation-axial	≥ 6.3 lbs	Durability (mating)	≥ 500										
Recommended coupling nut torque	6 to 10 inch lbs																				
Coupling proof torque	15 inch lbs																				
Coupling nut retention force	≥ 101.2 lbs																				
Contact captivation-axial	≥ 6.3 lbs																				
Durability (mating)	≥ 500																				
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant										
Temperature range	-65°C to +165°C																				
Thermal shock	MIL-STD-202, Method 107, Condition B																				
Moisture resistance	MIL-STD-202, Method 106																				
Corrosion	MIL-STD-202, Method 101, Condition B																				
RoHS	Compliant																				
Tooling																					

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3200A-0059		DATE	2014/04/29		REV	—
A	B	C	D	E	F	
						
BODY	CONTACT PIN	BRAID CLAMP	GASKET	WASHER	NUT	
DIAGRAM			ASSEMBLY INSTRUCTION			
			Step 1: STRIP AS SHOWN.			
			Step 2: SLIDE NUT " F " 、 WASHER " E " 、 GASKET " D " AND BRAID CLAMP " C " OVER CABLE.			
			Step 3: WRAP THE BRAIDING OVER " C ".			
			Step 4: STRIP AS SHOWN.			
			Step 5: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".			
			Step 6: FINALLY SCREW " F " ON THE CONNECTOR BODY " A ".			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.						
APPROVED		CHECKED		DRAWING		
				Albert		

N3200A-0059

S11

