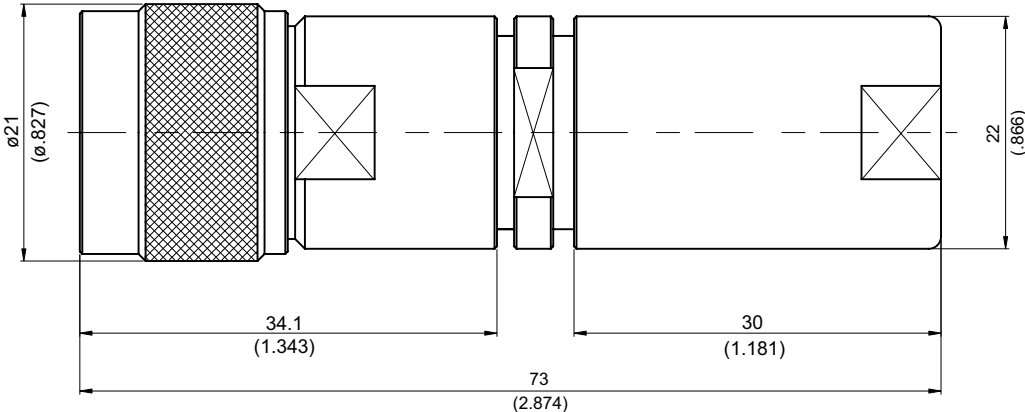


N3200B-0217	N plug clamp for RG217; 5GHz VSWR 1.2		50Ω																																				
																																							
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Crimp Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Braid Clamp</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Contact Pin</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Retainer Ring</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Contact Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>				Parts	Material	Plating (Micro-inch)	Crimp Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Insulator	Teflon		Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																																					
Crimp Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																					
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																					
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																					
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																					
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																																					
Insulator	Teflon																																						
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																					
Gasket	Silicon																																						
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																					
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																					
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																					
Weight: 101.81 g Suitable Cables: RG217																																							

This part number complies with RoHS.





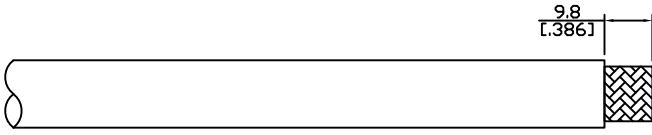
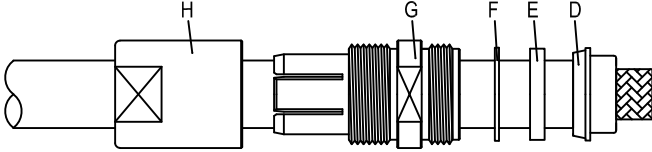
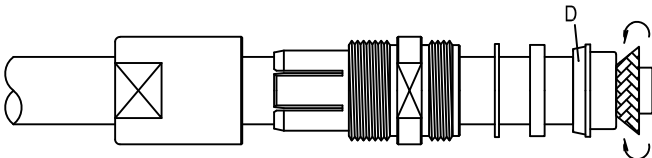
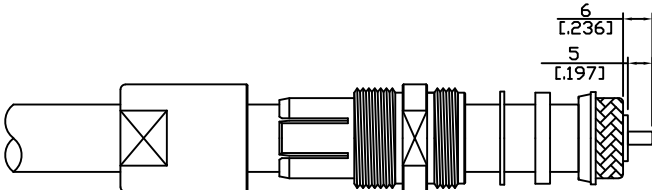
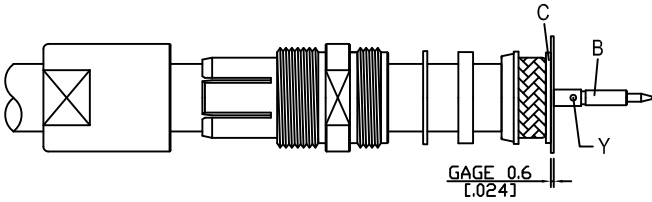
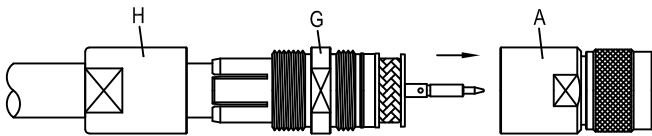
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N	N3200B-0217																		
Interface MIL-STD-348B																			
Electrical Data <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 5GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 5GHz)</td></tr> <tr> <td>Insertion loss</td><td>≤ 0.05 x √f(GHz) dB</td></tr> <tr> <td>Insulation resistance</td><td>≥ 5000MΩ</td></tr> <tr> <td>Contact resistance inner conductor</td><td>≤ 1.5mΩ</td></tr> <tr> <td>Contact resistance outer conductor</td><td>≤ 1mΩ</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>2500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>1000 V rms</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 5GHz	VSWR	≤ 1.2 (DC to 5GHz)	Insertion loss	≤ 0.05 x √f(GHz) dB	Insulation resistance	≥ 5000MΩ	Contact resistance inner conductor	≤ 1.5mΩ	Contact resistance outer conductor	≤ 1mΩ	Dielectric withstanding voltage (at sea level)	2500 V rms	Working voltage (at sea level)	1000 V rms
Impedance	50Ω																		
Frequency range	DC to 5GHz																		
VSWR	≤ 1.2 (DC to 5GHz)																		
Insertion loss	≤ 0.05 x √f(GHz) dB																		
Insulation resistance	≥ 5000MΩ																		
Contact resistance inner conductor	≤ 1.5mΩ																		
Contact resistance outer conductor	≤ 1mΩ																		
Dielectric withstanding voltage (at sea level)	2500 V rms																		
Working voltage (at sea level)	1000 V rms																		
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>6 to 10 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>15 inch lbs</td></tr> <tr> <td>Coupling nut retention force</td><td>≥ 101.2 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.3 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	6 to 10 inch lbs	Coupling proof torque	15 inch lbs	Coupling nut retention force	≥ 101.2 lbs	Contact captivation-axial	≥ 6.3 lbs	Durability (mating)	≥ 500								
Recommended coupling nut torque	6 to 10 inch lbs																		
Coupling proof torque	15 inch lbs																		
Coupling nut retention force	≥ 101.2 lbs																		
Contact captivation-axial	≥ 6.3 lbs																		
Durability (mating)	≥ 500																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling <table> <tr> <td>Soldering gauge</td><td>ST-0.6</td></tr> </table>		Soldering gauge	ST-0.6																
Soldering gauge	ST-0.6																		

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3200B-0217				DATE	2020/05/30	REV	B
A	B	C	D	E	F	G	H
							
BODY	CONTACT PIN	WASHER	BRAID CLAMP	GASKET	WASHER	NUT	NUT
DIAGRAM				ASSEMBLY INSTRUCTION			
				Step 1: STRIP AS SHOWN.			
				Step 2: SLIDE NUT "H" 、 NUT "G" 、 WASHER "F" 、 GASKET "E" AND BRAID CLAMP "D" OVER CABLE.			
				Step 3: WRAP THE BRAIDING OVER "D" .			
				Step 4: STRIP AS SHOWN.			
				Step 5: SLIDE PREPARED CABLE INTO WASHER "C" . Step 6: PUT 0.6 MM GAGE IN PLACE, INSERT CABLE'S CENTER CONDUCTOR INTO CONTACT PIN "B" AND SOLDER IN "Y" .			
				Step 7: SCREW NUT "G" ON THE CONNECTOR BODY "A" . Step 9: SCREW NUT "H" ON THE NUT "G" .			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.							
APPROVED		CHECKED		DRAWING		Albert	

N3200B-0217

S11

