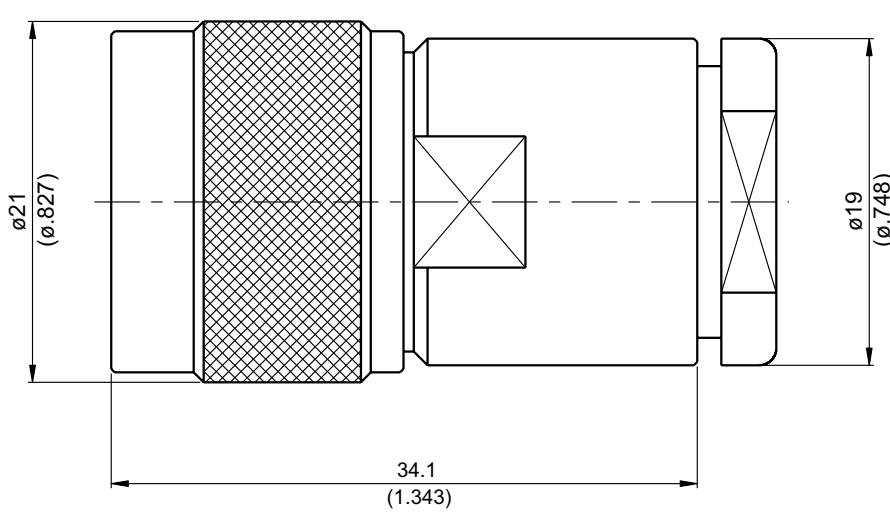


N3200B-8DFB	N Plug Clamp For 8DFB 6GHz VSWR 1.2	50Ω																																	
																																			
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Braid Clamp</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Center Pin</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Retainer Ring</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Contact Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>			Parts	Material	Plating (Micro-inch)	Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Insulator	Teflon		Center Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																																	
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Insulator	Teflon																																		
Center Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																																	
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Gasket	Silicon																																		
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Weight: 51.37 g																																			
Suitable Cables: 8DFB																																			

This part number complies with RoHS.

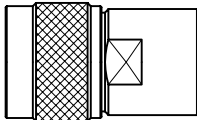


Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N	N3200B-8DFB																		
Interface MIL-STD-348B																			
Electrical Data <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 6GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 6GHz)</td></tr> <tr> <td>Insertion loss</td><td>$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB</td></tr> <tr> <td>Insulation resistance</td><td>$\geq 5000\text{M}\Omega$</td></tr> <tr> <td>Contact resistance inner conductor</td><td>$\leq 1.5\text{m}\Omega$</td></tr> <tr> <td>Contact resistance outer conductor</td><td>$\leq 1\text{m}\Omega$</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>2500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>1000 V rms</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 6GHz	VSWR	≤ 1.2 (DC to 6GHz)	Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB	Insulation resistance	$\geq 5000\text{M}\Omega$	Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$	Contact resistance outer conductor	$\leq 1\text{m}\Omega$	Dielectric withstanding voltage (at sea level)	2500 V rms	Working voltage (at sea level)	1000 V rms
Impedance	50Ω																		
Frequency range	DC to 6GHz																		
VSWR	≤ 1.2 (DC to 6GHz)																		
Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB																		
Insulation resistance	$\geq 5000\text{M}\Omega$																		
Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$																		
Contact resistance outer conductor	$\leq 1\text{m}\Omega$																		
Dielectric withstanding voltage (at sea level)	2500 V rms																		
Working voltage (at sea level)	1000 V rms																		
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>6 to 10 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>15 inch lbs</td></tr> <tr> <td>Coupling nut retention force</td><td>≥ 101.2 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.3 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	6 to 10 inch lbs	Coupling proof torque	15 inch lbs	Coupling nut retention force	≥ 101.2 lbs	Contact captivation-axial	≥ 6.3 lbs	Durability (mating)	≥ 500								
Recommended coupling nut torque	6 to 10 inch lbs																		
Coupling proof torque	15 inch lbs																		
Coupling nut retention force	≥ 101.2 lbs																		
Contact captivation-axial	≥ 6.3 lbs																		
Durability (mating)	≥ 500																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling																			

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3200B-8DFB				DATE	2014/04/29	REV	—	
A	B	C	D	E	F	G	H	I
								
BODY	INSULATOR	CONTACT PIN	INSULATOR	WASHER	BRAID CLAMP	GASKET	WASHER	NUT
DIAGRAM				ASSEMBLY INSTRUCTION				
8.2 [0.323] 7.5 [0.295]				Step 1: STRIP AS SHOWN.				
I H G F				Step 2: SLIDE NUT " I " 、 WASHER " H " 、 GASKET " G " AND BRAID CLAMP " F " OVER CABLE.				
F				Step 3: WRAP THE BRAIDING OVER " F ".				
6.6 [0.260] 5.5 [0.217]				Step 4: STRIP AS SHOWN.				
E D C Y				Step 5: SLIDE WASHER " E " IN PLACE. Step 6: PUT INSULATOR " D " AND CONTACT PIN " C " ON CENTER CONDUCTOR AND SOLDER IN " Y ".				
I B A				Step 7: SLIDE INSULATOR " B " INTO CONNECTOR BODY " A ". Step 8: FINALLY SCREW NUT " I " ON THE CONNECTOR BODY " A ".				
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.								
APPROVED			CHECKED			DRAWING		
						Albert		

N3200B-8DFB

S11

