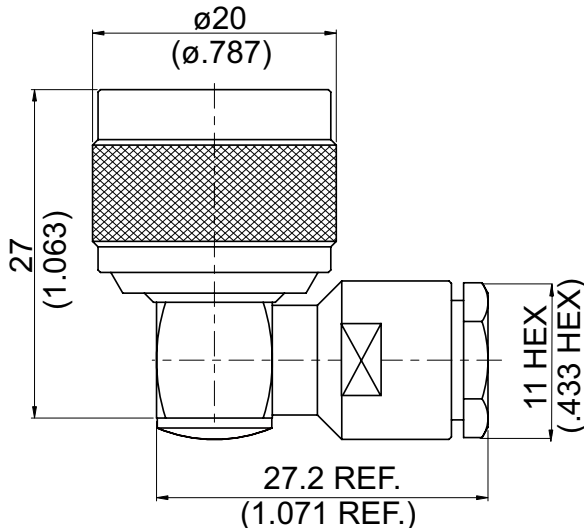


N3200B-9059	N Plug Clamp Right Angle For RG59; 1GHz VSWR 1.2		75Ω																														
																																	
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Hex Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Braid Clamp</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Contact Pin</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>				Parts	Material	Plating (Micro-inch)	Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																															
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																															
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																															
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																															
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																															
Gasket	Silicon																																
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																															
Insulator	Teflon																																
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																															
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																															
Weight: 37.5 g Suitable Cables: RG59																																	

This part number complies with RoHS.

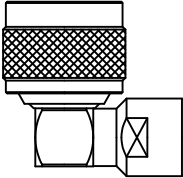
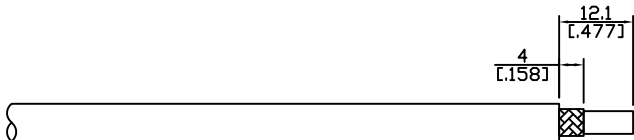
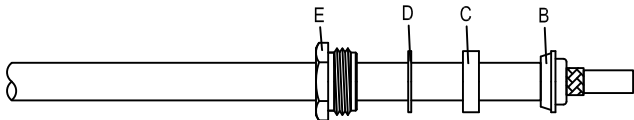
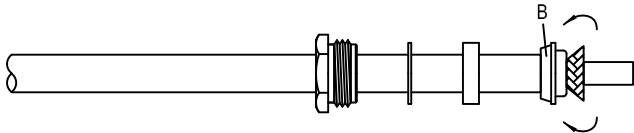
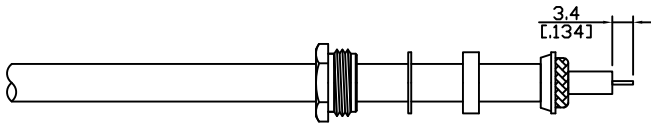
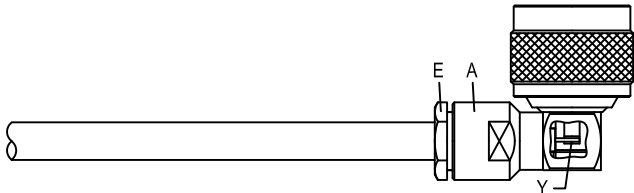
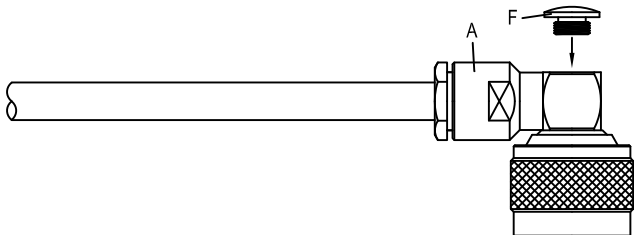
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N	N3200B-9059																				
Interface MIL-STD-348B																					
Electrical Data <table> <tr> <td>Impedance</td><td>75Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 1GHz</td></tr> <tr> <td>VSWR</td><td>≤1.2 (DC to 1GHz)</td></tr> <tr> <td>Insertion loss</td><td>≤0.05 x √f(GHz) dB</td></tr> <tr> <td>Insulation resistance</td><td>≥5000MΩ</td></tr> <tr> <td>Contact resistance inner conductor</td><td>≤1mΩ</td></tr> <tr> <td>Contact resistance outer conductor</td><td>≤1mΩ</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>2500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>1000 V rms</td></tr> <tr> <td>RF leakage</td><td>≥128dB to 1GHz</td></tr> </table>		Impedance	75Ω	Frequency range	DC to 1GHz	VSWR	≤1.2 (DC to 1GHz)	Insertion loss	≤0.05 x √f(GHz) dB	Insulation resistance	≥5000MΩ	Contact resistance inner conductor	≤1mΩ	Contact resistance outer conductor	≤1mΩ	Dielectric withstanding voltage (at sea level)	2500 V rms	Working voltage (at sea level)	1000 V rms	RF leakage	≥128dB to 1GHz
Impedance	75Ω																				
Frequency range	DC to 1GHz																				
VSWR	≤1.2 (DC to 1GHz)																				
Insertion loss	≤0.05 x √f(GHz) dB																				
Insulation resistance	≥5000MΩ																				
Contact resistance inner conductor	≤1mΩ																				
Contact resistance outer conductor	≤1mΩ																				
Dielectric withstanding voltage (at sea level)	2500 V rms																				
Working voltage (at sea level)	1000 V rms																				
RF leakage	≥128dB to 1GHz																				
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>6 to 10 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>15 inch lbs</td></tr> <tr> <td>Coupling nut retention force</td><td>≥101.2 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥6.3 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥500</td></tr> </table>		Recommended coupling nut torque	6 to 10 inch lbs	Coupling proof torque	15 inch lbs	Coupling nut retention force	≥101.2 lbs	Contact captivation-axial	≥6.3 lbs	Durability (mating)	≥500										
Recommended coupling nut torque	6 to 10 inch lbs																				
Coupling proof torque	15 inch lbs																				
Coupling nut retention force	≥101.2 lbs																				
Contact captivation-axial	≥6.3 lbs																				
Durability (mating)	≥500																				
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant										
Temperature range	-65°C to +165°C																				
Thermal shock	MIL-STD-202, Method 107, Condition B																				
Moisture resistance	MIL-STD-202, Method 106																				
Corrosion	MIL-STD-202, Method 101, Condition B																				
RoHS	Compliant																				
Tooling																					

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3200B-9059			DATE	2014/04/29	REV	—
A	B	C	D	E	F	
						
BODY	BRAID CLAMP	GASKET	WASHER	HEX NUT	NUT	
DIAGRAM			ASSEMBLY INSTRUCTION			
			Step 1: STRIP AS SHOWN.			
			Step 2: SLIDE NUT " E " 、 WASHER " D " 、 GASKET " C " AND BRAID CLAMP " B " OVER CABLE.			
			Step 3: WRAP THE BRAIDING OVER " B " .			
			Step 4: STRIP AS SHOWN.			
			Step 5: SCREW NUT " E " ON THE CONNECTOR BODY " A " AND SOLDER IN " Y " .			
			Step 6: FINALLY SCREW NUT " F " ON THE CONNECTOR BODY " A " .			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.						
APPROVED		CHECKED		DRAWING		
				Albert		

N3200B-9059

