

N3200B-9213	N Plug Clamp Right Angle 3GHz VSWR 1.2	50Ω																														
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Hex Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Braid Clamp</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Center Pin</td><td>Brass</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>			Parts	Material	Plating (Micro-inch)	Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Center Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																														
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Gasket	Silicon																															
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Center Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																														
Insulator	Teflon																															
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Weight: 70.96 g Suitable Cables: RG8, RG213																																

This part number complies with RoHS.

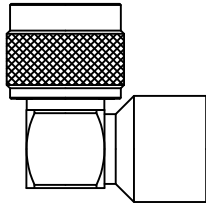
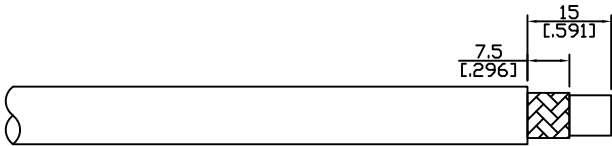
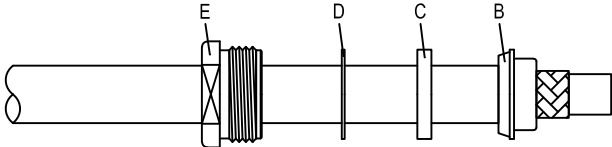
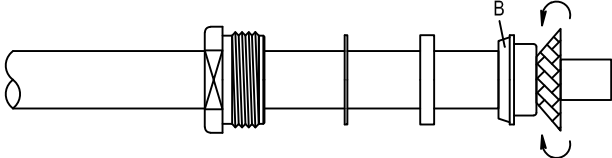
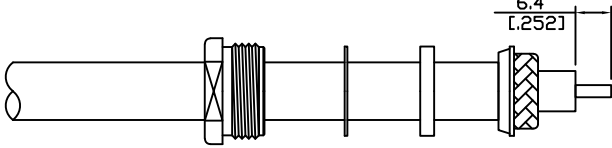
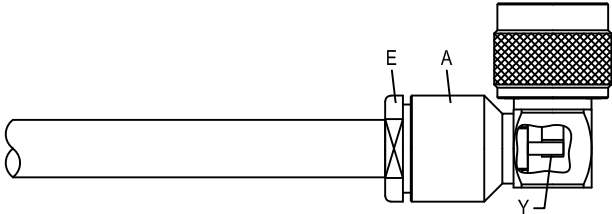
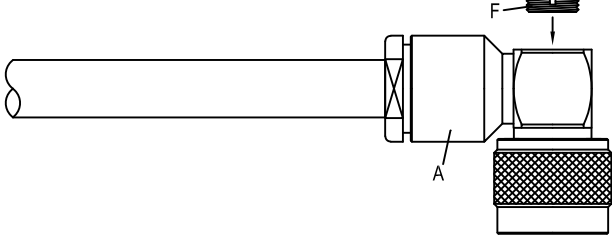
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N	N3200B-9213
Interface MIL-STD-348B	
Electrical Data Impedance Frequency range VSWR Insertion loss Insulation resistance Contact resistance inner conductor Contact resistance outer conductor Dielectric withstanding voltage (at sea level) Working voltage (at sea level) 50Ω DC to 3GHz ≤ 1.2 (DC to 3GHz) $\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB $\geq 5000\text{M}\Omega$ $\leq 1.5\text{m}\Omega$ $\leq 1\text{m}\Omega$ 2500 V rms 1000 V rms	
Mechanical Data Recommended coupling nut torque Coupling proof torque Coupling nut retention force Contact captivation-axial Durability (mating) 6 to 10 inch lbs 15 inch lbs ≥ 101.2 lbs ≥ 6.3 lbs ≥ 500	
Environmental Data Temperature range Thermal shock Moisture resistance Corrosion RoHS -65°C to +165°C MIL-STD-202, Method 107, Condition B MIL-STD-202, Method 106 MIL-STD-202, Method 101, Condition B Compliant	
Tooling	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3200B-9213			DATE	2020/03/18	REV	—
A	B	C	D	E	F	
						
BODY		BRAID CLAMP	GASKET	WASHER	HEX NUT	NUT
DIAGRAM			ASSEMBLY INSTRUCTION			
			Step 1: STRIP AS SHOWN.			
			Step 2: SLIDE NUT " E " 、 WASHER " D " 、 GASKET " C " AND BRAID CLAMP " B " OVER CABLE.			
			Step 3: WRAP THE BRAIDING OVER " B " .			
			Step 4: STRIP AS SHOWN.			
			Step 5: SCREW NUT " E " ON THE CONNECTOR BODY " A " AND SOLDER IN " Y " .			
			Step 6: FINALLY SCREW NUT " F " ON THE CONNECTOR BODY " A " .			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.						
APPROVED		CHECKED		DRAWING		
				Albert		

N3200B-9213

