


N3200BA-0219

N Plug Clamp

50Ω

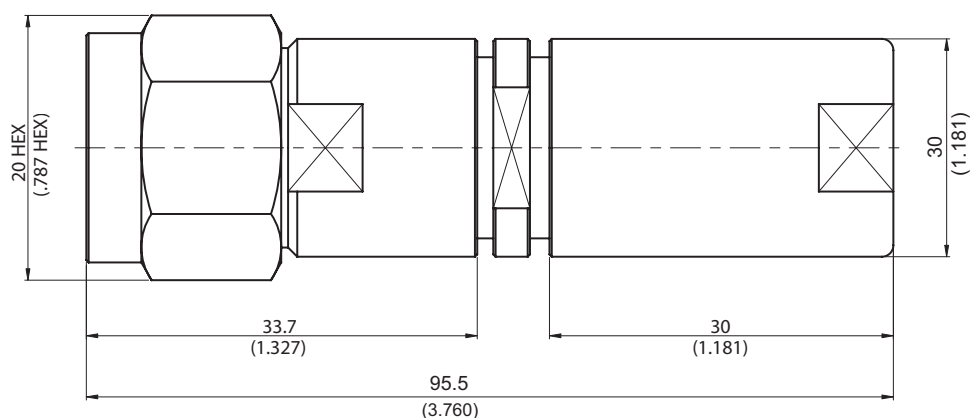

Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Center Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: RG219

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N3200BA-0219

JYE BAO CO., LTD.

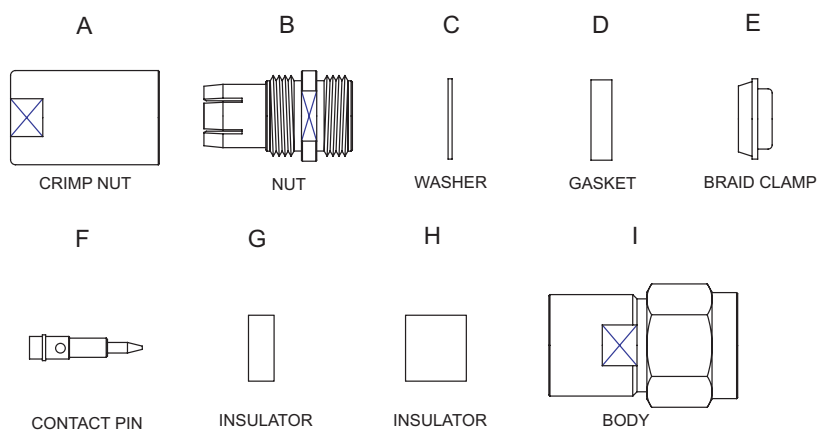


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE "A" "B" "C" "D" "E" OVER CABLE.
	Step 3: WRAP THE BRAIDING OVER "E". Step 4: STRIP THE DIELECTRIC AS SHOWN.
	Step 5: PUT TEFLON "G" AND PIN "F" IN PLACE AND SOLDER IT TO THE CENTER CONDUCTOR.
	Step 6: SLIDE TEFLON "H" INTO CONNECTOR BODY "I". Step 7: SCREW "B" ON THE CONNECTOR BODY "I". Step 8: SCREW "A" ON THE NUT "B".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.