


N6100A-9L200

N Reverse Polarity Plug Crimp Right Angle 50Ω

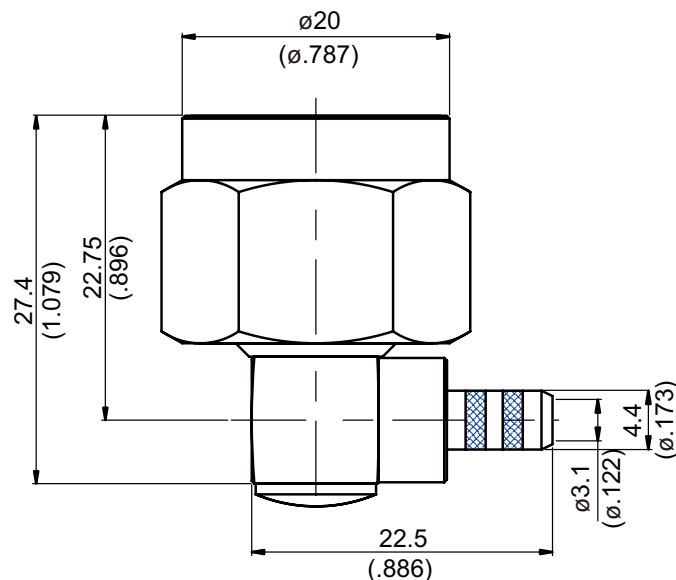

NOTE: 20 MM HEX NUT

Parts	Material	Plating(Micro-inch)
Contact Pin	Phosphor Bronze	Gold 5 Over Nickel 50 Over Copper 50
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Insulator	Teflon	
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:
Suitable Cables: JBY200

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N6100A-9L200

JYE BAO CO., LTD.

N6100A-9L200

DATE

2014/04/29


REV

—

A

B

C

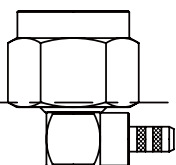

BODY

COVER


FERRULE

DIAGRAM


ASSEMBLY INSTRUCTION




Step 1: STRIP AS SHOWN.

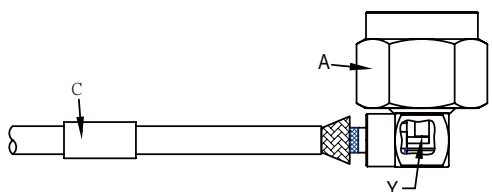

Step 2: SLIDE FERRULE "C" OVER CABLE.
Step 3: WRAP THE BRAIDING UPWARDS.
Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "A" AND SOLDER IN "Y".

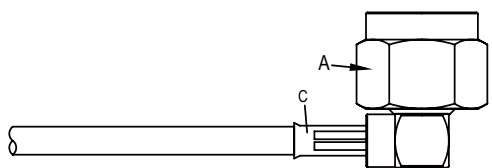

Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP.
(USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)

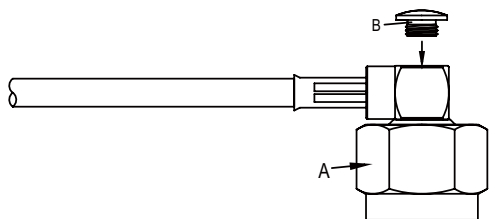

Step 6: FINALLY SCREW "B" ON THE CONNECTOR BODY "A".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.