


N6100A-L200

N Reverse Polarity Plug Crimp 50Ω

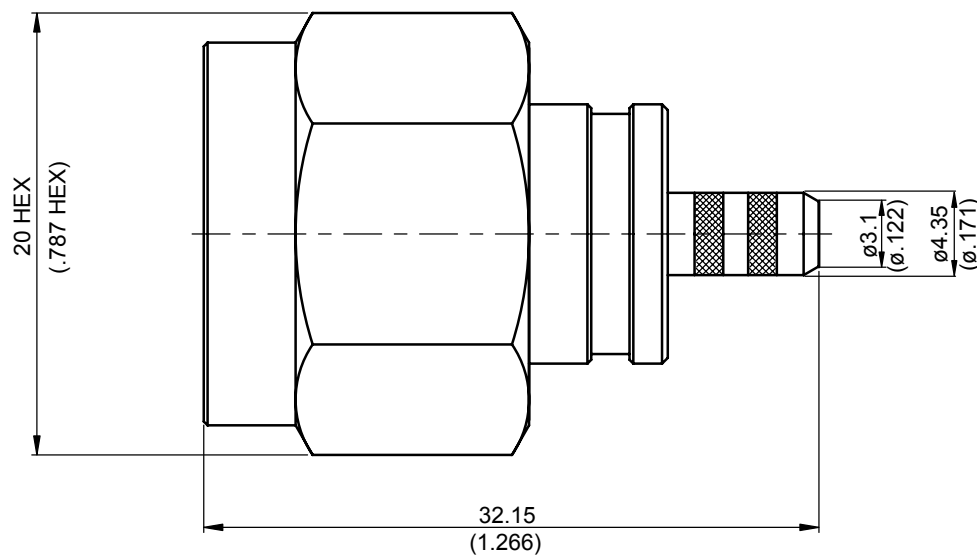

Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Phosphor Bronze	Gold 5 Over Nickel 50 Over Copper 50
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: LMR200, JBY200

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N6100A-L200

JYE BAO CO., LTD.

N6100A-L200

DATE

2014/04/29


REV

—


A

B

C

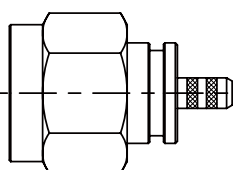

BODY



CONTACT PIN




FERRULE

DIAGRAM


ASSEMBLY INSTRUCTION




Step 1: STRIP AS SHOWN.

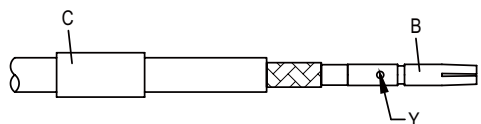

Step 2: SLIDE FERRULE "C" OVER CABLE.
Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN "Y".
(USE SQUARE 2.4mm/0.094inch SECTION OF INSERT-B IF CRIMPED)

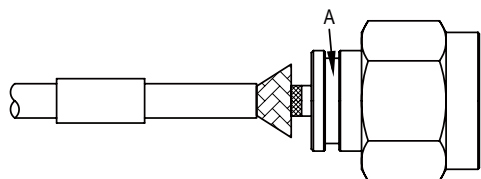

Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "A" IN PLACE.

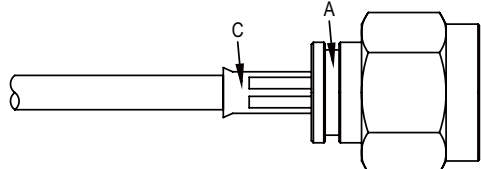

Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP.
(USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.