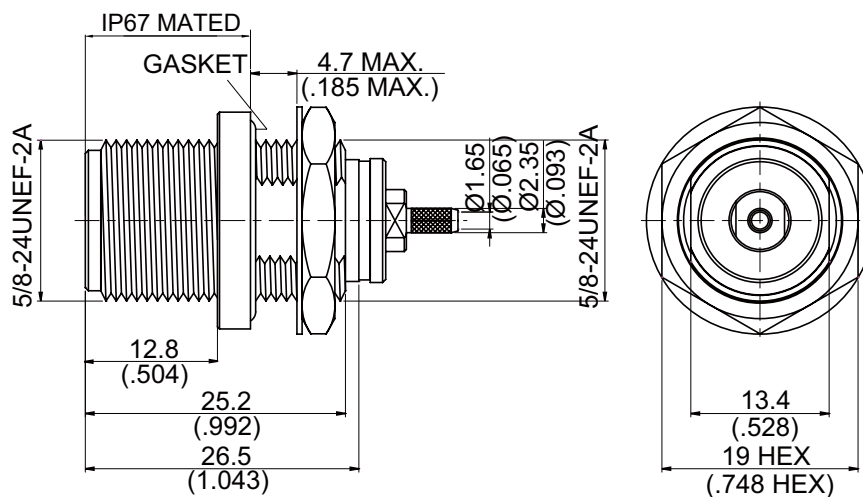


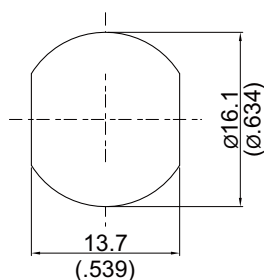
N8105B-D179

**N Jack Crimp Bulkhead, IP67 Mated,
For RG179; 3GHz VSWR 1.2**

75Ω



MOUNTING HOLE:



Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Crimp Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Suitable Cables: RG179, RG179-FEP

This part number complies with RoHS.

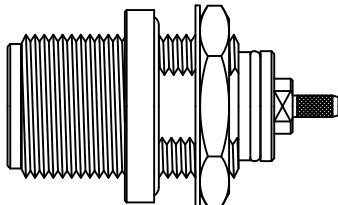
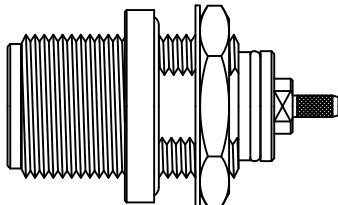
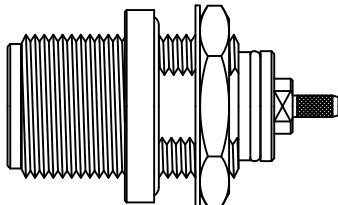
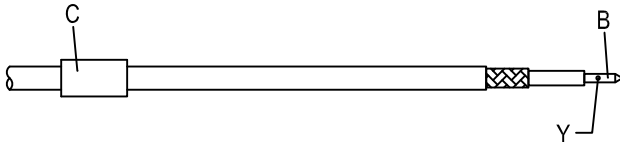
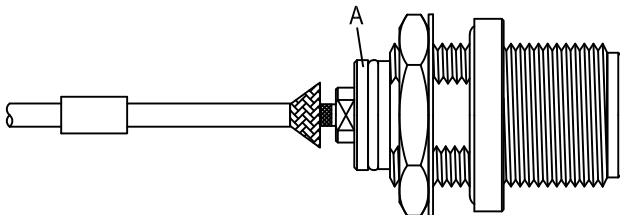
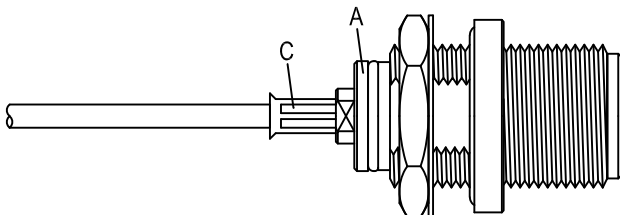
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N	N8105B-D179
Interface MIL-STD-348B	
Electrical Data Impedance 75Ω Frequency range DC to 3GHz VSWR ≤ 1.2 (DC to 3GHz) Insertion loss $\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB Insulation resistance $\geq 5000\text{M}\Omega$ Contact resistance inner conductor $\leq 1\text{m}\Omega$ Contact resistance outer conductor $\leq 1\text{m}\Omega$ Dielectric withstanding voltage (at sea level) 2500 V rms Working voltage (at sea level) 1000 V rms RF leakage $\geq 128\text{dB}$ to 1GHz	
Mechanical Data Recommended coupling nut torque 6 to 10 inch lbs Coupling proof torque 15 inch lbs Contact captivation-axial ≥ 6.3 lbs Durability (mating) ≥ 500	
Environmental Data Temperature range -65°C to +165°C Thermal shock MIL-STD-202, Method 107, Condition B Moisture resistance MIL-STD-202, Method 106 Corrosion MIL-STD-202, Method 101, Condition B RoHS Compliant	
Tooling Crimping tool CRT-1 or CRT-2 Crimp insert INSERT-A	

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N8105B-D179		DATE	2014/04/29	REV	—									
<table><tr><td>A</td><td>B</td><td>C</td></tr><tr><td></td><td></td><td></td></tr><tr><td>BODY + LOCK WASHER + GASKET + HEX NUT</td><td>CONTACT PIN</td><td>FERRULE</td></tr></table>						A	B	C				BODY + LOCK WASHER + GASKET + HEX NUT	CONTACT PIN	FERRULE
A	B	C												
														
BODY + LOCK WASHER + GASKET + HEX NUT	CONTACT PIN	FERRULE												
DIAGRAM			ASSEMBLY INSTRUCTION											
			Step 1: STRIP AS SHOWN.											
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". (USE SQUARE 0.7mm/0.028inch SECTION OF INSERT-A IF CRIMPED)											
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.											
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)											
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.														
APPROVED		CHECKED		DRAWING										
				Albert										

N8105B-D179

