


N8105C-L100/BL

Black Chromium Plated N Jack Crimp
Bulkhead For JBY100,LMR100

50Ω

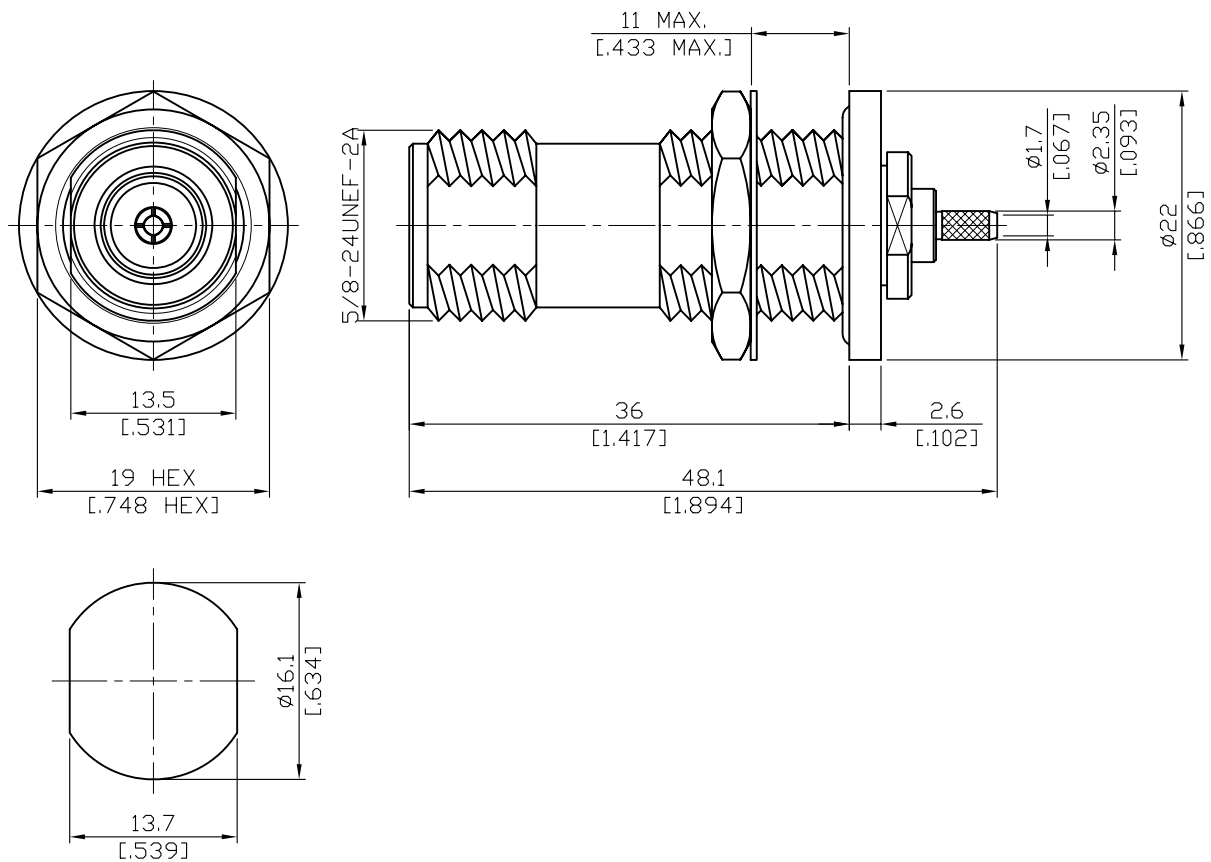

MOUNTING HOLE

Parts	Material	Plating (Micro-inch)
Hex Nut	Brass	Black Chromium 5 Over Copper 50
Lock Washer	Brass	Black Chromium 5 Over Copper 50
Gasket	Silicone	
Crimp Barrel	Brass	Black Chromium 5 Over Copper 50
Insulator	Teflon	
Contact Pin	P.Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Body	Brass	Black Chromium 5 Over Copper 50

Suitable Cables: JBY100 and LMR100

IP67 (Mated)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications demand appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N8105C-L100/BL			DATE	2015/03/09	REV	—
A	B	C	D	E	F	G
BODY+GASKET +LOCK WASHER +HEX NUT			CONTACT PIN	INSULATOR	CRIMP NUT	FERRULE
DIAGRAM			ASSEMBLY INSTRUCTION			
			Step 1: STRIP AS SHOWN.			
			Step 2: SLIDE " G " OVER CABLE. Step 3: LOOSEN BRAIDING AND SLIDE " F " IN PLACE.			
			Step 4: PUT INSULATOR " E " AND CONTACT PIN " D " ON CENTER CONDUCTOR AND SOLDER IN " Y ".			
			Step 5: SLIDE INSULATOR " B " AND FERRULE " C " INTO CONNECTOR BODY " A ".			
			Step 6: SCREW " F " ON THE CONNECTOR BODY " A ' . Step 7: SLIDE FERRULE " G " TOWARDS " F " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.						
APPROVED		CHECKED		DRAWING		
				Albert		