



N8105D-9316

N Jack Crimp For Bulkhead Right Angle 50Ω

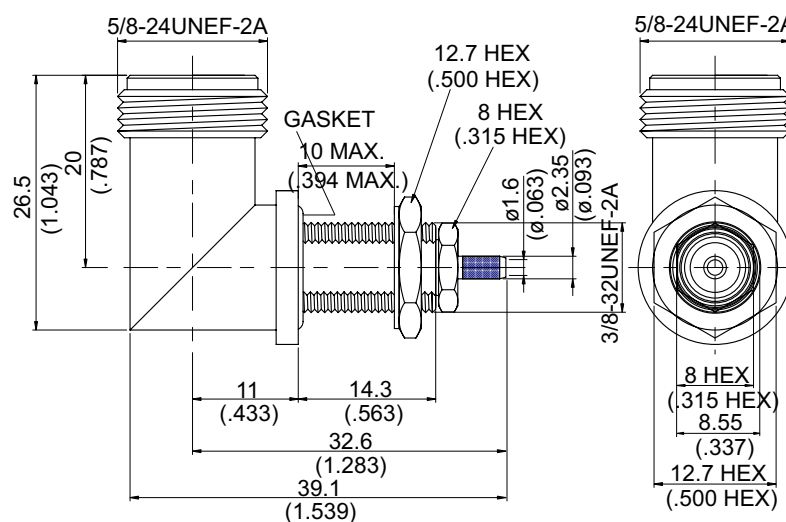

MOUNTING HOLE

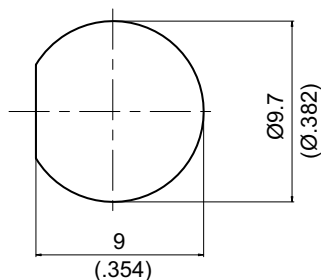

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Lock Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Crimp Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Gasket	Silicon	
Contact Pin	Phosphor Bronze	Gold 5 Over Nickel 50 Over Copper 50
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: RD316,RG316D-E,RD316-FEP,JBY100

IP67(Mated)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N8105D-9316

JYE BAO CO., LTD.

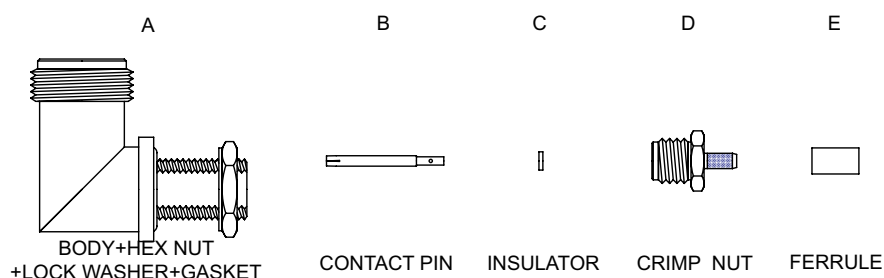


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE "E" OVER CABLE. Step 3: LOOSEN BRAIDING AND SLIDE "D" IN PLACE.
	Step 4: PUT INSULATOR "C" AND CONTACT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y".
	Step 5: SCREW "D" ON THE CONNECTOR BODY "A". Step 6: SLIDE FERRULE "E" TOWARDS "D" AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.