


N8146A-0316

N Jack Crimp For Panel Receptacle

50Ω

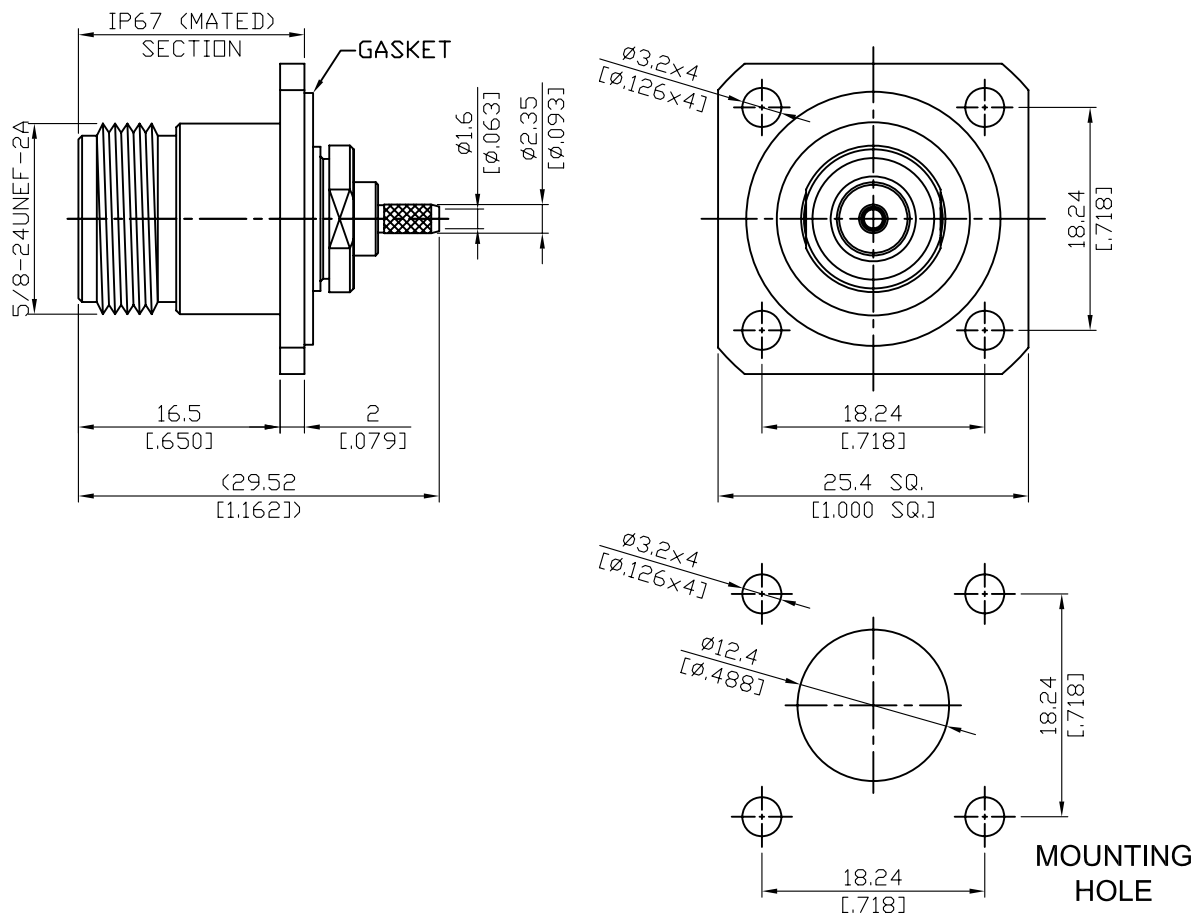

Parts	Material	Plating (Micro-inch)
Gasket	Silicone	
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Solder Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 30.98 g
Suitable Cables: RG174; RG188, RG316; RG316-E; RG316-FEP

IP67 (Mated)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications demand appropriate.

CABLE ASSEMBLY INSTRUCTION

N8146A-0316

JYE BAO CO., LTD.


N8146A-0316

DATE

2014/04/29

REV

—

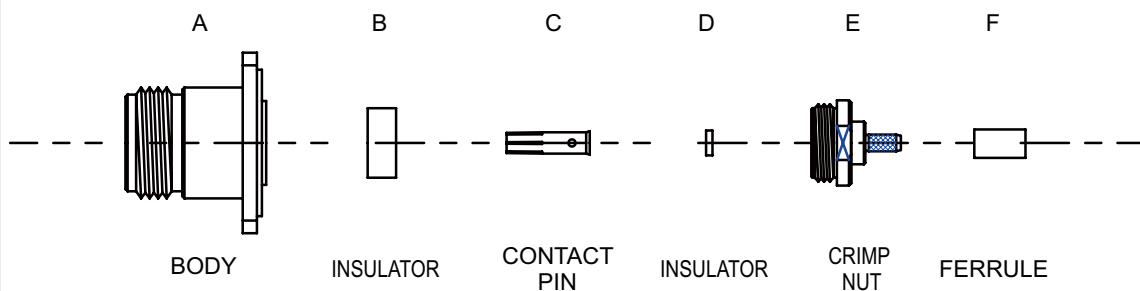


DIAGRAM


ASSEMBLY INSTRUCTION




Step 1: STRIP AS SHOWN.




Step 2: SLIDE FERRULE " F " OVER CABLE.
Step 3: LOOSEN BRAIDING AND SLIDE CRIMP NUT " E " IN PLACE.



Step 4: PUT INSULATOR " D " AND CONTACT PIN " C " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ".
(USE SQUARE 2.4mm/0.094inch SECTION OF INSERT-A IF CRIMPED)

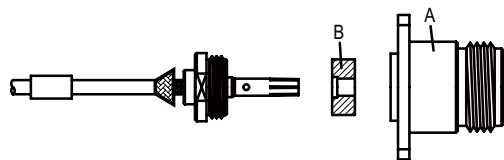

Step 5: SLIDE INSULATOR " B " INTO CONNECTOR BODY " A ".

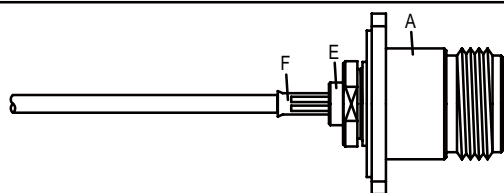

Step 6: SCREW CRIMP NUT " E " ON THE CONNECTOR BODY " A ".
Step 7: SLIDE FERRULE " F " TOWARDS THE CRIMP NUT " E " AND CRIMP.
(USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.