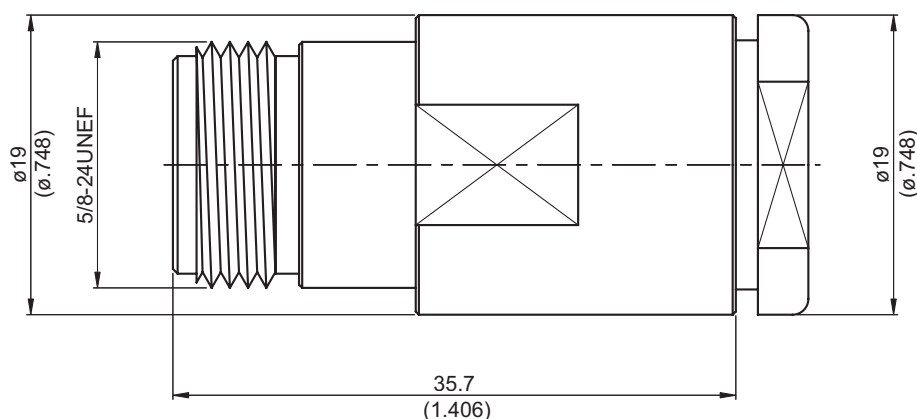


N8200B-0008

N jack clamp for RG8,RG213;
6GHz VSWR 1.2

50Ω



Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 49 g

Suitable Cables: RG8, RG213

This part number complies with RoHS.


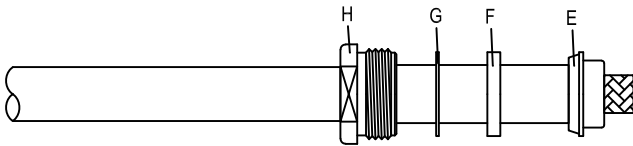
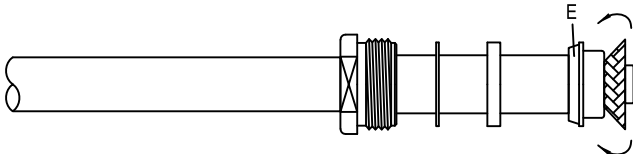
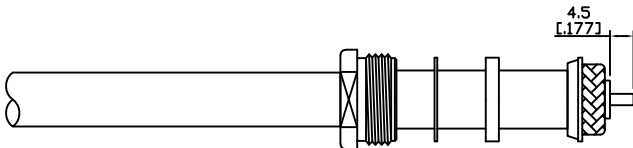
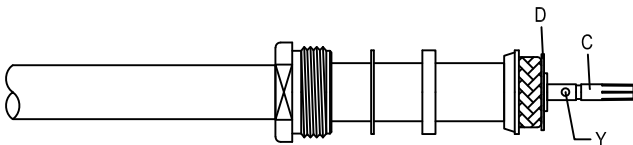
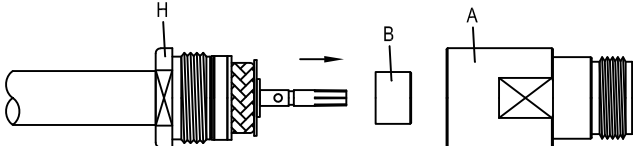
Notice: JYEBAO reserves the right to make modifications deemed appropriate.

N	N8200B-0008																		
Interface MIL-STD-348B																			
Electrical Data <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 6GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 6GHz)</td></tr> <tr> <td>Insertion loss</td><td>$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB</td></tr> <tr> <td>Insulation resistance</td><td>$\geq 5000\text{M}\Omega$</td></tr> <tr> <td>Contact resistance inner conductor</td><td>$\leq 1.5\text{m}\Omega$</td></tr> <tr> <td>Contact resistance outer conductor</td><td>$\leq 1\text{m}\Omega$</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>2500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>1000 V rms</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 6GHz	VSWR	≤ 1.2 (DC to 6GHz)	Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB	Insulation resistance	$\geq 5000\text{M}\Omega$	Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$	Contact resistance outer conductor	$\leq 1\text{m}\Omega$	Dielectric withstanding voltage (at sea level)	2500 V rms	Working voltage (at sea level)	1000 V rms
Impedance	50Ω																		
Frequency range	DC to 6GHz																		
VSWR	≤ 1.2 (DC to 6GHz)																		
Insertion loss	$\leq 0.05 \times \sqrt{f(\text{GHz})}$ dB																		
Insulation resistance	$\geq 5000\text{M}\Omega$																		
Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$																		
Contact resistance outer conductor	$\leq 1\text{m}\Omega$																		
Dielectric withstanding voltage (at sea level)	2500 V rms																		
Working voltage (at sea level)	1000 V rms																		
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>6 to 10 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>15 inch lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.3 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	6 to 10 inch lbs	Coupling proof torque	15 inch lbs	Contact captivation-axial	≥ 6.3 lbs	Durability (mating)	≥ 500										
Recommended coupling nut torque	6 to 10 inch lbs																		
Coupling proof torque	15 inch lbs																		
Contact captivation-axial	≥ 6.3 lbs																		
Durability (mating)	≥ 500																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling <table> <tr> <td>Crimping tool</td><td>CRT-1 or CRT-2</td></tr> <tr> <td>Crimp insert</td><td>INSERT-A</td></tr> </table>		Crimping tool	CRT-1 or CRT-2	Crimp insert	INSERT-A														
Crimping tool	CRT-1 or CRT-2																		
Crimp insert	INSERT-A																		

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N8200B-0008			DATE	2015/07/31		REV	—	
A	B	C	D	E	F	G	H	
								
BODY	INSULATOR	CONTACT PIN	WASHER	BRAID CLAMP	GASKET	WASHER	NUT	
DIAGRAM			ASSEMBLY INSTRUCTION					
			Step 1: STRIP AS SHOWN.					
			Step 2: SLIDE NUT " H " 、 WASHER " G " 、 GASKET " F " AND BRAID CLAMP " E " OVER CABLE.					
			Step 3: WRAP THE BRAIDING OVER " E ".					
			Step 4: STRIP AS SHOWN.					
			Step 5: SLIDE PREPARED CABLE INTO WASHER " D ". Step 6: PUT CONTACT PIN " C " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". (USE SQUARE 2.4mm/0.094inch SECTION OF INSERT-A IF CRIMPED)					
			Step 7: SLIDE INSULATOR " B " INTO CONNECTOR BODY " A ". Step 8: FINALLY SCREW NUT " H " ON THE CONNECTOR BODY " A ".					
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.								
APPROVED			CHECKED			DRAWING		
						Albert		

N8200B-0008

S11

