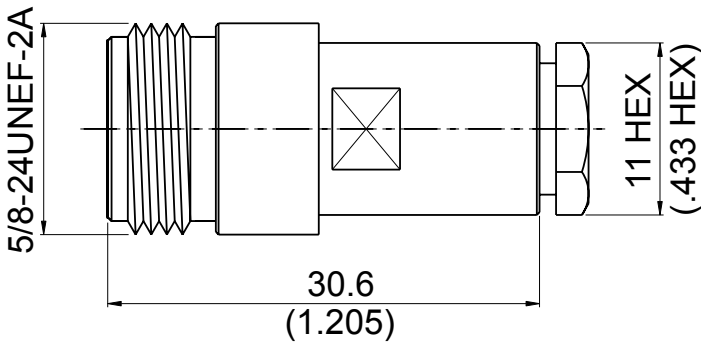


N8200B-0059	N Jack Clamp	75Ω																								
																										
<table border="1"> <thead> <tr> <th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr> </thead> <tbody> <tr> <td>Hex Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Gasket</td><td>Silicon</td><td></td></tr> <tr> <td>Braid Clamp</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Contact Pin</td><td>Phosphor Bronze</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr> <tr> <td>Insulator</td><td>Teflon</td><td></td></tr> <tr> <td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> </tbody> </table>			Parts	Material	Plating (Micro-inch)	Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Contact Pin	Phosphor Bronze	Gold 5 Over Nickel 50 Over Copper 50	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																								
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																								
Gasket	Silicon																									
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																								
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																								
Contact Pin	Phosphor Bronze	Gold 5 Over Nickel 50 Over Copper 50																								
Insulator	Teflon																									
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																								
Weight: 27 g Suitable Cables: RG59																										

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N8200B-0059

JYE BAO CO., LTD.


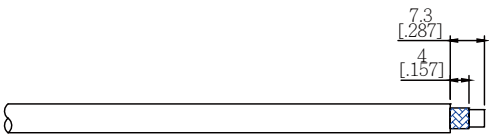




N8200B-0059			DATE	2014/04/29	REV	—
A	B	C	D	E	F	G
						
BODY	CONTACT PIN	WASHER	BRAID CLAMP	GASKET	WASHER	NUT

DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE NUT " G "- WASHER " F "- GASKET " E " AND BRAID CLAMP " D " OVER CABLE. Step 3: WRAP THE BRAIDING OVER " D ".
	Step 4: STRIP AS SHOWN.
	Step 5: SLIDE PREPARED CABLE INTO WASHER " C " . Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y " . (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-A IF CRIMPED)
	Step 7: FINALLY SCREW " G " ON THE CONNECTOR BODY " A ".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.