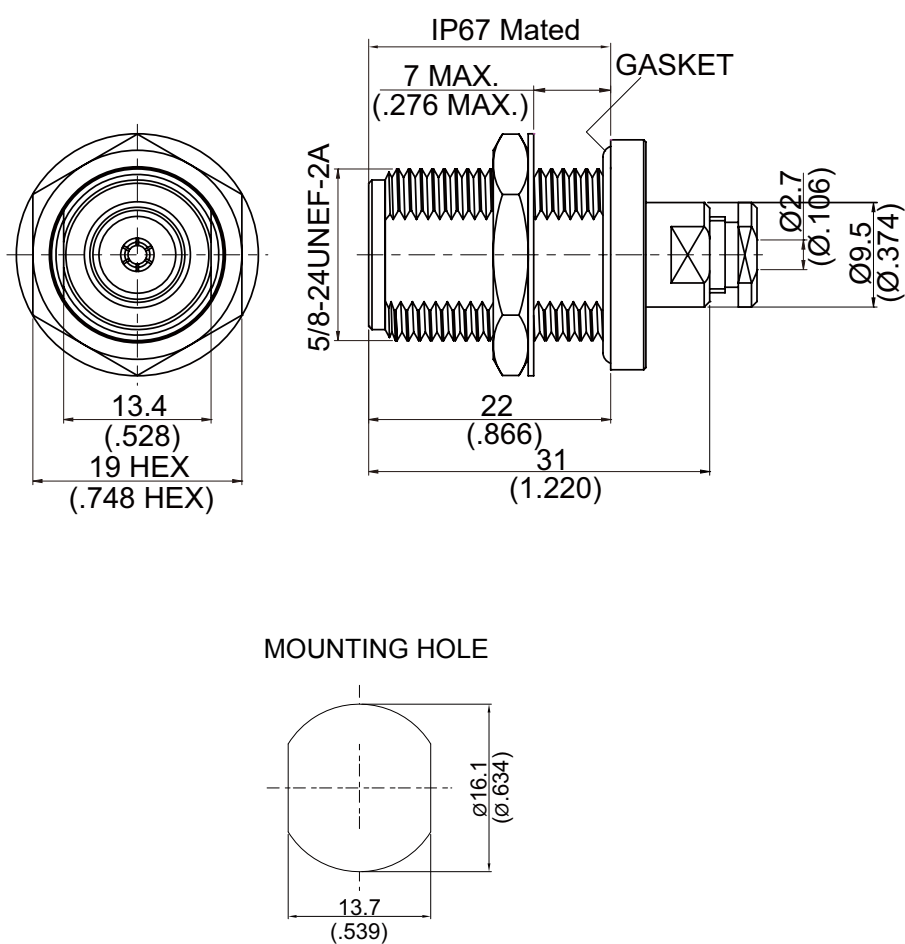


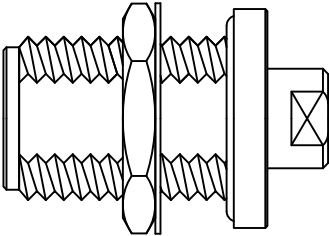




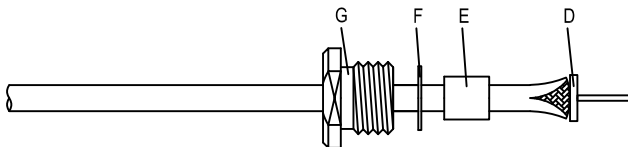
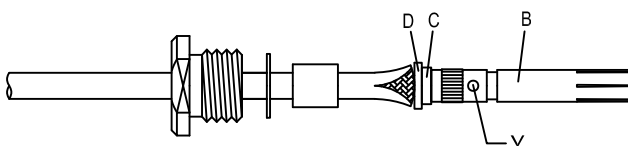
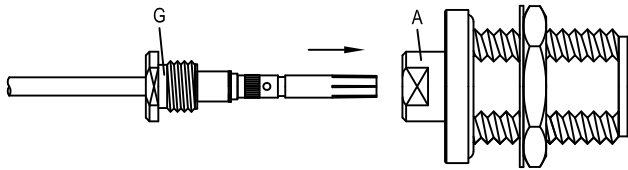
N8205B-0316	N Jack Clamp Bulkhead For RG174,RG188,RG316 IP67 mated, 3GHz VSWR 1.2	50Ω																														
 IP67 Mated 7 MAX. (.276 MAX.) GASKET 5/8-24 UNEF-2A 13.4 (.528) 19 HEX (.748 HEX) 22 (.866) 31 (1.220) Ø2.7 (Ø.106) Ø9.5 (Ø.374) MOUNTING HOLE 13.7 (.539) 16.1 (0.634)																																
<table border="1"> <thead> <tr> <th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr> </thead> <tbody> <tr> <td>Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Gasket</td><td>Silicon</td><td></td></tr> <tr> <td>Top Hat</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Insulator</td><td>Teflon</td><td></td></tr> <tr> <td>Hex Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Barrel</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Contact Pin</td><td>Phosphor Bronze</td><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr> <tr> <td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> </tbody> </table>			Parts	Material	Plating (Micro-inch)	Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Top Hat	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Insulator	Teflon		Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Contact Pin	Phosphor Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																														
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Gasket	Silicon																															
Top Hat	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Insulator	Teflon																															
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																														
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																														
Suitable Cables: RG174,RG188,RG316,RG316-FEP This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.																																

N	N8205B-0316																		
Interface MIL-STD-348B																			
Electrical Data <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 3GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 3GHz)</td></tr> <tr> <td>Insertion loss</td><td>≤ 0.05 x √f(GHz) dB</td></tr> <tr> <td>Insulation resistance</td><td>≥ 5000MΩ</td></tr> <tr> <td>Contact resistance inner conductor</td><td>≤ 1.5mΩ</td></tr> <tr> <td>Contact resistance outer conductor</td><td>≤ 1mΩ</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>2500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>1000 V rms</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 3GHz	VSWR	≤ 1.2 (DC to 3GHz)	Insertion loss	≤ 0.05 x √f(GHz) dB	Insulation resistance	≥ 5000MΩ	Contact resistance inner conductor	≤ 1.5mΩ	Contact resistance outer conductor	≤ 1mΩ	Dielectric withstanding voltage (at sea level)	2500 V rms	Working voltage (at sea level)	1000 V rms
Impedance	50Ω																		
Frequency range	DC to 3GHz																		
VSWR	≤ 1.2 (DC to 3GHz)																		
Insertion loss	≤ 0.05 x √f(GHz) dB																		
Insulation resistance	≥ 5000MΩ																		
Contact resistance inner conductor	≤ 1.5mΩ																		
Contact resistance outer conductor	≤ 1mΩ																		
Dielectric withstanding voltage (at sea level)	2500 V rms																		
Working voltage (at sea level)	1000 V rms																		
Mechanical Data <table> <tr> <td>Recommended coupling nut torque</td><td>6 to 10 inch lbs</td></tr> <tr> <td>Coupling proof torque</td><td>15 inch lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.3 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	6 to 10 inch lbs	Coupling proof torque	15 inch lbs	Contact captivation-axial	≥ 6.3 lbs	Durability (mating)	≥ 500										
Recommended coupling nut torque	6 to 10 inch lbs																		
Coupling proof torque	15 inch lbs																		
Contact captivation-axial	≥ 6.3 lbs																		
Durability (mating)	≥ 500																		
Environmental Data <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
Tooling																			

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N8205B-0316		DATE	2021/08/10	REV	—	
A	B	C	D	E	F	G
						
BODY + HEX NUT + GASKET + WASHER	CONTACT PIN	INSULATOR	TOP HAT	GASKET	WASHER	NUT
		ASSEMBLY INSTRUCTION				
		Step 1: STRIP AS SHOWN.				
		Step 2: MAKE A 3.3MM LONG CUT IN THE JACKET WITHOUT DAMAGING THE BRAIDING.				
		Step 3: SLIDE NUT " G " 、 WASHER " F " AND GASKET " E " OVER CABLE. Step 4: LOOSEN BRAIDING AND SLIDE TOP HAT " D " BETWEEN DIELECTRIC AND BRAIDING.				
		Step 5: SLIDE PREPARED CABLE INTO INSULATOR " C ". Step 6: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".				
		Step 7: FINALLY SCREW " G " ON THE CONNECTOR BODY " A ".				
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.						
APPROVED		CHECKED		DRAWING <i>Albert</i>		

N8205B-0316

S11

